

PAR Automotive Consultancy

Regn. No: 52986974L

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel : 645 31173, Fax : 645 36131.

Report No: 0135-20-TCA

01 September 2020

Kwok Wee Mun
Blk 602 Woodlands Drive 42 #09-61
Singapore 730602

INVOICE No. 0135-20-TCA

Vehicle No. SJU3505L

<u>S/NO.</u>	<u>SERVICES RENDERED</u>	<u>Amount due</u>
1	Being accident vehicle appraisal services, transport, photographs and re-inspection (work in progress and post repair inspection).	\$726.00
	Total amount payable	<u>\$726.00</u>

Kindly cross your cheque in favour of "PAR Automotive Consultancy"

We thank you in anticipation for your prompt payment.

PAR Automotive Consultancy



Report No: 0135-20-TCA

01 September 2020

ACCIDENT VEHICLE SURVEY REPORT

Kwok Wee Mun
Blk 602 Woodlands Drive 42 #09-61
Singapore 730602

VEHICLE INFORMATION:

<i>Vehicle Reg No.:</i>	SJU3505L	<i>Odometer:</i>	102782km
<i>Make & Model:</i>	Toyota Wish 2.0 A	<i>Colour:</i>	Silver
<i>Chassis number:</i>	JTDGJ20W405001456	<i>Date of accident:</i>	08/10/2019
<i>Year of Regn.:</i>	30/11/2009	<i>Date inspected:</i>	10/10/2019
<i>Repairer at:</i>	Twincar Automotive Pte Ltd 2 Kaki Bukit Ave 2 #01-17 Kaki Bukit Auto Hub Singapore 417921	<i>Date inspected (After Repair):</i>	15/10/2019

STATIC CHECKS, where applicable:

<i>Steering :</i>	serviceable
<i>Footbrake :</i>	serviceable
<i>Handbrake :</i>	serviceable
<i>Paintwork :</i>	Good
<i>General condition :</i>	Good

TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
<i>Front:</i>	6mm/Firenza	6mm/Firenza	215/50ZR17
<i>Rear:</i>	6mm/Firenza	6mm/Firenza	215/50ZR17

POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the rear portion.
Please see details as described in the Annex for parts and labour.

REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.

Parts and Labour Assessment

PARTS

Description of part	Qty	Condition	Repairer's estimate	Our adjustment
REAR BUMPER	1	squashed	698.10	698.10
REAR BUMPER REFLECTOR L/R	2	reuse	190.00	0.00
REAR BUMPER SIDE RETAINER L/R	2	necessary	282.90	282.90
REAR END LOWER PANEL	1	buckled	463.20	463.20
REAR END PANEL	1	buckled	591.40	591.40
REAR END PANEL INNER TOP GARNISH	1	fractured	289.90	289.90
REAR EXHAUST GASKET	1	necessary	61.75	61.75
REAR EXHAUST RUBBER MOUNTING	2	distorted	123.40	123.40
REAR EXHAUST SILENCER BOX	1	bent	971.00	971.00
REAR FLOOR PANEL TOP BOARD COVER	1	reuse	498.70	0.00
REAR SPARE TYRE CARRIAGE	1	jammed/bent	328.70	328.70
REAR TAILGATE	1	buckled	1,515.00	1,515.00
REAR TAILGATE 'LOGO' EMBLEM	1	necessary	72.50	72.50
REAR TAILGATE DAMPER L/R	2	reuse	598.20	0.00
REAR TAILGATE HINGES L/R	2	repair	363.00	0.00
REAR TAILGATE INNER PULL HANDLE	1	reuse	131.20	0.00
REAR TAILGATE INNER RUBBER GUIDE STOPPER L/R	2	deformed	87.40	87.40
REAR TAILGATE INNER TRIM BOARD	1	reuse	708.85	0.00
REAR TAILGATE LOCK STRIKER	1	repair	48.30	0.00
REAR TAILGATE MECHANISM LOCK	1	bent	517.10	517.10
REAR TAILGATE NUMBER PLATE LAMP L/R	2	reuse	166.50	0.00
REAR TAILGATE OUTER CHROME HANDLE	1	reuse	313.90	0.00
REAR TAILGATE REFLECTOR L/R	2	reuse	616.60	0.00
REAR TAILGATE WEATHER STRIP	1	deformed	320.00	320.00
REAR TAILGATE WINDSCREEN MOULDING (LOWER)	1	necessary	68.00	68.00
REAR TAILGATE WINDSCREEN MOULDING (TOP)	1	necessary	68.00	68.00
REAR TAILGATE WINDSCREEN MOULDING L/R	2	necessary	220.70	220.70
Subtotal before discount			S\$ 10,314.30	S\$ 6,679.05
Percentage discount 25% and 25%			S\$ 2,578.58	S\$ 1,669.76
Sub-total 1			S\$ 7,735.73	S\$ 5,009.29
REAR BUMPER REVERSE SENSOR - SET	1	shorted	350.00	350.00
REAR END PANEL INNER TOP GARNISH CLIPS - SET	1	necessary	50.00	50.00
REAR FLOOR PANEL INSULATOR MAT	1	necessary	300.00	300.00
REAR TAILGATE INNER TRIM BOARD CLIPS - SET	1	necessary	50.00	50.00
REAR TAILGATE NUMBER PLATE	1	reuse	25.00	0.00
REAR TAILGATE NUMBER PLATE HOLDER	1	reuse	50.00	0.00
REAR TAILGATE OUTER CHROME HANDLE CLIPS - SET	1	necessary	50.00	50.00
REAR TAILGATE WINDSCREEN SEALANT	1	necessary	100.00	100.00
Subtotal before discount			S\$ 975.00	S\$ 900.00
Sub-total 2			S\$ 975.00	S\$ 900.00
Parts-total			S\$ 8,710.73	S\$ 5,909.29

LABOUR

To remove, reinstall electrical wiring harness, check lighting and rewire for parking sensor.	100.00	60.00
To remove, reinstall tailgate windscreen	300.00	150.00
To remove, reinstall roof top trim upholstery, cushion seat, trim garnish, trim liner carpet. (to FR)	140.00	60.00
To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident.	1,200.00	1,100.00
To remove and change exhaust silencer box with pipe, re-align where necessary consistent to the accident.	180.00	120.00
To provide labour, workmanship to change the above damaged bodyparts, repair, re-construct and re-align body structure, body alignments and damaged consistent to the accident.	1,500.00	1,250.00
To apply anti-rust chemical on repaired and replaced panel.	120.00	60.00
To transfer rear tailgate inner trim board, wiper motor, mechanism lock outer handle.	100.00	60.00
	Labour Total	S\$ 3,640.00
	Parts & Labour Total	S\$ 2,860.00
		S\$ 12,350.73
		S\$ 8,769.29

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on Lump Sum repairs is : S\$ 7,500.00 and the recommended number of working days for the repairs is within 8 day(s).



B J Loi (I Eng., MIMI, AIRTE)
Automotive Appraiser

























15/04/2016

15/04/2016

15/04/2016





Report No: 0135-20-TCA

01 September 2020

ACCIDENT VEHICLE SURVEY REPORT

Kwok Wee Mun
Blk 602 Woodlands Drive 42 #09-61
Singapore 730602

VEHICLE INFORMATION:

<i>Vehicle Reg No.:</i>	SJU3505L	<i>Odometer:</i>	102782km
<i>Make & Model:</i>	Toyota Wish 2.0 A	<i>Colour:</i>	Silver
<i>Chassis number:</i>	JTDGJ20W405001456	<i>Date of accident:</i>	08/10/2019
<i>Year of Regn.:</i>	30/11/2009	<i>Date inspected:</i>	10/10/2019
<i>Repairer at:</i>	Twincar Automotive Pte Ltd 2 Kaki Bukit Ave 2 #01-17 Kaki Bukit Auto Hub Singapore 417921	<i>Date inspected (After Repair):</i>	15/10/2019

RE-INSPECTION

We had carried out re-inspection during works in progress and post repair inspection on the above vehicle. Attached in Annex B are the re-inspection photos, showing the work in progress and our re-inspection to the hidden part that were damaged.

REMARKS:

We have inspected the above-mentioned vehicle on a "**Without Prejudice**" basis.























