



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

PRE-REPAIR INSPECTION REPORT

AXA INSURANCE PTE LTD
8 SHENTON WAY #24-01
AXA TOWERSINGAPORE 068811
ATTN: NG STACEY

Ref: CS3/ASM21008775/R1tce2
Date: 13/09/2021
Code: ASM

1. Policy Particulars :- (THIRD PARTY CLAIM)

| | | | |
|---------------------|-----------|-----------------------|------------|
| Insured Veh. | SNB 6588E | Veh. Inspected | SMS 9573A |
| Policy No. | GA571124 | Coverage (\$) | 0.00 |
| Claim No. | S1M03G0J | Excess (\$) | 0.00 |
| Assign From | NG STACEY | Assign Date | 20/08/2021 |

 
2. Vehicle Particulars & Condition

| | | | |
|-------------------------|----------------------------|---------------------|------------|
| Make & Model | SUZUKI SWIFT 1.2XG LIMITED | c.c | 1242 |
| Engine No. | HIDDEN | Year of Reg. | 2020 |
| Chassis No. | ZC83S135451 | Colour | WHITE |
| Odometer | 12586 KM | Steering | IN ORDER |
| Brakes | IN ORDER | Modification | SPORTS RIM |
| General | FAIR | | |

3. Conditions of Tyres

| | Size | Make | Balance |
|-----------------------|------------|-------------|---------|
| R/H Front Tyre | 175/65 R15 | BRIDGESTONE | 5 mm |
| L/H Front Tyre | 175/65 R15 | BRIDGESTONE | 5 mm |
| R/H Rear Tyre | 175/65 R15 | BRIDGESTONE | 5 mm |
| L/H Rear Tyre | 175/65 R15 | BRIDGESTONE | 5 mm |

4. Description of Damages

| | |
|--|---|
| THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. |  |
|--|---|

5. General Information

| | | | |
|-----------------------|---|----------------------------|-------------------------|
| Accident Date | 18/08/2021 | Inspect Date / Time | 23/08/2021 (01:50 PM) |
| Survey held at | SUNDAY PLUS AUTO COMPUTERISED SERVICE CENTRE PTE LTD BLK 4003 ANG MO KIO IND. PARK 1 #01-118 AVE 10, SINGAPORE 569624 | | |

5a. Remarks

| |
|--|
| A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$3,000-\$4,000 |
|--|

5b. Estimate Days of Repair

| | |
|-------------------------------------|-----------------------|
| ESTIMATED NORMAL PERIOD FOR REPAIR: | 4 Working Days |
|-------------------------------------|-----------------------|

Report Ref No. CS3/ASM21008775/R1tce2

Inspected By

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE, MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.