



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. FBJ 2330H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
2	HANDLE BAR @\$309.00	USABLE	618.00	-
1	SET HANDLE BAR END	CUT	80.00	60.00
2	THROTTLE CABLE COMPLETE @\$76.00	CUT	152.00	152.00
2	MIRROR ASSY @\$338.00	CUT	676.00	596.00
2	FRONT WINKER LENS COMPLETE @\$99.00	USABLE	198.00	-
1	WINDSCREEN	USABLE	442.00	-
1	SET UPPER COWLING	CRACKED	1,705.00	980.00
1	HEADLIGHT UNIT	BROKEN	2,013.00	1,445.00
1	FRONT STAY	SERVICEABLE	393.00	-
1	SET FRONT FENDER	TO REPAIR SEE LABOUR	504.00	-
2	AIR DUCT TOP SIDE COVER ASSY @\$108.00	N/S BROKEN	216.00	108.00
2	SET MID COWLING @\$1687.00	BROKEN / CUT	3,374.00	2,210.00
2	MID COWLING LAYER @\$125.00	GRAZED / CUT	250.00	250.00
2	SET UNDER COWLING @\$912.00	GRAZED / CUT	1,824.00	1,040.00
1	BRAKE PEDAL	CUT / BENT	228.00	130.00
1	FRONT STEP ASSY RH	CUT	173.00	120.00
1	REAR STEP ASSY RH	CUT	157.00	110.00
1	MUFFLER COVER	CUT	169.00	169.00
1	MUFFLER GUARD COMPLETE	NOT NECESSARY	601.00	-
1	MUFFLER ASSY	DENTED	3,192.00	2,200.00
	LESS 10% DISCOUNT		-1,696.50	-957.00
			15,268.50	8,613.00
<u>SPECIAL NETT ITEMS</u>				
1	SET STEERING CONE & BEARING (SN) (50%)	NECESSARY	212.00	106.00
1	HANDLE GUARD (SN)	CRACKED	312.00	120.00
1	ENGINE COVER SET, GB RACING (SN)	CUT	486.00	320.00
			1,010.00	546.00
<u>LABOUR</u>				
	TOWING FEE.		80.00	40.00

Report Ref No. CS3/AIG20008852/R1f3e2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPAIR FORKS & ALIGN STEERING COMPONENTS.		200.00	80.00
	RESPRAY SCRATCHED FUEL TANK.		350.00	150.00
	RENEW DAMAGED PARTS & REPAIR AFFECTED AREAS. INCLUSIVE OF THE REPAIR OF 1 SET FRONT FENDER.		500.00	350.00
			1,130.00	620.00
GRAND TOTAL			17,408.50	9,779.00
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				7,800.00

Report Ref No. CS3/AIG20008852/R1tf3e2-1

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.