

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/AIG21008902/VEA3Q2
Date: 13/12/2021**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1800070145
Claimant Vehicle No :	SH6238A	Insured Vehicle No :	SMA9752U
Date of Loss:	24/08/2021	Nature of Claim:	TP
		Claim No:	7368024660SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SH6238A	Engine No:	D4FDFU596806
Make & Model:	HYUNDAI I40, 1.7 L CRDI AT ABS AIRBAG 4DR (A)	Chassis No:	KMHLB41UMGU085811
Reg. Date:	24/03/2016 (Man. Year: 2015)	Odometer:	593910 km
Colour:	Blue		
Engine Capacity:	1685 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	205/60 R16	Rear Tyre Size:	205/60 R16
Front Left Side:	Hankook 5 mm	Rear Left Side:	Hankook 5 mm
Front Right Side:	Hankook 5 mm	Rear Right Side:	Hankook 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,520.50	1,338.10	182.40	12.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	720.00	580.00	140.00	19.44
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	2,240.50	1,918.10	322.40	14.39
Approved Total (Overridden) (S\$)		1,550.00		

(S\$)	2,240.50	1,550.00	690.50	30.82
+ GST 7.00/7.00% (S\$)	156.84	108.50	48.34	30.82
Nett Amount (S\$)	2,397.34	1,658.50	738.84	30.82
+ Loss of Use (1.5 x S\$50.00/day) (S\$)		75.00		
+ Car Rental (1.5 x S\$114.95/day) (S\$)		172.43		
+ Doc/Search Fee (S\$)		2.00		
Nett Liability (S\$)		1,907.93		
Global Sum Settlement (S\$)		1,900.00		

INSPECTION

Date of Assignment: 24/08/2021

Date Inspected: 24/08/2021

Estimated Period of Repair: 2.0 days

Inspected At:

ComfortDelGro Engineering Pte Ltd (Loyang)
 59 Loyang Drive
 Singapore 508969

Adjuster: Thevan Thomas Karthikesavan**Manager:** Asher Sng Rong Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Cut	1,106.00 FL	*1,106.00 FL
2	1		*REAR BUMPER UNDER COVER	Repair	228.00 FL	*- FL
3	10		*REAR BUMPER CLIPS	Necessary	22.00 FL	*22.00 FL
4	2		*REAR FENDER ADV STICKER RH/LH	Necessary	200.00 FS	*200.00 FS
5	1		*REAR BUMPER ADV .STICKER	Necessary	50.00 FS	*50.00 FS
6	1		*REVERSE SENSORS	Cut	135.70 FS	*135.70 FS
7	1		*REAR BUMPER MAT	Necessary	50.00 FS	*50.00 FS
						F=Franchise part. S=SpcNett. L=ListItemDisc.
					Sub Total (\$\$)	1,791.701,563.70
					- List Item Discount on L Items 20.00/20.00% (\$\$)	271.20225.60
					Total Parts (\$\$)	1,520.501,338.10

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	PANEL BEATING	New	300.00	280.00
2	SPRAY PAINTING CHARGE	New	300.00	250.00
3	R/I REVERSE SENSORS	New	120.00	50.00
Gross Labour Cost (\$\$)			720.00	580.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >