



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2204418

INV Date 19/07/2022

Reference CC4/LPC21009043/Gea3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SHD 1352L
Insured Veh. YN 7214J
Claim No. 20/21/21/VC00/024888
Policy No. Z/20/VC00/109438
Accident Date 24/08/2021
Inspection Date 27/08/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC21009043/Gea3q2 Date: 19/07/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	YN 7214J	Veh. Inspected	SHD 1352L
	Policy No.	Z/20/VC00/109438	Coverage (\$)	0.00
	Claim No.	20/21/21/VC00/024888	Excess (\$)	0.00
	Assign From	ONG LI LI	Assign Date	27/08/2021
2. Vehicle Particulars & Condition				
	Make & Model	HYUNDAI I30	c.c	1582
	Engine No.	HIDDEN	Year of Reg.	2017
	Chassis No.	TMAD281UVHJ119103	Colour	SILVER
	Odometer	340164 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	205/65 R16	MAXXIS	6 mm
	L/H Front Tyre	205/65 R16	MAXXIS	6 mm
	R/H Rear Tyre	205/65 R16	MAXXIS	6 mm
	L/H Rear Tyre	205/65 R16	MAXXIS	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S & N/S BODY.THE UNDERCARRIAGE AFFECTED DUE TO COLLISION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	24/08/2021	Inspection Date	27/08/2021
	Survey held at	PREMIER AUTOMOTIVE SERVICES PTE LTD 23 CHANGI SOUTH AVENUE 2 #01-02 SINGAPORE 486443		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 1352L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	DISTORTED	811.11	811.11
1	FRONT BUMPER EMBLEM	NOT NECESSARY	27.80	-
2	FRONT BUMPER N/S & O/S SIDE BRACKET @\$32.51	CUT	65.02	65.02
1	FRONT BUMPER O/S UPPER BRACKET	BENT	92.60	92.60
1	FRONT BUMPER O/S SUPPORT BRACKET	BENT	37.01	37.01
1	FRONT BUMPER O/S FOG LIGHT GARNISH	NOT NECESSARY	25.00	-
1	FRONT O/S FOG LAMP	NOT NECESSARY	840.90	-
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	636.40	-
1	BONNET	BENT	1,220.40	1,220.40
1	SUPPORT PANEL	BROKEN	1,292.20	1,292.20
1	FRONT O/S HEAD LAMP	CRACKED	1,531.57	1,531.57
1	FRONT O/S FENDER	BUCKLED	514.02	514.02
1	FRONT O/S FENDER INNER SHIELD	TORN	176.72	176.72
1	FRONT O/S FENDER SIGNAL LAMP	CUT	32.10	32.10
1	O/S MIRROR ASSY	DISTORTED	742.49	742.49
1	FRONT O/S DOOR	BUCKLED	1,723.60	1,723.60
2	FRONT O/S HINGES @\$36.10	BENT	72.20	72.20
1	WASHER TANK	DEFORMED	51.40	51.40
1	WASHER TANK MOTOR	NOT NECESSARY	75.00	-
1	FRONT O/S MUD FLAP	CUT	47.45	47.45
2	FRONT N/S & O/S RIM @\$246.00	CUT	492.00	492.00
2	FRONT N/S & O/S LOWER ARM @\$811.34	DAMAGED	1,622.68	1,622.68
2	FRONT N/S & O/S SHOCK ABSORBER @\$611.56	NOT NECESSARY	1,223.12	-
2	FRONT N/S & O/S TIE ROD END @\$72.50	NOT NECESSARY	145.00	-
2	FRONT N/S & O/S BALL JOINT @\$91.90	NOT NECESSARY	183.80	-
2	FRONT N/S & O/S KNUCKLE ARM @\$873.88	DAMAGED	1,747.76	1,747.76
2	FRONT N/S & O/S KNUCKLE BEARING @\$349.60	NOT NECESSARY	699.20	-
2	FRONT N/S & O/S STABILIZER LINK @\$88.50	NOT NECESSARY	177.00	-
	LESS 20% DISCOUNT		-3,261.11	-2,454.47
			13,044.44	9,817.86

Report Ref No. CC4/LPC21009043/Gea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	48.00	48.00
1	FRONT O/S FENDER STICKER (SN)	NECESSARY	30.00	30.00
1	SET FRONT O/S FENDER INNER SHIELD CLIPS (SN)	NECESSARY	28.00	28.00
1	SET O/S DOOR STICKERS (SN)	NECESSARY	100.00	100.00
2	TYRE @\$200.00 (SN)	CUT	400.00	200.00
1	SUNDRY (SN)	NOT NECESSARY	50.00	-
			656.00	406.00
	<u>LABOUR</u>			
	TOWING FEE.		50.00	50.00
	TO CHECK FRONT O/S WHEEL ALIGNMENT.		80.00	60.00
	TO ADJUST /FOCUS FRONT N/S & O/S HEAD LAMPS.		80.00	30.00
	TO DISMANTLE /REFIT THE FRONT N/S & O/S UNDERCARRIAGE.		500.00	300.00
	TO TOP UP AIRCON GAS.		120.00	120.00
	TO DISMANTLE /REFIT THE INNER GARNISHES INNER LININGS ,INNER TRIMS ,CUSHION SEAT ,CARPET ETC TO FACILITATE REPAIRS.	NOT NECESSARY	180.00	-
	TO DISMANTLE & REFIT THE INNER COMPONENTS OF THE FRONT O/S DOOR INTO THE NEW SHELL DOOR.		150.00	60.00
	TO LABOUR CHARGE FOR DISMANTLE AND RENEW THE ACCIDENT DAMAGED PARTS .INCLUDING KNOCK-OUT STRAIGHTEN REPAIR,RESHAPE AND ADJUST OF THE FRONT O/S WHEEL HOUSE ,REAR O/S DOOR.		1,000.00	720.00
	TO PUTTY AND SPRAY PAINTING ON FRONT BUMPER ,FRONT O/S FENDER,FRONT O/S WHEEL HOUSE ,FRONT O/S DOOR ,REAR O/S DOOR ,O/S ROCKER PANEL.		1,200.00	1,100.00
	TO APPLY RUSTPROOFING ON THE REPAIRED AND REPLACED PANELS.		150.00	60.00
			3,510.00	2,500.00
	GRAND TOTAL		17,210.44	12,723.86



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			10,200.00
---	--	--	------------------

Report Ref No. CC4/LPC21009043/Gea3q2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 1352L

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 1352L

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 1352L

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

