

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG21009102/UGA3Q2**Date:** 13/01/2022REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1800108378
Claimant Vehicle No :	SKG1909E	Insured Vehicle No :	SMD8675A
Date of Loss:	28/08/2021	Nature of Claim:	TP
		Claim No:	7438424959SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKG1909E		
Make & Model:	JAGUAR XF, 2.2 I4D AUTO ABS D/AB 2WD 4DR HID TC (A)	Engine No:	4045653224DT
Reg. Date:	30/03/2015 (Man. Year: 2014)	Chassis No:	SAJAC05K9FDU58922
Colour:	Grey	Odometer:	112873 km
Engine Capacity:	2179 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	245/45 R18	Rear Tyre Size:	245/45 R18
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,638.00	1,758.65	3,879.35	68.81
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,010.00	500.00	510.00	50.50
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	6,648.00	2,258.65	4,389.35	66.03
Approved Total (Overridden) (S\$)		1,800.00		
(S\$)	6,648.00	1,800.00	4,848.00	72.92
+ GST 7.00/7.00% (S\$)	465.36	126.00	339.36	72.92
Nett Amount (S\$)	7,113.36	1,926.00	5,187.36	72.92
+ Car Rental (2.0 x S\$120.00/day) (S\$)		240.00		
Nett Liability (S\$)		2,166.00		
Global Sum Settlement (S\$)		2,100.00		

INSPECTION

Date of Assignment:	30/08/2021	
Date Inspected:	30/08/2021	Inspected At: Fastech Auto Pte Ltd (HQ) 1 Kaki Bukit Ave 6, #01-46/48/50 Autobay Singapore 417883
Estimated Period of Repair:	2.0 days	

Adjuster: MARCUS CHUA**Manager:** Chong Pui Lin

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Repair	3,250.00 F	*- FL
2	1		*SET FRONT BUMPER CLIPS	Necessary	50.00 F	*50.00 FL
3	1		*FRONT BUMPER PDC SENSOR	Damaged	268.00 F	*252.00 FL
4	1		*FRONT GRILLE	Cracked	1,820.00 F	*1,465.00 FL
5	1		*FRONT GRILLE LOGO	Not Necessary	150.00 F	*- FL
6	1		*FRONT LICENCE PLATE W/GARNISH	Scratched	100.00 FS	*80.00 FS
					Sub Total (S\$)	5,638.00 1,847.00
					- List Item Discount on L Items 0.00/5.00% (S\$)	0.00 88.35
					Total Parts (S\$)	5,638.00 1,758.65

F=Franchise part. S=SpcNett. L=ListItemDisc.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CHECK WIRING }	New	50.00	50.00
2	TO DISMANTLE & REPLACED FRONT PDC SENSOR }	New	80.00	0.00
3	LABOUR FOR PANEL BEATING & REPLACED PARTS	New	380.00	250.00
4	TO PUTTY & SPRAY PAINTING	New	500.00	200.00
Gross Labour Cost (\$\$)			1,010.00	500.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >