

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/AIG21009162/VGA3Q2**Date:** 05/01/2022REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2100450373
Claimant Vehicle No :	SHA1029L	Insured Vehicle No :	SGD6181S
Date of Loss:	29/08/2021	Nature of Claim:	TP
		Claim No:	8437588543SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHA1029L		
Make & Model:	HYUNDAI I40, 1.7 D CRDI F/L ABS AIRBAG 4DR (A)	Engine No:	D4FDEU419927
Reg. Date:	12/05/2016 (Man. Year: 2016)	Chassis No:	KMHLB41UMGU090026
Colour:	Blue	Odometer:	682583 km
Engine Capacity:	1685 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/60 R16	Rear Tyre Size:	205/60 R16
Front Left Side:	West Lake 5 mm	Rear Left Side:	West Lake 5 mm
Front Right Side:	West Lake 5 mm	Rear Right Side:	West Lake 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,296.10	828.10	468.00	36.11
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,040.00	590.00	450.00	43.27
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	2,336.10	1,418.10	918.00	39.30
Approved Total (Overridden) (S\$)		1,150.00		
(S\$)	2,336.10	1,150.00	1,186.10	50.77
+ GST 7.00/7.00% (S\$)	163.53	80.50	83.03	50.77
Nett Amount (S\$)	2,499.63	1,230.50	1,269.13	50.77
+ Loss of Use (3.0 x S\$50.00/day) (S\$)		150.00		
+ Car Rental (3.0 x S\$114.95/day) (S\$)		344.85		
+ Doc/Search Fee (S\$)		7.49		
Nett Liability (S\$)		1,732.84		
Global Sum Settlement (S\$)		1,700.00		

INSPECTION

Date of Assignment:	31/08/2021	
Date Inspected:	31/08/2021	Inspected At: ComfortDelGro Engineering Pte Ltd (Loyang) 59 Loyang Drive Singapore 508969
Estimated Period of Repair:	2.0 days	

Adjuster: Thevan Thomas Karthikesavan**Manager:** Chong Pui Lin

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER COVER	Deformed	1,106.00 FL	*553.00 FL
2	10		*REAR BUMPER CLIPS	Necessary	22.00 FL	*22.00 FL
3	2		*REAR BUMPER REFLECTOR /RH	Serviceable	32.00 FL	*- FL
4	1		*REAR BUMPER UNDER COVER	Scratched	228.00 FL	*228.00 FL
5	1		*REAR REVERSE SENSOR	Cut	135.70 FS	*135.70 FS
6	1		*REAR REVERSE PROTECTOR	Scratched	50.00 FS	*50.00 FS
					Sub Total (\$)	1,573.70
					- List Item Discount on L Items 20.00/20.00% (\$)	277.60
					Total Parts (\$)	1,296.10

F=Franchise part. S=SpcNett. L=ListItemDisc.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING	New	560.00	280.00
2	SPRAY PAINTING CHARGE	New	300.00	250.00
3	REMOVE/REFIX REVERSE SENSOR	New	60.00	20.00
4	TUFF KOTE	New	60.00	20.00
5	CHECK LIGHTING & WIRING	New	60.00	20.00
Gross Labour Cost (\$)			1,040.00	590.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >