

PAR Automotive Consultancy

Regn. No: 52986974L

Mailing Address : Blk 310 Shunfu Road #07-213, Singapore 570310. Tel : 64531173, Fax : 64536131.
Consultants: Vehicle appraisal & inspection, accident investigation, expert witness

Report No: 0040-21-HLm

30 June 2021

ACCIDENT VEHICLE SURVEY REPORT

Oh Jie Xiang
c/o 160 Sin Ming Drive #05-17 Sin Ming Autocity
Singapore 575722

VEHICLE INFORMATION:

Vehicle Reg No.:	SMQ7349E	Odometer:	034688km
Make & Model:	Honda Fit Hybrid 1.5 Auto	Colour:	Yellow
Chassis number:	GP51340296	Date of accident:	10/02/2021
Year of Regn.:	29/11/2019	Date inspected:	23/02/2021
Repairer at:	Hiap Lek Automobile Trading	Date inspected (After Repair):	01/03/2021
	160 Sin Ming Drive #05-17 Sin Ming Autocity		
	Singapore 575722		

STATIC CHECKS, where applicable:

Steering :	serviceable
Footbrake :	serviceable
Handbrake :	serviceable
Paintwork :	Good
General condition :	Good

TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
Front:	5mm/Yokohama	5mm/Yokohama	185/60R15
Rear:	5mm/Yokohama	5mm/Yokohama	185/60R15

POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the LH portion.
Please see details as described in the Annex for parts and labour.

REMARKS:

We have inspected the above-mentioned vehicle on a "**Without Prejudice**" basis.

Parts and Labour Assessment

Report No: 0040-21-HLm

Vehicle No: SMQ7349E

Description of part	Qty	Condition as inspected	Repairer's estimate	Our adjustment
Front door LH	1	buckled	851.10	851.10
Front door glass outer moulding LH	1	deformed	58.00	58.00
Front door outer handle LH	1	fractured	85.00	85.00
Front door inner lock LH	1	bent	233.70	233.70
Front door outer garnish vertical LH	1	necessary	36.00	36.00
Front door window regulator c/w motor LH	1	bent/shorted	405.30	405.30
Front door window channel LH	1	bent	68.80	68.80
Rear door LH	1	buckled	865.00	865.00
Rear door door outer moulding LH	1	necessary	53.30	53.30
Rear door checker LH	1	bent	74.50	74.50
Rear door inner lock LH	1	bent	231.20	231.20
Rear door garnish vertical rear LH	1	necessary	30.00	30.00
<i>Subtotal before discount</i>			2,991.90	2,991.90
<i>Percentage discount 0% and 20%</i>			0.00	598.38
Sub-total 1			2,991.90	2,393.52
Front door speaker LH	1	distortion	150.00	150.00
<i>Subtotal before discount</i>			150.00	150.00
<i>Percentage discount 0% and 0%</i>			0.00	0.00
Sub-total 2			150.00	150.00
Parts-total			3,141.90	2,543.52
LABOUR				
1. To straighten and panel beating and rear LH fender, centre pillar LH and LH frame members. To remove, transfer and refit LH front and rear door components.			900.00	750.00
2. To putty, re-spray painting and polish affected areas.			840.00	660.00
3. To check and rectify wiring system.			80.00	50.00
4. To rust proof affected areas.			120.00	60.00
Labour total			1,940.00	1,520.00
Parts & Labour total			5,081.90	4,063.52

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on LUMP SUM repairs is : **\$3,400.00**
and the recommended number of working days for the repairs is : **4**



B J Loi (I Eng. MIMI, AJRTE)

Automotive Appraiser







































