

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI21009408/KUCN2**Date:** 22/11/2021**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMHCSNW00007722100

Claimant Vehicle No : SNA3005X **Insured Vehicle No :** SMX5894Z

Date of Loss: 01/09/2021 Nature of Claim: TP Claim No: SNM21D204943/C02/TOHHS

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SNA3005X**

Make & Model: TOYOTA COROLLA ALTIS, 1.6 Standard (AUTO) (2WD) (A) Engine No: 1ZR0G36650

Reg. Date: 16/06/2021 (Man. Year: 2020) Chassis No: MR2BE3BE800011986

Colour: Metallic Silver Odometer: 6000 km

Engine Capacity: 1598 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 205/55R16 Rear Tyre Size: 205/55R16

Front Left Side: Bridgestone 9 mm Rear Left Side: Bridgestone 9 mm

Front Right Side: Bridgestone 9 mm Rear Right Side: Bridgestone 9 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,347.06	4,417.79	929.27	17.38
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,320.00	1,660.00	660.00	28.45
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	7,667.06	6,077.79	1,589.27	20.73
+ GST 7.00/7.00% (S\$)	536.69	425.45	111.24	20.73
Nett Amount (S\$)	8,203.75	6,503.24	1,700.51	20.73

INSPECTION

Date of Assignment: 07/09/2021

Date Inspected: 07/09/2021 Inspected At: Comfortdelgro Engineering Pte Ltd (HQ)
205 BRADDELL ROAD
Singapore 579701

Estimated Period of Repair: 7.0 days

Adjuster: KENNETH KONG**Manager:** Tan Hui Zhen

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 20 Nov 2021)

Parts: 143 TOYOTA COROLLA ALTIS 1.6 Standard (AUTO)(2WD) (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SNA3005X)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BOOTLID	Bent	890.00 FL	*890.00 FL
2	1		*BOOTLID LOCK	Dented	256.00 FL	*256.00 FL
3	1		*BOOTLID INNER TRIM	Distorted	260.00 FL	*260.00 FL
4	1		*BOOTLID LAMP LH	Serviceable	300.00 FL	*- FL
5	1		*BOOTLID LAMP RH	Serviceable	300.00 FL	*- FL
6	1		*BOOTLID LOGO	Necessary	60.00 FL	*60.00 FL
7	1		*BOOTLID EMBLEM COROLLA	Necessary	79.00 FL	*79.00 FL
8	1		*BOOTLID EMBLEM ALTIS	Necessary	79.00 FL	*79.00 FL
9	1		*BOOTLID HINGE LH	Repair	135.00 FL	*- FL
10	1		*BOOTLID HINGE RH	Repair	135.00 FL	*- FL
11	1		*BOOTLID CHROME	Serviceable	234.00 FL	*- FL
12	1		*TAILLAMP LH	Cut	345.00 FL	*345.00 FL
13	1		*TAILLAMP RH	Cut	345.00 FL	*345.00 FL
14	1		*REAR BUMPER	Bent	434.00 FL	*434.00 FL
15	1		*REAR BUMPER SIDE RETAINER LH	Cracked	104.00 FL	*104.00 FL
16	1		*REAR BUMPER SIDE RETAINER RH	Distorted	104.00 FL	*104.00 FL
17	1		*REAR BUMPER SENSOR HOLDER X2 (NPA)	Not Necessary	0.00 FL	*- FL
18	1		*REAR BUMPER UNDER COVER	Cracked	455.00 FL	*455.00 FL
19	6		*REAR BUMPER CLIPS	Necessary	30.00 FL	*30.00 FL
20	1		*REAR BUMPER TOW COVER	Dented	45.00 FL	*45.00 FL
21	1		*REAR END PANEL	Bent	533.00 FL	*533.00 FL
22	1		*REAR END PANEL TOP GARNISH	Distorted	278.00 FL	*278.00 FL
23	1		*SPARE TYRE TOP BOARD	Deformed	545.00 FL	*545.00 FL
24	1		*TAILLAMP SIDE COVER LH	Dented	79.54 FL	*79.54 FL
25	1		*TAILLAMP SIDE COVER RH	Dented	79.54 FL	*79.54 FL
26	1		*TAILLAMP LOWER BRACKET RH	Distorted	79.54 FL	*79.54 FL
27	1		*TAILLAMP SIDE CLIP LH	Cracked	10.00 FL	*10.00 FL
28	1		*TAILLAMP SIDE CLIP RH	Cracked	10.00 FL	*10.00 FL
29	1		*BOOTLID WEATHER STRIP	Dented/Cut	244.32 FL	*244.32 FL
30	1		*REAR BUMPER REINFORCEMENT	Bent	287.14 FL	*287.14 FL
31	1		*REAR BUMPER SENSOR X2	Shorted	250.00 FS	*148.73 FS
32	1		*REAR NUMBER PLATE	Dented	45.00 FS	*45.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	7,031.08	5,825.81
- List Item Discount on L Items 25.00/25.00% (\$)	1,684.02	1,408.02
Total Parts (\$)	5,347.06	4,417.79

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CUT WELD END PANEL,PANEL BEAT ON REAR AFFECTED AREAS,REPLACE DAMAGE PARTS AND REALIGNMENT	New	1,000.00	750.00
2	TO PUTTY,RESPRAY BOOTLID,END PANEL,BUMPER,FENDERS,TYRE WELL AND AFFECTED AREAS	New	1,000.00	750.00
3	CHECK LIGHTING AND WIRING	New	50.00	20.00
4	TUFF KOTE REAR AFFECTED AREAS	New	120.00	60.00
5	REMOVE INTERIOR UPHOLSTERY TO ASSIST REPAIR AND REFIT	New	150.00	80.00
Gross Labour Cost (\$)			2,320.00	1,660.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >