

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI21009444/BTCN2**Date:** 17/09/2021**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMPCSNW00088612101

Claimant Vehicle No : SLL3354D **Insured Vehicle No :** SLN5644T

Date of Loss: 01/09/2021 Nature of Claim: TP Claim No: SNM21D204949/C02/LEWLC

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLL3354D**

Make & Model: TOYOTA COROLLA ALTIS, 1.6 (A) Engine No: 3ZZ4955497

Reg. Date: 13/04/2010 (Man. Year: 2009) Chassis No: MR053ZEE106162452

Colour: Silver Odometer: 153799 km

Engine Capacity: 1598 cc

Market Value/New Car Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195/65R15 Rear Tyre Size: 195/65R15

Front Left Side: Yokohama 4 mm Rear Left Side: Yokohama 4 mm

Front Right Side: Yokohama 4 mm Rear Right Side: Yokohama 4 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	4,447.82	3,744.24	703.58	15.82
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,240.00	1,320.00	920.00	41.07
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	6,687.82	5,064.24	1,623.58	24.28
Approved Total (Overridden) (\$\$)		4,050.00		
(\$\$)	6,687.82	4,050.00	2,637.82	39.44
+ GST 7.00/7.00% (\$\$)	468.15	283.50	184.65	39.44
Nett Amount (\$\$)	7,155.97	4,333.50	2,822.47	39.44

INSPECTION

Date of Assignment: 08/09/2021

Date Inspected: 08/09/2021 Inspected At: Bifrost Auto Pte Ltd (Kaki Bukit)
8 Kaki Bukit Ave 4, #01-49, Premier @ Kaki Bukit
Singapore 415875

Estimated Period of Repair: 6.0 days

Adjuster: Lim Teow Guan**Manager:** DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 17 Sep 2021)
Parts:	143	TOYOTA COROLLA ALTIS 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLL3354D)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BOOTLID	Dented	909.70 FL	*813.00 FL
2	1		*BOOTLID 1.6 EMBLEM	Necessary	23.93 FL	*23.93 FL
3	1		*BOOTLID CENTRE EMBLEM	Necessary	45.67 FL	*45.67 FL
4	1		*BOOTLID COROLLA EMBLEM	Necessary	48.34 FL	*48.34 FL
5	1		*BOOTLID ALTIS EMBLEM	Necessary	45.67 FL	*45.67 FL
6	1		*BOOTLID LOCK	Jammed	126.80 FL	*126.80 FL
7	1		*BOOTLID LOCK CATCH	Not Damaged	28.30 FL	*- FL
8	1		*BOOTLID WEATHERSTRIP	Not Damaged	194.70 FL	*- FL
9	1		*REAR BUMPER	Dented	523.90 FL	*459.75 FL
10	1		*REAR BUMPER INNER SPONGE	Broken	175.70 FL	*125.00 FL
11	1		*REAR BUMPER RH SIDE RETAINER (LONG)	Necessary	57.80 FL	*57.80 FL
12	1		*REAR BUMPER LH SIDE RETAINER (LONG)	Necessary	57.80 FL	*57.80 FL
13	1		*REAR BUMPER RH SIDE RETAINER (SHORT)	Not Damaged	46.95 FL	*- FL
14	1		*REAR BUMPER LH SIDE RETAINER (SHORT)	Not Damaged	46.95 FL	*- FL
15	1		*REAR BUMPER RH REFLECTOR	Broken	47.77 FL	*47.77 FL
16	1		*REAR BUMPER LH REFLECTOR	Broken	47.77 FL	*47.77 FL
17	1		*END PANEL	Dented	590.60 FL	*590.60 FL
18	1		*END PANEL INNER GARNISH	Broken	202.70 FL	*202.70 FL
19	1		*RH TAILLAMP ASSY	Broken	414.10 FL	*414.10 FL
20	1		*LH TAILLAMP ASSY	Broken	414.10 FL	*414.10 FL
21	1		*REAR NUMBER PLATE	Not Damaged	70.00 FS	*- FS
22	1		*SET REAR BUMPER CLIPS	Necessary	70.00 FS	*30.00 FS
23	1		*REAR BUMPER REVERSE SENSOR (SET)	Short Circuit	280.00 FS	*200.00 FS
24	1		*END PANEL JOINT SEALANT	Necessary	70.00 FS	*30.00 FS
25	1		*REAR RH FENDER INNER TRIM BOARD	Torn	338.00 FL	*286.50 FL
26	1		*REAR LH FENDER INNER TRIM BOARD	Torn	338.00 FL	*286.50 FL
27	1		*RH TAILLAMP LOWER BRACKET	Broken	88.70 FL	*88.70 FL
28	1		*LH TAILLAMP LOWER BRACKET	Broken	88.70 FL	*88.70 FL
29	1		*BOOTLID LH LAMP	Broken	374.45 FL	*374.45 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	5,767.10	4,905.65
- List Item Discount on L Items 25.00/25.00% (\$\$)	1,319.28	1,161.41
Total Parts (\$\$)	4,447.82	3,744.24

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR CHARGES TO REMOVE,CHECK,REPLACE AND REINSTALL DAMAGED BODYPARTS,TO PANEL BEATING,CUT/WELD AND RE-ALIGN ALL AFFECTED PANELS	New	900.00	600.00
2	SPRAY PAINTING ON AFFECTED PANELS	New	900.00	600.00
3	CHECK WIRING AND LIGHTING SYSTEM	New	60.00	0.00
4	APPLY RUST COATING CHEMICAL ON AFFECTED PANELS	New	80.00	0.00
5	REMOVE AND REPLACE REAR BUMPER REVERSE SENSORS TO ASSIST REPAIR	New	100.00	60.00
6	REMOVE AND REPLACE REAR INNER TRIMS,GARNISH AND BOARDS TO ASSIST REPAIR	New	200.00	60.00
Gross Labour Cost (\$\$)			2,240.00	1,320.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >