

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CS/AIG21009491/KUF3E2

Date: 10/02/2022

REFERENCE

| | | | | | |
|-------------------|--------------------|------------------|------------|-----------|--------------|
| Insured/Claimant: | Toh Kang Wei Kenny | Policy No: | 1900246338 | | |
| Date of Loss: | 03/09/2021 | Nature of Claim: | OD | Claim No: | 9063022131SG |

DESCRIPTION & IDENTIFICATION OF VEHICLE

| | | | |
|-----------------------------|---------------------------------|-------------|-------------------|
| Reg No: | SKC85J | Engine No: | 27492030719573 |
| Make & Model: | MERCEDES-BENZ C200, 1.5 AMG (A) | Chassis No: | WDD2050422R215585 |
| Reg. Date: | 24/11/2016 (Man. Year: 2016) | Odometer: | 130080 km |
| Colour: | Black | | |
| Engine Capacity: | 1991 cc | | |
| Market Value/New Car Price: | S\$109,000.00 | | |
| Sum Insured (S\$): | Market Value/New Car Price | | |

CONDITION OF VEHICLE AT THE TIME OF SURVEY

| | | | | | |
|--------------------------|-------------------------|----------------------|--------------------------|-------------------------|--|
| General Condition: | Steering (Serviceable): | Yes | Footbrake (Serviceable): | Yes | |
| Handbrake (Serviceable): | Yes | Engine Modification: | No | Pre-accident Condition: | |

CONDITION OF TYRES

| | | | |
|-------------------|--------------|------------------|--------------|
| Front Tyre Size: | 225/45 R18 | Rear Tyre Size: | 245/40 R18 |
| Front Left Side: | Pirelli 9 mm | Rear Left Side: | Pirelli 9 mm |
| Front Right Side: | Pirelli 9 mm | Rear Right Side: | Pirelli 9 mm |

The above values represent the remaining tyre treads depth

| COST OF CLAIMS | Repairer's | Adjuster's | Difference | Diff % |
|-------------------------------------|------------------|------------------|------------------|--------------|
| Parts | 22,015.03 | 13,888.79 | 8,126.24 | 36.91 |
| Miscellaneous Items | 0.00 | 0.00 | 0.00 | |
| Labour | 4,020.00 | 1,580.00 | 2,440.00 | 60.70 |
| Paintwork Labour | 0.00 | 0.00 | 0.00 | |
| Towing | 0.00 | 0.00 | 0.00 | |
| Calculated Gross Total (S\$) | 26,035.03 | 15,468.79 | 10,566.24 | 40.58 |
| - Excess (S\$) | 800.00 | 800.00 | 0.00 | 0.00 |
| Nett Amount (S\$) | 25,235.03 | 14,668.79 | 10,566.24 | 41.87 |

INSPECTION

| | | | |
|-----------------------------|------------|---------------|--|
| Date of Assignment: | 09/09/2021 | | |
| Date Inspected: | 09/09/2021 | Inspected At: | Hiap Lek Automobile Trading Blk 14 #01-19 Sector B, Sin Ming Industrial Est Singapore 575658 |
| Estimated Period of Repair: | 5.0 days | | |

Adjuster: KENNETH KONG

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

| No. | Qty | Part No. | Particulars | Condition | Repairer's | Amount |
|-----|-----|----------|---|-------------------|------------|-------------|
| 1 | 1 | | *FRT BONNET (WCP) | Bent | 2,300.50 F | *1,120.00 F |
| 2 | 1 | | *FRT BONNET EMBLEM (WCP) | Necessary | 42.80 F | *40.00 F |
| 3 | 1 | | *FRT BONNET INSULATOR (WCP) | Serviceable | 160.50 F | *- F |
| 4 | 10 | | *FRT BONNET INSULATOR CLIPS (WCP) | Not Necessary | 18.20 F | *- F |
| 5 | 2 | | *FRT BONNET CATCH LH / RH (WCP) | Repair | 42.80 F | *- F |
| 6 | 2 | | *FRT BONNET CATCH STOPPER LH / RH (WCP) | Serviceable | 38.52 F | *- F |
| 7 | 1 | | *FRT BONNET CENTER LOCK (WCP) | Repair | 39.57 F | *- F |
| 8 | 2 | | *FRT BONNET LOCK LH / RH (WCP) | Repair | 77.04 F | *- F |
| 9 | 2 | | *FRT BONNET LOCK SWITCH LH / RH (WCP) | Serviceable | 49.22 F | *- F |
| 10 | 2 | | *FRT BONNET STOPPER LH / RH (WCP) | Serviceable | 10.37 F | *- F |
| 11 | 2 | | *FRT BONNET SHOCK ABSORBER LH / RH (WCP) | Serviceable | 124.12 F | *- F |
| 12 | 2 | | *FRT BONNET HINGE LH / RH (WCP) | Repair | 209.72 F | *- F |
| 13 | 2 | | *FRT BONNET HINGE PINS LH / RH (WCP) | Serviceable | 218.28 F | *- F |
| 14 | 1 | | *FRT BUMPER (WCP) | Buckled / Cracked | 813.20 F | *760.00 F |
| 15 | 1 | | *FRT BUMPER CLIPS (8PCS)(WCP) | Necessary | 17.12 F | *12.80 F |
| 16 | 1 | | *FRT BUMPER TOP WEATHER STRIP (WCP) | Necessary | 18.19 F | *17.00 F |
| 17 | 4 | | *FRT BUMPER PARKING SENSOR (WCP) | Serviceable | 398.04 F | *- F |
| 18 | 2 | | *FRT BUMPER LOWER GRILLE LH / RH (WCP) | Serviceable | 70.62 F | *- F |
| 19 | 2 | | *FRT BUMPER LOWER GRILLE SENSOR LH / RH (WCP) | Serviceable | 59.92 F | *- F |
| 20 | 1 | | *FRT BUMPER LOWER GRILLE CENTER (WCP) | Serviceable | 72.76 F | *- F |
| 21 | 2 | | *FRT BUMPER LOWER CHROME MOULDING LH / RH (WCP) | Dented | 188.32 F | *180.00 F |
| 22 | 1 | | *FRT BUMPER LOWER CHROME CENTER MOULDING (WCP) | Dented | 187.25 F | *155.00 F |
| 23 | 1 | | *FRT BUMPER TOP FRAME CENTER (WCP) | Cracked | 51.36 F | *46.00 F |
| 24 | 2 | | *FRT BUMPER SIDE BRACKET LH / RH (WCP) | Distorted | 83.46 F | *82.00 F |
| 25 | 1 | | *FRT RADIATOR GRILLE BASE (WCP) | Cracked | 77.04 F | *72.00 F |
| 26 | 1 | | *FRT RADIATOR GRILLE CENTER CHROME (WCP) | Dented | 117.70 F | *110.00 F |
| 27 | 2 | | *FRT RADIATOR GRILLE OUTER CHROME LH TOP (WCP) | Dented | 77.04 F | *72.00 F |
| 28 | 2 | | *FRT RADIATOR GRILLE OUTER CHROME RH BOTTOM (WCP) | Dented | 96.30 F | *90.00 F |
| 29 | 1 | | *FRT RADIATOR MERCEDES EMBLEM CHROME (WCP) | Necessary | 43.87 F | *41.00 F |
| 30 | 1 | | *FRT RADIATOR GRILLE STAR (WCP) | Cracked | 74.90 F | *70.00 F |
| 31 | 1 | | *FRT RADIATOR GRILLER INNER SHIELD (WCP) | Dented | 72.76 F | *66.00 F |
| 32 | 1 | | *FRT BUMPER RE-INFORCEMENT (WCP) | Bent | 246.10 F | *230.00 F |
| 33 | 1 | | *FRT SUPPORT PANEL (WCP) | Buckled | 395.90 F | *370.00 F |

Report was unsubmitted during this print-out.

| No. | Qty | Part No. Particulars | Condition | Repairer's | Amount |
|-----|-----|---|-------------------|------------|-------------|
| 34 | 2 | *FRT ANGLE BRACKET LH / RH (WCP) | Repair | 68.48 F | *- F |
| 35 | 1 | *FRT STRUT (WCP) | Serviceable | 24.61 F | *- F |
| 36 | 1 | *FRT BUMPER SPONGE CENTER (WCP) | Cracked | 94.16 F | *88.00 F |
| 37 | 1 | *FRT BUMPER INSIDE PART CENTER (WCP) | Serviceable | 72.76 F | *- F |
| 38 | 1 | *FRT BUMPER INSIDE PARTS LH / RH (2PCS)(WCP) | Cracked(1Pc Only) | 89.88 F | *42.00 F |
| 39 | 1 | *FRT MOUNTING CONSOLE (WCP) | Cracked | 150.00 F | *150.00 F |
| 40 | 1 | *FRT BUMPER TOP FRAME (WCP) | Serviceable | 51.36 F | *- F |
| 41 | 1 | *FRT FENDER LH (WCP) | Repair | 567.10 F | *- F |
| 42 | 1 | *FRT FENDER RH (WCP) | Repair | 460.10 F | *- F |
| 43 | 1 | *FRT FENDER INNER SHIELD INNER LH (WCP) | Serviceable | 71.69 F | *- F |
| 44 | 1 | *FRT FENDER INNER SHIELD INNER RH (WCP) | Serviceable | 80.25 F | *- F |
| 45 | 1 | *FRT FENDER INNER SHIELD OUTER LH (WCP) | Cracked | 69.55 F | *65.00 F |
| 46 | 1 | *FRT FENDER INNER SHIELD OUTER RH (WCP) | Serviceable | 69.55 F | *- F |
| 47 | 10 | *FRT FENDER INNER SHIELD CLIPS (WCP) | Not Necessary | 17.12 F | *- F |
| 48 | 1 | *FRT HEAD LAMP LH (WCP) | Mtg Cracked | 2,407.50 F | *2,250.00 F |
| 49 | 1 | *FRT HEAD LAMP RH (WCP) | Mtg Cracked | 2,514.50 F | *2,350.00 F |
| 50 | 2 | *FRT RADIATOR (WCP) | Punctured | 567.10 F | *530.00 F |
| 51 | 1 | *FRT RADIATOR FAN ASSY (WCP) | Cracked | 1,016.50 F | *930.00 F |
| 52 | 1 | *FRT NUMBER PLATE BASE (WCP) | Dented | 80.25 F | *75.00 F |
| 53 | 1 | *COOLANT (4PCS)(WCP) | Necessary | 32.12 F | *31.50 F |
| 54 | 1 | *NUMBER PLATE AND CASING | Dented | 70.00 FS | *45.00 FS |
| 55 | 1 | *AIRCON CONDENSOR (WCP) | Punctured | 1,102.10 F | *700.00 F |
| 56 | 1 | *FRT RADIATOR LOWER PRESURE (WCP) (SUPPLEMENTARY) | Bent | 492.20 F | *460.00 F |
| 57 | 1 | *FRT RADIATOR SPARE TANK FRONT PIPE (WCP) (SUPPLEMENTARY) | Cracked | 51.36 F | *47.00 F |
| 58 | 1 | *FRT BUMPER RADAR SENSOR BOX (WCP) (SUPPLEMENTARY) | Cracked | 620.60 F | *580.00 F |
| 59 | 2 | *FRT HEAD LAMP BURLAS CONTROL LED LH / RH (WCP) (SUPPLEMENTARY) | Serviceable | 1,465.90 F | *- F |
| 60 | 2 | *FRT HEAD LAMP BARLAS CONTROL RH / LH (WCP) (SUPPLEMENTARY) | Serviceable | 1,219.80 F | *- F |
| 61 | 1 | *PARTS 7% GST | | - | *828.26 FS |

F=Franchise part. S=SpcNett.

| | | |
|--|------------------|------------------|
| Sub Total (\$\$) | 20,020.03 | 12,705.56 |
| + Margin on L,N Items 10.00/10.00% (\$\$) | 1,995.00 | 1,183.23 |

| | | |
|---------------------------|------------------|------------------|
| Total Parts (\$\$) | 22,015.03 | 13,888.79 |
|---------------------------|------------------|------------------|

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

| No | Particulars | Lab.Type | Repairer's | Amount |
|---------------------------------|---|----------|-----------------|-----------------|
| Labour Items | | | | |
| 1 | CHECKING OF WIRING AND FOCUS HEADLAMPS | New | 200.00 | 20.00 |
| 2 | TO REMOVE AND REPLACE FRONT DAMAGED PARTS, STRAIGHTEN, ALIGN FRONT AFFECTED AREAS, FLUSH COOLANT. STRAIGHTEN FRONT CHASSIS MEMBER | New | 1,800.00 | 600.00 |
| 3 | TO REMOVE AND REFIT FRONT AIRCON GASES, CHECK FAN MOTOR WIRING | New | 120.00 | 100.00 |
| 4 | TO DO RESETTNG FOR BUMPER SENSORS AND AFFECTED AREA AND CHECK WIRING | New | 200.00 | 60.00 |
| 5 | TO PUTTY AND SPRAY PAINTING ON AFFECTED PORTIONS | New | 1,500.00 | 800.00 |
| 6 | TO RUST PROOF AFFECTED AREAS (NOT INSURED) | New | 200.00 | 0.00 |
| Gross Labour Cost (\$\$) | | | 4,020.00 | 1,580.00 |

Report was unsubmitted during this print-out.

< END OF ESTIMATES >