

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG21009574/URS3Q2
Date: 08/11/2021**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	7210000999
Claimant Vehicle No :	SNB6307A	Insured Vehicle No :	SKW1173B
Date of Loss:	12/09/2021	Nature of Claim:	TP
		Claim No:	5594268010SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SNB6307A		
Make & Model:	NISSAN SERENA, 1.2 L HIGHWAY STAR PREMIUM E-POWER (A)	Engine No:	HR12266567K
Reg. Date:	31/08/2021 (Man. Year: 2021)	Chassis No:	JN1EBAC27Z0001226
Colour:	Grey	Odometer:	392 km
Engine Capacity:	1198 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	195/60 R16	Rear Tyre Size:	195/60 R16
Front Left Side:	Bridgestone 9 mm	Rear Left Side:	Bridgestone 9 mm
Front Right Side:	Bridgestone 9 mm	Rear Right Side:	Bridgestone 9 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	29,560.00	14,337.10	15,222.90	51.50
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,870.00	2,710.00	3,160.00	53.83
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	35,430.00	17,047.10	18,382.90	51.89
+ GST 7.00/7.00% (S\$)	2,480.10	1,193.30	1,286.80	51.89

Nett Amount (S\$)	37,910.10	18,240.40	19,669.70	51.89
+ Loss of Use (10.0 x S\$60.00/day) (S\$)		600.00		
+ Doc/Search Fee (S\$)		2.00		
+ Other Costs (S\$)		70.00		
Nett Liability (S\$)		18,912.40		

INSPECTION

Date of Assignment: 13/09/2021

Date Inspected: 13/09/2021

Estimated Period of Repair: 8.0 days

Inspected At:

Fastech Auto Pte Ltd (HQ)
 1 Kaki Bukit Ave 6, #01-46/48/50 Autobay
 Singapore 417883

Adjuster: MARCUS CHUA**Manager:** Jaslin Kok Chin Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BONNET	Repair	873.90 F	*- FN
2	2		*BONNET HINGES	Serviceable	83.40 F	*- FN
3	1		*BONNET LOCK	Bent	67.30 F	*67.30 FN
4	1		*FRONT BUMPER	Distorted	862.70 F	*862.70 FN
5	1		*FRONT BUMPER SIDE RETAINERS	N/S Cracked	46.80 F	*23.40 FN
6	1		*FRONT BUMPER LED DAY LIGHT GARNISH N/S	Torn	119.20 F	*119.20 FN
7	1		*FRONT BUMPER CENTRE GARNISH	Twisted	277.00 F	*277.00 FN
8	1		*FRONT BUMPER UNDER COVER	Distorted	319.90 F	*319.90 FN
9	1		*SET FRONT BUMPER UNDER COVER CLIPS	Necessary	35.00 F	*35.00 FN
10	1		*FRONT BUMPER OUTER CENTRE GARNISH	Distorted	385.00 F	*385.00 FN
11	1		*FRONT BUMPER SPONGE	Torn	170.10 F	*170.10 FN
12	1		*FRONT BUMPER REINFORCEMENT	Distorted	548.50 F	*548.50 FN
13	2		*FRONT BUMPER REINFORCEMENT BRACKETS	Twisted	193.80 F	*193.80 FN
14	1		*SET FRONT BUMPER CLIPS	Necessary	39.00 F	*39.00 FN
15	1		*FRONT GRILLE ASSY	Cracked	727.90 F	*727.90 FN
16	1		*FRONT GRILLE LOGO	Necessary	64.90 F	*64.90 FN
17	1		*FRONT GRILLE VIEW CAMERA	Damaged	750.00 F	*750.00 FN
18	1		*FRONT GRILLE VIEW CAMERA HOLDER	Twisted	66.00 F	*66.00 FN
19	1		*FRONT GRILLE VIEW CAMERA WIRE HARNESS	Serviceable	129.60 F	*- FN
20	2		*HEADLAMPS	Cracked	3,479.00 F	*3,479.00 FN
21	1		*HEADLAMP OUTER CHROME MOULDINGS	N/S Broken / O/S Not Necessary	298.60 F	*149.30 FN
22	1		*FRONT SIGNAL LAMPS	N/S Cracked / O/S Not Necessary	1,440.00 F	*720.00 FN
23	1		*FRONT FENDER N/S	Buckled	620.10 F	*620.10 FN
24	1		*FRONT FENDER INNER SHIELD N/S	Torn	166.20 F	*166.20 FN
25	1		*SET FRONT FENDER INNER SHIELD CLIPS N/S	Necessary	39.00 F	*39.00 FN
26	1		*FRONT DOOR N/S	Repair	1,545.00 F	*- FN
27	1		*FRONT DOOR E-POWER EMBLEM N/S	Not Necessary	102.00 F	*- FN
28	1		*FRONT HORN UNIT	Damaged	162.00 F	*162.00 FN
29	1		*FRONT SUPPORT PANEL CENTRE	Bent	169.90 F	*169.90 FN
30	1		*FRONT SUPPORT LOWER MEMBER	Bent	322.50 F	*322.50 FN
31	1		*HEADLAMP SUPPORT PANEL N/S	Twisted	97.00 F	*97.00 FN
32	1		*FRONT SUPPORT PANEL TOP AIR DUCT	Distorted	128.20 F	*128.20 FN
33	1		*RADIATOR	Distorted	916.10 F	*716.10 FN
34	1		*RADIATOR TOP HOSE	Not Necessary	89.00 F	*- FN
35	1		*ENGINE SUB HARNESS	Repair	2,304.00 F	*- FN

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
36	1		*RADIATOR SPARE TANK	Serviceable	133.00 F	*- FN
37	1		*WIPER WASHER TANK	Not Necessary	245.00 F	*- FN
38	1		*INLET MANIFOLD	Not Necessary	1,800.00 F	*- FN
39	1		*FRONT WINDSCREEN	Not Necessary	1,280.00 F	*- FN
40	1		*FRONT BUMPER LED DAYLIGHT N/S	Cracked	335.40 FS	*335.40 FS
41	2		*FRONT BUMPER PDC SENSORS	Shorted	464.00 FS	*464.00 FS
42	1		*AIR CON CONDENSER	Distorted	786.90 FS	*786.90 FS
43	1		*AIR CON CONDENSER OUTER GRILLE	Distorted	142.00 FS	*142.00 FS
44	2		*AIR GUIDES	Distorted	130.00 FS	*130.00 FS
45	1		*AIR CON TEMPERATURE SENSOR	Cracked	108.00 FS	*108.00 FS
46	1		*RADIATOR FAN MOTOR ASSY	Cracked / Jammed	1,020.40 FS	*1,020.40 FS
47	1		*INVERTER RADIATOR	Distorted	821.60 FS	*821.30 FS
48	1		*DIGITAL SOUND CCU	Serviceable	580.00 FS	*- FS
49	1		*ENGINE CONTROL MODULE	Serviceable	2,363.60 FS	*- FS
50	1		*COMPRESSOR	Not Necessary	999.50 FS	*- FS
51	1		*WATER HOSE	Torn	122.00 FS	*122.00 FS
52	1		*BATTERY	Serviceable	300.00 FS	*- FS
53	1		*BOL RADIATOR COOLANT	Necessary	80.00 FS	*30.00 FS
54	1		*BOL INVERTER RADIATOR COOLANT	Necessary	80.00 FS	*30.00 FS
55	1		*BOL AIR CON OIL	Necessary	80.00 FS	*30.00 FS
56	1		*FRONT LICENCE PLATE	Bent	50.00 FS	*40.00 FS

F=Franchise part. S=SpcNett. N=NettItemDisc.

Sub Total (\$)	29,560.00	15,479.00
- Nett Item Discount on N Items 0.00/10.00% (\$)	0.00	1,141.90
Total Parts (\$)	29,560.00	14,337.10

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO CHECK WIRING	New	50.00	30.00
2	TO DISMANTLE & REPLACED FRT PDC SENSOR	New	100.00	50.00
3	TO REFILL AIR CON GAS	New	120.00	100.00
4	TO DISMANTLE & REFIX FRONT ENGINE CONTROL MODULE	New	500.00	200.00
5	TO RESET & REPROGRAMME DIAGNOSIS SYSTEM	New	500.00	200.00
6	TO DISMANTLE & REPLACED INVERTER RADIATOR	New	180.00	50.00
7	TO SPRAY RUST PROOFING	New	120.00	80.00
8	TO CONDUCT WHEEL ALIGNMENT	New	120.00	0.00
9	TO MOUNT VEHICLE ON CAR O-LINER	New	380.00	0.00
10	LABOUR FOR PANEL BEATING & REPLACED PARTS	New	2,000.00	1,000.00
11	TO PUTTY & SPRAY PAINTING	New	1,800.00	1,000.00
Gross Labour Cost (S\$)			5,870.00	2,710.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >