

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CC3/AIG21009655/ETCE2

Date: 22/12/2021

REFERENCE

Insured/Claimant:	GAN GUAN HONG STANLEY	Policy No:	7210000999	
Date of Loss:	12/09/2021	Nature of Claim:	OD	Claim No: 5594268010SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKW1173B	Engine No:	DEM028736
Make & Model:	AUDI A5, 2.0 SPORTBACK (A)	Chassis No:	WAUZZZF54MA018339
Reg. Date:	25/01/2021 (Man. Year: 2020)	Odometer:	12381 km
Colour:	Blue		
Engine Capacity:	1984 cc		
Market Value/New Car Price:	S\$170,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	255/35 R19	Rear Tyre Size:	255/35 R19
Front Left Side:	Pirelli 5 mm	Rear Left Side:	Pirelli 5 mm
Front Right Side:	Pirelli 5 mm	Rear Right Side:	Pirelli 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	52,995.40	26,822.72	26,172.68	49.39
Miscellaneous Items	0.00	0.00	0.00	
Labour	25,804.00	17,019.00	8,785.00	34.05
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	78,799.40	43,841.72	34,957.68	44.36
- Excess (S\$)	800.00	800.00	0.00	0.00
(S\$)	77,999.40	43,041.72	34,957.68	44.82
+ GST 7.00/7.00% (S\$)	5,459.96	3,012.92	2,447.04	44.82
Nett Amount (S\$)	83,459.36	46,054.64	37,404.72	44.82

INSPECTION

Date of Assignment:	15/09/2021		
Date Inspected:	14/09/2021	Inspected At:	24 Benoi Sector Singapore 629857 Repairer: Premium Automobiles Pte Ltd
Estimated Period of Repair:	15.0 days		

Adjuster: CHEN TSUE YEE

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Broken	2,342.00 FS	*1,873.60 FS
2	2		*FRONT BUMPER SECURING STRIP	Missing	71.00 FS	*56.32 FS
3	1		*FRONT BUMPER GRILLE	Broken	196.00 FS	*156.40 FS
4	1		*FRONT BUMPER CLOSING ELEMENT	Broken	262.00 FS	*209.20 FS
5	1		*FRONT BUMPER SPOILER	Cut	535.00 FS	*428.00 FS
6	1		*FRONT BUMPER AIR GUIDE - RH	Broken	63.00 FS	*50.08 FS
7	1		*FRONT BUMPER CLOSING ELEMENT	Broken	262.00 FS	*209.20 FS
8	1		*FRONT BUMPER AIR GUIDE GRILLE - RH	Broken	135.00 FS	*108.00 FS
9	1		*FRONT BUMPER TRIM - RH	Cut	48.00 FS	*38.00 FS
10	1		*FRONT BUMPER TRIM - CENTER	Broken	114.00 FS	*91.20 FS
11	1		*RADIATOR GRILLE	Broken	1,694.00 FS	*1,355.20 FS
12	1		*FRONT BUMPER REINFORCEMENT FOAM PIECE	Broken	146.00 FS	*116.40 FS
13	1		*FRONT BUMPER REINFORCEMENT BAR	Bent	845.00 FS	*675.60 FS
14	1		*FRONT BUMPER GUIDE SECTION - RH	Broken	36.00 FS	*28.72 FS
15	1		*FRONT BUMPER BRACKET - RH	Not Necessary	214.00 FS	*- FS
16	1		*FRONT BUMPER TOP COVER	Crushed	127.00 FS	*101.60 FS
17	1		*CAUTION STICKER	Necessary	14.00 FS	*10.88 FS
18	1		*AIR CONDITIONER STICKER	Necessary	8.00 FS	*5.68 FS
19	1		*FRONT BUMPER REINFORCEMENT BRACKET	Broken	137.00 FS	*109.60 FS
20	1		*FRONT BUMPER SUPPORT - LH / RH	Necessary	58.00 FS	*44.96 FS
21	4		*POP RIVET	Necessary	4.00 FS	*2.56 FS
22	1		*HORN - RH	Broken	126.00 FS	*100.40 FS
23	1		*HORN BRACKET - RH	Bent	29.00 FS	*22.80 FS
24	1		*FRONT PARKING AID SENSOR - RH OUTER	Missing	243.90 FS	*195.12 FS
25	1		*FRONT PARKING AID SENSOR - RH INNER (NPA)	Not Necessary	0.00 FS	*- FS
26	4		*FRONT PARKING AID SENSOR SEAL	Not Necessary	14.00 FS	*- FS
27	1		*FRONT BUMPER WIRING	Torn	405.00 FS	*100.32 FS
28	1		*FRONT BONNET	Dented	3,312.00 FS	*2,649.60 FS
29	1		*FRONT BONNET RETAINING CLIP (3PCS)	Necessary	4.00 FS	*2.64 FS
30	1		*FRONT BONNET ATTACHMENT PARTS	Not Necessary	123.00 FS	*- FS
31	2		*FRONT BONNET HINGE - LH / RH	Not Necessary	838.00 FS	*- FS
32	1		*FRONT BONNET IMPACT PROTECTION - LH / RH / CENTER	Necessary	84.00 FS	*65.68 FS
33	1		*FRONT BONNET INSULATION	Crushed	343.00 FS	*274.40 FS
34	1		*FRONT BONNET STRIKER	Not Necessary	50.00 FS	*- FS
35	1		*FRONT BONNET LOCK	Not Necessary	214.00 FS	*- FS
36	1		*FRONT BONNET BOWDEN CABLE - CENTER	Not Necessary	58.00 FS	*- FS
37	1		*FRONT BONNET HOOD RELEASE	Not Necessary	14.00 FS	*- FS
38	1		*FRONT BONNET RELEASE CABLE	Not Necessary	58.00 FS	*- FS
39	1		*FRONT BONNET CABLE COVER	Not Necessary	10.00 FS	*- FS
40	1		*FRONT BONNET LOCK CABLE - RH	Not Necessary	74.00 FS	*- FS
41	1		*PLENUM CHAMBER COVER - RH	Not Necessary	97.00 FS	*- FS
42	1		*FRONT FENDER TOP COVER - RH	Necessary	72.00 FS	*57.52 FS
43	1		*FRONT BONNET STRUT	Not Necessary	121.00 FS	*- FS
44	1		*FRONT FENDER - RH	Dented	1,060.00 FS	*848.00 FS
45	1		*FRONT FENDER ATTACHMENT PART	Necessary	53.00 FS	*42.40 FS
46	1		*FRONT FENDER SUPPORT BRACKET	Necessary	74.00 FS	*59.04 FS
47	1		*FRONT FENDER BRACKET - RH	Necessary	35.00 FS	*27.92 FS
48	5		*POP RIVET	Necessary	17.00 FS	*13.20 FS
49	1		*FRONT FENDER RETAINING BRACKET - RH	Necessary	49.00 FS	*39.20 FS
50	1		*FRONT FENDER SUPPORT	Necessary	35.00 FS	*27.92 FS
51	1		*FRONT FENDER BRACKET - REAR RH	Necessary	58.00 FS	*46.00 FS
52	1		*FRONT FENDER HOLE COVER	Necessary	18.00 FS	*14.16 FS
53	1		*FRONT FENDER BRACE - RH	Dented	118.00 FS	*94.40 FS
54	1		*FRONT FENDER CLOSING ELEMENT - RH	Necessary	33.00 FS	*26.16 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
55	1		*FRONT HEADLIGHT COVER - RH	Broken	44.00 FS	*34.48 FS
56	1		*FRONT FENDER COVER - RH	Missing	16.00 FS	*12.24 FS
57	1		*FRONT FENDER COVER - OUTER RH	Necessary	36.00 FS	*28.24 FS
58	1		*FRONT FENDER TRIM - RH	Cut	164.00 FS	*130.80 FS
59	1		*FRONT WHEEL HOUSING LINER - RH	Crushed	275.00 FS	*219.60 FS
60	1		*FRONT WHEEL HOUSING LINER ATTACHMENT PART	Not Necessary	169.00 FS	*- FS
61	1		*FRONT WHEEL SPOILER - RH	Missing	73.00 FS	*58.40 FS
62	1		*FRONT SPOILER - RH	Missing	36.00 FS	*28.56 FS
63	1		*FRONT FENDER STONE CHIP GUARD - RH	Necessary	51.00 FS	*40.32 FS
64	1		*FRONT FENDER BRACKET TRIM - RH	Not Necessary	24.00 FS	*- FS
65	1		*FRONT FENDER CONNECTING PLATE - RH	Dented	217.00 FS	*173.20 FS
66	1		*FRONT FENDER FILLER PANEL - RH	Dented	251.00 FS	*200.40 FS
67	1		*FRONT HEADLIGHT - RH	Broken	7,685.00 FS	*6,148.00 FS
68	2		*FRONT HEADLIGHT COMPENSATING PIECE	Bent	83.00 FS	*65.92 FS
69	2		*FRONT HEADLIGHT RETAINER PLATE	Not Necessary	80.00 FS	*- FS
70	2		*FRONT HEADLIGHT SPACER	Not Necessary	80.00 FS	*- FS
71	1		*FRONT HEADLIGHT HOSE - RH	Not Necessary	36.00 FS	*- FS
72	1		*FRONT HEADLIGHT LIFT CYLINDER - RH	Broken	198.00 FS	*167.20 FS
73	1		*FRONT HEADLIGHT LIFT CYLINDER BRACKET - RH	Broken	15.00 FS	*36.24 FS
74	1		*FRONT HEADLIGHT LIFT CYLINDER HOSE	Torn	92.50 FS	*74.00 FS
75	1		*FRONT HEADLIGHT LIFT CYLINDER CONNETED HOSE	Torn	46.00 FS	*36.24 FS
76	1		*FRONT WASHER RESERVOIR	Not Necessary	142.00 FS	*- FS
77	1		*WINDSCREEN WASHER PUMP	Not Necessary	125.00 FS	*- FS
78	1		*HEADLIGHT WASHER PUMP	Not Necessary	155.00 FS	*- FS
79	1		*RADIATOR LOCK CARRIER	Bent	1,016.00 FS	*812.80 FS
80	1		*RADIATOR SUPPORT	Not Necessary	38.00 FS	*- FS
81	1		*AIR COOLER	Not Necessary	587.00 FS	*- FS
82	1		*AIR COOLER SEAL	Not Necessary	92.00 FS	*- FS
83	1		*AIR COOLER PRESSURE HOSE - RH	Not Necessary	357.00 FS	*- FS
84	1		*FRONT BUMPER TEMPERATURE SENSOR BRACKET	Necessary	19.00 FS	*14.56 FS
85	6		*COOLANT	Necessary	266.00 FS	*212.64 FS
86	1		*RADIATOR AIR GUIDE - RH OUTER	Not Necessary	32.00 FS	*- FS
87	1		*RADIATOR AIR GUIDE - RH INNER	Broken	16.00 FS	*13.52 FS
88	1		*RADIATOR AIR DUCT - RH UPPER	Not Necessary	16.00 FS	*- FS
89	1		*RADIATOR AIR DUCT - RH LOWER	Not Necessary	22.00 FS	*- FS
90	1		*AIR FILTER	Broken	386.00 FS	*308.40 FS
91	2		*WINDSCREEN STRIP - LH / RH	Not Necessary	134.00 FS	*- FS
92	1		*FRONT DOOR CHROME TRIM - LH / RH	O/S Missing	328.00 FS	*130.80 FS
93	2		*FRONT WINDOW CHROME SLOT SEAL - LH / RH	Not Necessary	798.00 FS	*- FS
94	1		*FRONT ALUMINIUM RIM - RH	Cut	2,290.00 FS	*1,832.00 FS
95	1		*FRONT SUBFRAME	Not Necessary	2,290.00 FS	*- FS
96	1		*FRONT SUBFRAME SUPPORT - RH	Not Necessary	472.00 FS	*- FS
97	1		*ENGINE MOUNTING - RH	Not Necessary	370.00 FS	*- FS
98	1		*ENGINE MOUNTING SUPPORT - RH	Not Necessary	158.00 FS	*- FS
99	1		*ENGINE BEARING SUPPORT - RH	Not Necessary	67.00 FS	*- FS
100	1		*FRONT LOWER ARM WISHBONE - RH	Bent	539.00 FS	*430.80 FS
101	1		*FRONT LOWER ARM - RH ARM	Bent	943.00 FS	*754.40 FS
102	1		*FRONT UPPER ARM - RH FRONT	Bent	512.00 FS	*409.20 FS
103	1		*FRONT UPPER ARM - RH REAR	Bent	512.00 FS	*409.20 FS
104	1		*WHEEL BEARING HOUSING - RH	Bent	968.00 FS	*774.00 FS
105	1		*FRONT LOWER BALL JOINT	Necessary	193.00 FS	*154.40 FS
106	1		*FRONT WHEEL HUB	Necessary	479.00 FS	*383.20 FS
107	1		*FRONT WHEEL BEARING	Necessary	246.00 FS	*196.80 FS
108	1		*FRONT SUSPENSION FORKS - RH	Bent	264.00 FS	*210.80 FS
109	1		*STABILIZER LINK - RH	Not Necessary	127.00 FS	*- FS
110	1		*FRONT ANTI ROLL BAR	Not Necessary	433.00 FS	*- FS
111	1		*FRONT SHOCK ABSORBER - RH	Bent	310.00 FS	*247.60 FS
112	1		*FRONT DRIVE SHAFT - RH	Not Necessary	2,650.00 FS	*- FS
113	1		*STEERING RACK	Not Necessary	6,787.00 FS	*- FS
114	1		*TIE ROD - RH	Bent	99.00 FS	*78.88 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
115	1	*TIE ROD END - RH	Bent	167.00 FS	*133.60 FS
116	1	*UNDERBODY NOISE INSULATION	Broken	572.00 FS	*457.60 FS
117	1	*UNDERBODY NOISE INSULATION FIXING PARTS	Not Necessary	70.00 FS	*- FS
118	1	*FRONT NO PLATE	Necessary	60.00 FS	*60.00 FS
119	1	*ACRYLIC SEALANT	Not Necessary	180.00 FS	*- FS
120	1	*CRAVITY WAX	Not Necessary	140.00 FS	*- FS
121	1	*STONE CHIP	Not Necessary	180.00 FS	*- FS
122	1	*METAL FILLER POWDER	Not Necessary	280.00 FS	*- FS
123	1	*RHS FRONT TYRE (NPA)	Not Necessary	0.00 FS	*- FS
124	1	*SUNDRIES	Necessary	500.00 FS	*338.72 FS
125	1	*RADIATOR AIR GUIDE = LH INNER (Supplementary)	Torn	16.00 F	*13.52 F
126	1	*AIR INTAKE AIR GUIDE (Supplementary)	Broken	53.00 F	*42.40 F
127	1	*HORN CONNECTOR (Supplementary)	Broken	21.00 F	*16.40 F
128	1	*BONNET LOCK COONECTOR (Supplementary)	Broken	13.00 F	*10.32 F
129	1	*INTAKE CONNECTOR (Supplementary)	Broken	31.00 F	*24.08 F
130	5	*WIRING SEAL (Supplementary)	Necessary	15.00 F	*11.60 F
131	2	*WIRING REPAIR KIT (Supplementary)	Necessary	130.00 F	*103.36 F
132	1	*LAMBDA PRODE SENSOR (Supplementary)	Bent	507.00 F	*405.20 F

F=Franchise part. S=SpcNett.

Total Parts (S\$) 52,995.40 26,822.72

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY AND FRONT PARKING AID	New	480.00	480.00
2	TO REMOVE AND TRANSFER RHS HEADLIGHTSS CONTROL UNIT AND POWER MODULE	New	400.00	250.00
3	TO REMOVE AND REINSTALL AIRCON CONDENSER, ADDITIONAL RADIATOR, RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS	New	1,700.00	1,700.00
4	TO REMOVE AND REINSTALL RHS FRONT SUSPENSION ASSY WITH SUBFRAME TO INSPECT FOR DAMAGES AND RENEW IF NECESSARY	New	2,400.00	2,400.00
5	TO DISMANTLE AND REINSTALL BOTH FRONT DOOR PANEL TRIMS. TO REMOVE AND REINSTALL BOTH WING MIRROR ASSY TO FACILITATE RESPRAY OF BOTH FRONT DOORS	New	560.00	280.00
6	TO REMOVE AND RENEW RHS ENGINE MOUNTING ASSY	New	280.00	0.00
7	TO DISMANTLE AND RENEW FRONT BUMPER, BONNET, RHS FRONT FENDER AND RHS HEADLIGHT. TO CUT OUT AND WELD RHS FRONT FENDER TOP SUPPORT. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. TO REPAIR RHS FRONT DOORS AND RHS FRONT IPPER A-PILLAR. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	8,000.00	4,500.00
8	TO RESPRAY FRONT BUMPER, RHS FRONT FENDER, BONNET, HINGES, RHS FRONT FENDER TOP SUPPORT, BOTH FRONT UPPER A-PILLAR AND BOTH FRONT DOORS	New	7,600.00	3,025.00
9	TO CARRY OUT FIRST MEASUREMENT ON CAR-O-LINER	New	800.00	800.00
10	TO PUT ON THE CAR ON CAR O-LINER TO FACILITATE THE REPAIR	New	2,400.00	2,400.00
11	TO RENEW RHS FRONT RIM WITH TYRE. TO CARRY OUT PRE/POST WHEEL ALIGNMENT	New	520.00	520.00
12	TO CARRY OUT PRE AND POST DIAGNOSTIC CHECK	New	384.00	384.00
13	TO CARRY OUT WIRING CHECK AND REPLACE ACCORDING TO DAMAGE. CHECK FUNCTION (Supplementary)	New	280.00	280.00
Gross Labour Cost (\$\$)			25,804.00	17,019.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >