

VEHICLE DAMAGE PRE REPAIR SURVEY REPORT

EQ Insurance Company Limited
5 Maxwell Road
#17-00 Tower Block
MND Complex
Singapore 069110

Our File No: **MS19-EQ-010016/TPFG**
Insurer Ref: **YP8938L**
Insured Name: -

Date: 4-Jul-19

REFERENCE

Insured Veh No: YP8938L Policy No: -
Date of loss: 3-Dec-18
Claimant Veh No: YM6079U

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	YM6079U	Make:	ISUZU
Reg Year:	2007	Model:	NHR85EU3ES
Colour:	Green	Engine No:	4JJ1450635
Type:	-	Chassis No:	JAANHR85E77100047
Type of Claim:	Third Party's Claim	Odometer:	0
Market Value:	-	Engine Cap:	2999 cc

CONDITION OF VEHICLE AT THE TIME OF SURVEY

(STATIC ONLY)

General Condition:	Good	Steering:	Serviceable	Engine Modification:	Nil
Paint work:	Good	Handbrake:	Serviceable	Pre-accident damage:	Nil
		Footbrake:	Serviceable		

CONDITION OF TYRES

Front Left Size:	Bridgestone 205R16C 70%	Front Right Size:	Bridgestone 205R16C 70%
Rear Left Size:	Maxxis 185R14C 60%	Rear Right Size:	Maxxis 185R14C 60%

The above percentages represent the remaining life of the tyre threads

COST OF REPAIRS

	Repairer's S\$	Adjuster's S\$	Difference S\$
Parts	-	-	-
Labour	-	-	-
Calculated Cost (S\$) :	(No Estimate)	-	-


Recommended Estimate Repair Cost (S\$) : 3,000.00

INSPECTION

Date of Assignment:	3-Jan-19	Inspected At:	Twincar Automotive Pte Ltd
Date of Pre-Repair Survey	10-Jan-19		Kaki Bukit Autohub
Date of Interim Survey	11-Jan-19		2 Kaki Bukit Avenue 2
Date of Post Repair Survey	16-Jan-19		#01-17
Est. repair Period:	3 days		Singapore 417921
Recommended Reserve(S\$):	NA		
Sum Insured (S\$):	NA		
Repair status:	Surveyed on a "Without Prejudice" Basis		

MS19-EQ-010016/TPFG
YM6079U

POINT OF IMPACT
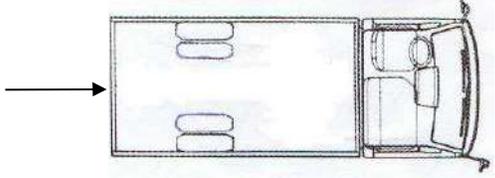
<p>The vehicle sustained damages to the rear portion.</p>	
--	--

BRIEF CIRCUMSTANCES OF ACCIDENT

The Insured's vehicle and Third Party's vehicle collided at along **Lentor AVE L/P 90**.

CONSISTENCY OF DAMAGES

Our visual inspection of the vehicle revealed that the damages noted are consistent with the accident as reported.

SPECIAL REMARKS

1. The repairer did not provide Repair Estimate during our pre-repair survey.
2. This inspection was conducted on a "Without Prejudice" Basis.
3. We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Pre-Repair Survey Report and photographs.


 

Faizal Ghulam Mohd
Automobile Appraiser

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.


Our Ref: MS19-EQ-010016/TPFG
Vehicle No.: YM6079U

INSPECTION PHOTOS

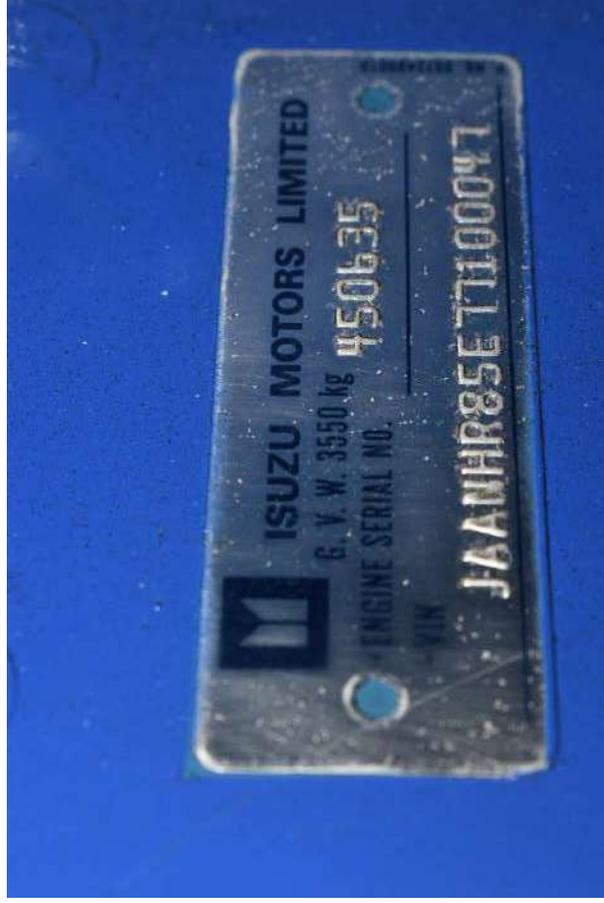

Our Ref: MS19-EQ-010016/TPFG
Vehicle No.: YM6079U

INSPECTION PHOTOS

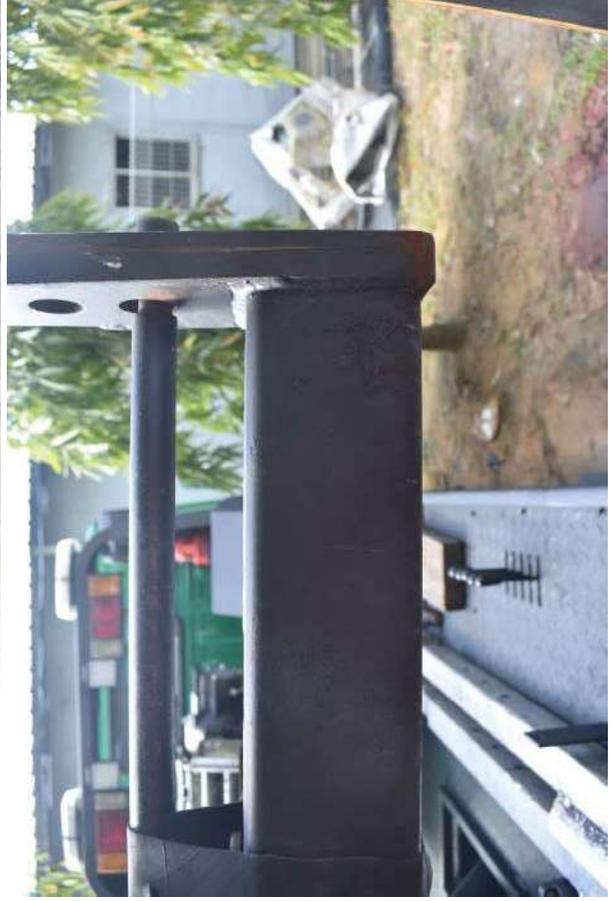

Our Ref: MS19-EQ-010016/TPFG
Vehicle No.: YM6079U

INSPECTION PHOTOS



Our Ref: MS19-EQ-010016/TPFG
Vehicle No.: YM16079U

INSPECTION PHOTOS



Our Ref: MS19-EQ-010016/TPFG
Vehicle No.: YM6079U

RE-INSPECTION PHOTOS



Our Ref: MS19-EQ-010016/TPFG
Vehicle No.: YM6079U

RE-INSPECTION PHOTOS



Our Ref: MS19-EQ-010016/TPFG
Vehicle No.: YM6079U

RE-INSPECTION PHOTOS



Our Ref: MS19-EQ-010016/TPFG
Vehicle No.: YM6079U

RE-INSPECTION PHOTOS



Our Ref: MS19-EQ-010016/TPFG
Vehicle No.: YM6079U

RE-INSPECTION PHOTOS



Our Ref: MS19-EQ-010016/TPFG
Vehicle No.: YM6079U

RE-INSPECTION PHOTOS

