

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/AIG21009787/VPS3Q2
Date: 13/12/2021**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2100474139
Claimant Vehicle No :	SHD3036L	Insured Vehicle No :	SKB8230J
Date of Loss:	16/09/2021	Nature of Claim:	TP
		Claim No:	7949199021SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHD3036L	Engine No:	D4FDEU463477
Make & Model:	HYUNDAI I40, 1.7 D CRDI F/L ABS AIRBAG 4DR (A)	Chassis No:	KMHLB41UMHU096730
Reg. Date:	06/12/2016 (Man. Year: 2016)	Odometer:	619910 km
Colour:	Blue		
Engine Capacity:	1685 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/60 R16	Rear Tyre Size:	205/60 R16
Front Left Side:	West Lake 5 mm	Rear Left Side:	West Lake 5 mm
Front Right Side:	West Lake 5 mm	Rear Right Side:	West Lake 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	2,617.68	1,201.60	1,416.08	54.10
Miscellaneous Items	0.00	0.00	0.00	
Labour	600.00	530.00	70.00	11.67
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	3,217.68	1,731.60	1,486.08	46.18
Approved Total (Overridden) (S\$)		1,400.00		

(S\$)	3,217.68	1,400.00	1,817.68	56.49
+ GST 7.00/7.00% (S\$)	225.24	98.00	127.24	56.49
Nett Amount (S\$)	3,442.92	1,498.00	1,944.92	56.49
+ Loss of Use (2.0 x S\$50.00/day) (S\$)		100.00		
+ Car Rental (2.0 x S\$110.67/day) (S\$)		221.34		
+ Doc/Search Fee (S\$)		2.00		
Nett Liability (S\$)		1,821.34		
Global Sum Settlement (S\$)		1,800.00		

INSPECTION

Date of Assignment: 20/09/2021

Date Inspected: 20/09/2021

Estimated Period of Repair: 2.0 days

Inspected At:

ComfortDelGro Engineering Pte Ltd (Loyang)
 59 Loyang Drive
 Singapore 508969

Adjuster: Thevan Thomas Karthikesavan**Manager:** CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Repair	1,052.20 FL	*- FL
2	10		*FRONT BUMPER CLIPS	Necessary	22.00 FL	*22.00 FL
3	1		*FRONT BUMPER REINFORCEMENT	Serviceable	588.40 FL	*- FL
4	1		*RADIATOR GRILLE	Scratched	1,480.00 FL	*1,480.00 FL
5	1		*RADIATOR GRILLE H EMBLEM	Serviceable	129.50 FL	*- FL
					Sub Total (\$\$)	3,272.10
					- List Item Discount on L Items 20.00/20.00% (\$\$)	654.42
					Total Parts (\$\$)	2,617.68

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	PANEL BEATING	New	300.00	280.00
2	SPRAY PAINTING CHARGE	New	300.00	250.00
Gross Labour Cost (S\$)			600.00	530.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >