

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/CTI21009900/VVCN2**Date:** 05/10/2021REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMPCSNW00158262001		
Claimant Vehicle No :	GBB2088A	Insured Vehicle No :	SLT5507A		
Date of Loss:	20/09/2021	Nature of Claim:	TP	Claim No:	SNM21D205365/C02/THAMYL

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	GBB2088A		Engine No:	5L5354266
Make & Model:	TOYOTA DYNA 150, 2.0 YY211 (M)		Chassis No:	JTFUF34Y903001512
Reg. Date:	18/08/2003 (Man. Year: 2003)		Odometer:	220415 km
Colour:	Orange			
Engine Capacity:	2986 cc			
Market Value/New Car Price:	N/A			
Sum Insured (S\$):	Market Value/New Car Price			

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	185R14C	Rear Tyre Size:	155R12C
Front Left Side:	Falken 5 mm	Rear Left Side:	Falken 5 mm
Front Right Side:	Falken 5 mm	Rear Right Side:	Falken 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 22/09/2021

Date Inspected: 22/09/2021 Inspected At:

Bluwel Automotive Service Pte Ltd (HQ)
1 Kaki Bukit Avenue 6, #01-28/37/53/55/56
Autobay@Kaki Bukit
Singapore 417883

Estimated Period of Repair: 5.0 days

Adjuster: Thevan Thomas Karthikesavan**Manager:** VERON CHEN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$5,000.00
-\$6,000.00

REPAIR DETAILS

Reference

Part Source: (Last Synchronised: 05 Oct 2021)

Parts: N/A TOYOTA DYNA 150 2.0 YY211 (M) (Model not available in database)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for GBB2088A)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >