

Our reference: 21-7104

Date: 18/12/2020

c/o Garage 13 Pte Ltd 8 Kaki Bukit Ave 4 #03-46 Premier@KB Singapore 415875

Dear Sirs

RE: Road Traffic Accident on 7/12/2020

Richard Lim Wee Liat

In accordance with your instructions received in this office on 8/12/2020 , we made arrangements to examine the vehicle on 8/12/2020 at above-mentioned address. The following data was recorded:

#### Vehicle details

Make	Mitsubishi	Registration	SFSS671J
Model	Lancer	Chassis	JMYSTCY4A8U001191
Colour	Red	Gearbox	Auto
Odometer	232841km	Paintwork	Good
Steering	In order	Brakes	In order
Condition	Good		

### Tyre Depths

Front left	225/40R18	85% Dayton		
Front right	225/40R18	85% Dayton		
Rear left	225/40R18	85% Falken		
Rear right	225/40R18	85% Falken		

Status	REPAIRABLE		
Magnitude	Medium		
Legal status	Unroadworthy		

## Impact Direction & Area of Damage:

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB

> Singapore 41780 Hotline: 6385 1171



Following our examination of the accident damage, we have calculated repair times and method, which are detailed on page 2 & 3. We would recommend a sum of \$7,300.00 and 8 working days for repair, which is sufficiently lower than the pre accident value to render the vehicle an economically and physically reliable proposition.

Subsidiaries of Impact Analysis Consultant:

- Impact Analysis Consulting Pte Ltd
   Impact Analysis Academy Pte Ltd
   IA Racking Solutions Pte Ltd
- IA Accounting & Consultancy Pte Ltd Infoknights International Services (Philippines) IABN Pte Ltd www.iaconsultingsg.com



Our reference 21-7104

Date 18/12/2020

Page 2

# Section A: Damaged Parts Assessment

Part's Description	Qty	Condition As inspected	Repairer's Estimate	Our Adjustment
List Items :		770070-000		
Boot lid	1	bent	689.80	689.80
Boot lid weatherstrip	1	abrade//nec	162.50	162.50
Boot lid inner trim	1	crumpled	166.80	166.80
Boot lid reflector @\$235.00	2	holder damaged	470.00	470.00
Boot lid sensor lock	1	malfunction/jammed	311.00	311.00
Boot lid lower lock	1	distorted	21.00	21.00
Rear number plate lamp @\$48.20	2	broken	96.40	96.40
Rear bumper	1	deformed	732.00	732.00
Rear bumper top beam	1	bent	133.00	133.00
Rear bumper reinforcement	1	bent	398.50	398.50
Rear bumper tow cover	1	damaged	39.00	39.00
Rear bumper reflector \$78.00	2	broken	156.00	156.00
Rear bumper side retainer @\$35.90	2	necessary	71.80	71.80
Rear end panel	1	bent	612.40	612.40
Rear end panel top garnish	1	deformed	155.00	155.00
Rear silencer box	1	bent/dented	678.70	678.70
Rear silencer chrome pipe	1	damaged	228.90	228.90
Rear fender inner trim @\$203.50	2	torn/crumpled	407.00	407.00
Tail lamp @\$369.50	2	damaged	739.00	739.00
Tail lamp panel @\$120.00	2	repair	240.00	0.00
Rear exhaust pipe insulator	1	crumpled	110.00	110.00
Rear exhaust mounting @\$31.00	2	snapped	62.00	62.00
Rear spare tyre floor panel	1	repair	895.00	0.00
Rear spare tyre floor panel top board	1	fractured	287.90	287.90

Subsidiaries of Impact Analysis Consultant:

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

<sup>•</sup> Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd

IA Accounting & Consultancy Pte Ltd - Infoknights International Services (Philippines) - IABN Pte Ltd www.iaconsultingsg.com



Our reference

21-7104

Date

18/12/2020

Rear fender Ih	1	repair.respray	895.20	0.00
Su	Sub- Total cost			6728.70
Percentage dis	count:	10%	875.89	672.87
Sub-To	tal cost:	s for parts	7883.01	6055.83
Special Nett Items:				
Rear bumper clip @\$5.00	10	necessary	50.00	50.00
Rear number plate casing	1	broken	59.00	59.00
Rear number plate	1	bent	50.00	50.00
Rear reverse sensor	1	malfunction	250.00	220.00
Rear number plate	1	bent	50.00	50.00
Rear spare tyre floor panel insulation (touch-up)	1	necessary	80.00	80.00
Rear end panel top garnish clips @\$5.00	2	necessary	10.00	10.00
Rear end panel sealant	1	necessary	50.00	50.00
Sub-To		for parts	599.00	569.00
Parts Repair				
•	*		0.00	0.00
Sui	Sub- Total costs			0.00
Total	Total costs for parts		8482.01	6624.83

No.25 Kaki Bukit Road 4

#06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

<sup>•</sup> Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd

IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd www.iaconsultingsg.com

Our reference

21-7104

Date

18/12/2020

Page

3

## Section B: Labour Cost Calculation

No.25 Kaki Bukit Road 4

#06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

	Hourly rate	Manhr. Req.	Total	
To dismantle, replace, cut, weld, knock out dents to straighten accident parts as-mentioned on the 'Parts Repair' column inclusive of replacement parts.	\$ 45.00	23	\$	1,035.00
Putty & Spray painting to adjacent panels. Job allowance. Paint / material.		Sub-contract work.		1,100.00
Apply rust proofing on the adjacent panels.	els. Sub-contract work.		\$	80.00
Remove and replace rear exhaust system	\$ 45.00	2	\$	90.00
Remove and replace rear bumper reverse sensor & conduct distance safety setting.	\$ 45.00	1.7	\$	76.50
Remove and refix upholstery to facilitate the repair works	\$ 45.00	2	\$	90.00
Conduct water leak test for rear portion associated repair works	\$ 45.00	1	\$	45.00
Wiring / bulb checking (inclusive of re-focus / re-adjust on angle of light intensity.)	\$ 45.00	0.8	\$	36.00
	Total la	bour cost	\$	2,552.50

Manhour rate and the number of manhours required for each repairing task are formulated based on individual workshop's operating cost and in-house@ IA Research Guidelines respectively.

<sup>■</sup> Impact Analysis Consulting Pte Ltd → Impact Analysis Academy Pte Ltd → IA Racking Solutions Pte Ltd

IA Accounting & Consultancy Pte Ltd - Infoknights International Services (Philippines) - IABN Pte Ltd www.iaconsultingsg.com



Our reference 21-7104

Date 18/12/2020

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

# Section C: Summary Table of Total Repair Cost

Description		Cost	
Damaged Parts Assessment (See section A)		\$6,624.83	
Labour Cost Calculation (See section B)  Total cost  Further discount 20%		\$2,552.50 \$9,177.33	
		Total Repair Cost	

We would recommend a sum of	\$7,300.00	and	8	working days for repair.
No further items will be approved to	without our expres	sed written agree	ment. Any sig	gnificant additional
items will be subject to a suppleme	entary report.			

N

Mechanical Engineer, Accident Expert Witness, Licensed Appraiser (Automobile)

B.Eng. (Hons, NUS)

Diploma.Mechanical Engineering

NTC-2 Automovite Technology

Sr.MIES, Institution of Engineers, Singapore (#20100091)

MATAI, Maryland Association of Traffic Accident Investigators

IAARS, International Association of Accident Reconstruction Specialists

PMC of Singapore Business Advisors & Consultants Council

ACTA certified Trainer, Singapore

Enterprise Singapore - Recognised Certification for Management Consultants

IMI Professional Certificate In Vehicle Accident Damage Assessment (UK)

Subsidiaries of Impact Analysis Consultant:

- Impact Analysis Consulting Pte Ltd
   Impact Analysis Academy Pte Ltd
   IA Racking Solutions Pte Ltd
- ◆ IA Accounting & Consultancy Pte Ltd
   ◆ Infoknights International Services (Philippines)
   ◆ IABN Pte Ltd
   www.iaconsultingsg.com





























































































































































