

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CC6/AIG21010001/UGA3Q2**Date:** 19/07/2022REFERENCE

|                              |                                      |                             |              |
|------------------------------|--------------------------------------|-----------------------------|--------------|
| Handling Insurer:            | AIG Asia Pacific Insurance Pte. Ltd. | Policy No:                  | 1800101326   |
| <b>Claimant Vehicle No :</b> | SMM7052G                             | <b>Insured Vehicle No :</b> | SMD5517T     |
| Date of Loss:                | 23/09/2021                           | Nature of Claim:            | TP           |
|                              |                                      | Claim No:                   | 8371219895SG |

DESCRIPTION & IDENTIFICATION OF VEHICLE

|                             |                                   |             |                   |
|-----------------------------|-----------------------------------|-------------|-------------------|
| Reg No:                     | <b>SMM7052G</b>                   | Engine No:  | R16B25510611      |
| Make & Model:               | HONDA CIVIC, 1.6 VTI (A)          | Chassis No: | MRHFC5650KT000587 |
| Reg. Date:                  | 10/07/2019 (Man. Year: 2019)      | Odometer:   | 41164 km          |
| Colour:                     | Grey                              |             |                   |
| Engine Capacity:            | 1597 cc                           |             |                   |
| Market Value/New Car Price: | N/A                               |             |                   |
| Sum Insured (S\$):          | <b>Market Value/New Car Price</b> |             |                   |

CONDITION OF VEHICLE AT THE TIME OF SURVEY

|                          |                         |                      |                          |                         |
|--------------------------|-------------------------|----------------------|--------------------------|-------------------------|
| General Condition:       | Steering (Serviceable): | Yes                  | Footbrake (Serviceable): | Yes                     |
| Handbrake (Serviceable): | Yes                     | Engine Modification: | No                       | Pre-accident Condition: |

CONDITION OF TYRES

|                   |             |                  |             |
|-------------------|-------------|------------------|-------------|
| Front Tyre Size:  | 215/55Z R16 | Rear Tyre Size:  | 215/55Z R16 |
| Front Left Side:  | Dunlop 6 mm | Rear Left Side:  | Dunlop 6 mm |
| Front Right Side: | Dunlop 6 mm | Rear Right Side: | Dunlop 6 mm |

*The above values represent the remaining tyre treads depth*

| <b>COST OF CLAIMS</b>                            | <b>Repairer's</b> | <b>Adjuster's</b> | <b>Difference</b> | <b>Diff %</b> |
|--------------------------------------------------|-------------------|-------------------|-------------------|---------------|
| Parts                                            | 33,048.00         | 19,950.56         | 13,097.44         | 39.63         |
| Miscellaneous Items                              | 0.00              | 0.00              | 0.00              |               |
| Labour                                           | 9,250.00          | 6,490.00          | 2,760.00          | 29.84         |
| Paintwork Labour                                 | 0.00              | 0.00              | 0.00              |               |
| Towing                                           | 0.00              | 0.00              | 0.00              |               |
| <b>Calculated Gross Total (S\$)</b>              | <b>42,298.00</b>  | <b>26,440.56</b>  | <b>15,857.44</b>  | <b>37.49</b>  |
| <b>Approved Total (Overridden) (S\$)</b>         |                   | <b>21,000.00</b>  |                   |               |
| <b>Nett Amount (S\$)</b>                         | <b>42,298.00</b>  | <b>21,000.00</b>  | <b>21,298.00</b>  | <b>50.35</b>  |
| <b>+ Car Rental (44.0 x S\$100.00/day) (S\$)</b> |                   | 4,400.00          |                   |               |
| <b>+ Doc/Search Fee (S\$)</b>                    |                   | 7.45              |                   |               |
| <b>Nett Liability (S\$)</b>                      |                   | <b>25,407.45</b>  |                   |               |

INSPECTION

|                             |                          |                                                                                                           |
|-----------------------------|--------------------------|-----------------------------------------------------------------------------------------------------------|
| Date of Assignment:         | 27/09/2021               | Quan De Motor Trading<br>BLK 1 KAKI BUKIT AVENUE 6 #01-67 AUTOBAY<br>SINGAPORE 417883<br>Singapore 417883 |
| Date Inspected:             | 27/09/2021 Inspected At: |                                                                                                           |
| Estimated Period of Repair: | 35.0 days                |                                                                                                           |

**Adjuster:** MARCUS CHUA**Manager:** Chong Pui Lin

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

| No. | Qty | Part No. | Particulars                            | Condition                | Repairer's | Amount       |
|-----|-----|----------|----------------------------------------|--------------------------|------------|--------------|
| 1   | 1   |          | *BOOTLID                               | Dented / Buckled         | 554.90 F   | *554.90 FL   |
| 2   | 1   |          | *BOOTLID REAR LOGO                     | Necessary                | 14.00 F    | *14.00 FL    |
| 3   | 1   |          | *BOOTLID IVTEC EMBLEM                  | Necessary                | 22.00 F    | *22.00 FL    |
| 4   | 1   |          | *BOOTLID CIVIC EMBLEM                  | Necessary                | 20.00 F    | *20.00 FL    |
| 5   | 1   |          | *BOOTLID OUTER GARNISH                 | Warped                   | 114.80 F   | *114.80 FL   |
| 6   | 2   |          | *BOOTLID REFLECTORS                    | Serviceable              | 279.20 F   | *- FL        |
| 7   | 1   |          | *BOOTLID INNER LOCK                    | Bent                     | 84.90 F    | *84.90 FL    |
| 8   | 1   |          | *BOOTLID WEATHERSTRIP                  | Twisted                  | 70.00 F    | *70.00 FL    |
| 9   | 1   |          | *BOOTLID INNER TRIM                    | Deformed / Torn          | 182.30 F   | *182.30 FL   |
| 10  | 1   |          | *SET BOOTLID INNER TRIM CLIPS          | Necessary                | 30.00 F    | *30.00 FL    |
| 11  | 1   |          | *REAR BUMPER                           | Distorted                | 617.20 F   | *617.20 FL   |
| 12  | 1   |          | *REAR BUMPER DIFFUSER                  | Distorted                | 266.30 F   | *266.30 FL   |
| 13  | 1   |          | *REAR BUMPER TOW COVER                 | Torn                     | 9.30 F     | *9.30 FL     |
| 14  | 1   |          | *REAR BUMPER SIDE COVER RH             | Distorted                | 41.60 F    | *41.60 FL    |
| 15  | 2   |          | *REAR BUMPER SIDE RETAINERS            | Bent                     | 23.00 F    | *23.00 FL    |
| 16  | 1   |          | *REAR BUMPER BEAM                      | Distorted                | 188.00 F   | *188.00 FL   |
| 17  | 1   |          | *SET REAR BUMPER CLIPS                 | Necessary                | 35.00 F    | *35.00 FL    |
| 18  | 1   |          | *REAR END PANEL                        | Badly Dented             | 277.50 F   | *277.50 FL   |
| 19  | 1   |          | *REAR END PANEL TOP GARNISH            | Twisted                  | 108.60 F   | *108.60 FL   |
| 20  | 2   |          | *REAR TAIL LAMPS                       | Cracked                  | 596.80 F   | *596.80 FL   |
| 21  | 1   |          | *REAR TAIL LAMPS HOUSING PANELS        | N/S Repair / O/S Buckled | 290.00 F   | *145.00 FL   |
| 22  | 1   |          | *REAR FENDER RH                        | Warped / Buckled         | 812.30 F   | *812.30 FL   |
| 23  | 1   |          | *REAR FENDER INNER TRIM RH             | Distorted                | 224.60 F   | *224.60 FL   |
| 24  | 1   |          | *REAR FLOOR PANEL                      | Crumpled / Buckled       | 911.40 F   | *911.40 FL   |
| 25  | 1   |          | *REAR FLOOR PANEL TOP BOARD            | Torn                     | 316.00 F   | *316.00 FL   |
| 26  | 1   |          | *REAR CHASSIS MEMBER RH                | Repair                   | 545.20 F   | *- FL        |
| 27  | 1   |          | *REAR EXHAUST                          | Repair                   | 596.20 F   | *- FL        |
| 28  | 1   |          | *REAR EXHAUST HEAT SHIELD              | Not Necessary            | 84.50 F    | *- FL        |
| 29  | 1   |          | *REAR WINDSCREEN MOULDING              | Necessary                | 66.50 F    | *66.50 FL    |
| 30  | 1   |          | *BONNET                                | Buckled                  | 683.50 F   | *683.50 FL   |
| 31  | 1   |          | *BONNET INSULATOR                      | Distorted                | 87.80 F    | *87.80 FL    |
| 32  | 1   |          | *SET BONNET INSULATOR CLIPS            | Necessary                | 45.00 F    | *45.00 FL    |
| 33  | 2   |          | *BONNET HINGES                         | Bent                     | 75.20 F    | *75.20 FL    |
| 34  | 1   |          | *BONNET LOCK                           | Bent                     | 100.40 F   | *100.40 FL   |
| 35  | 1   |          | *BONNET CABLE                          | Jammed                   | 121.20 F   | *121.20 FL   |
| 36  | 1   |          | *BONNET RUBBER                         | Necessary                | 32.00 F    | *32.00 FL    |
| 37  | 1   |          | *FRONT GRILLE                          | Distorted                | 279.80 F   | *279.80 FL   |
| 38  | 1   |          | *FRONT GRILLE CHROME                   | Broken                   | 114.50 F   | *114.50 FL   |
| 39  | 1   |          | *FRONT GRILLE H LOGO                   | Cracked                  | 17.20 F    | *17.20 FL    |
| 40  | 1   |          | *FRONT BUMPER                          | Distorted                | 579.90 F   | *579.90 FL   |
| 41  | 1   |          | *FRONT BUMPER CENTRE GRILLE            | Twisted                  | 91.00 F    | *91.00 FL    |
| 42  | 2   |          | *FRONT BUMPER SIDE RETAINERS           | Bent                     | 61.00 F    | *61.00 FL    |
| 43  | 1   |          | *SET FRONT BUMPER CLIPS                | Necessary                | 50.00 F    | *50.00 FL    |
| 44  | 1   |          | *FRONT BUMPER BEAM                     | Bent                     | 394.90 F   | *394.90 FL   |
| 45  | 1   |          | *FRONT BUMPER LICENSE PLATE GARNISH    | Torn                     | 48.50 F    | *48.50 FL    |
| 46  | 1   |          | *FRONT BUMPER TOP BEAM                 | Bent                     | 245.30 F   | *245.30 FL   |
| 47  | 2   |          | *FRONT BUMPER FOG LAMP GARNISHES       | Not Necessary            | 136.00 F   | *- FL        |
| 48  | 2   |          | *FRONT BUMPER FOG LAMPS                | Not Necessary            | 570.00 F   | *- FL        |
| 49  | 2   |          | *HEADLAMPS                             | Cracked / Broken         | 1,377.00 F | *1,377.00 FL |
| 50  | 1   |          | *FRONT SUPPORT PANEL                   | Distorted                | 600.20 F   | *600.20 FL   |
| 51  | 1   |          | *FRONT SUPPORT PANEL TOP GARNISH       | Distorted                | 142.30 F   | *142.30 FL   |
| 52  | 1   |          | *FRONT SUPPORT PANEL TOP GARNISH CLIPS | Necessary                | 25.00 F    | *25.00 FL    |
| 53  | 2   |          | *AIR GUIDES                            | Torn                     | 170.00 F   | *170.00 FL   |
| 54  | 2   |          | *AIR CON CONDENSER                     | Distorted                | 704.40 F   | *704.40 FL   |
| 55  | 1   |          | *AIR CON SUCTION HOSE                  | Bent                     | 109.90 F   | *109.90 FL   |

Report was unsubmitted during this print-out.

| No. | Qty | Part No. | Particulars                         | Condition         | Repairer's | Amount       |
|-----|-----|----------|-------------------------------------|-------------------|------------|--------------|
| 56  | 1   |          | *AIR CON DISCHARGE HOSE             | Bent              | 101.20 F   | *101.20 FL   |
| 57  | 1   |          | *AIR CON LIQUID PIPE                | Bent              | 100.80 F   | *100.80 FL   |
| 58  | 1   |          | *AIR CLEANER BOX ASSY               | Cracked           | 165.40 F   | *165.40 FL   |
| 59  | 1   |          | *AIR CLEANER INTAKE DUCT            | Distorted         | 82.30 F    | *82.30 FL    |
| 60  | 1   |          | *AIR RESONATOR BOX                  | Dented            | 58.10 F    | *58.10 FL    |
| 61  | 1   |          | *RADIATOR                           | Distorted         | 1,100.50 F | *1,100.50 FL |
| 62  | 1   |          | *RADIATOR TOP HOSE                  | Torn              | 35.00 F    | *35.00 FL    |
| 63  | 1   |          | *RADIATOR FAN ASSY                  | Cracked / Jammed  | 783.50 F   | *783.50 FL   |
| 64  | 1   |          | *RADIATOR SPARE TANK                | Deformed          | 95.00 F    | *95.00 FL    |
| 65  | 1   |          | *EGR VALVE                          | Cracked           | 420.50 F   | *420.50 FL   |
| 66  | 1   |          | *WATER PIPE                         | Bent              | 133.20 F   | *133.20 FL   |
| 67  | 1   |          | *FRONT FENDERS                      | Buckled / Twisted | 901.60 F   | *901.60 FL   |
| 68  | 1   |          | *FRONT FENDER INNERSHIELDS          | O/S Torn          | 225.20 F   | *112.60 FL   |
| 69  | 2   |          | *REAR FENDER INNERSHIELD CLIPS      | Necessary         | 39.00 F    | *39.00 FL    |
| 70  | 1   |          | *SET FRONT FENDER INNER ARCH PANELS | Repair            | 203.00 F   | *- FL        |
| 71  | 1   |          | *ALTERNATOR                         | Serviceable       | 1,521.80 F | *- FL        |
| 72  | 1   |          | *WIPER GARNISH                      | Not Necessary     | 162.30 F   | *- FL        |
| 73  | 2   |          | *WIPER GARNISH SIDE GRILLES         | Distorted         | 64.00 F    | *64.00 FL    |
| 74  | 2   |          | *FRONT WINDSCREEN                   | Cracked           | 1,814.90 F | *1,814.90 FL |
| 75  | 1   |          | *SET FRONT WINDSCREEN MOULDING      | Necessary         | 250.00 F   | *250.00 FL   |
| 76  | 1   |          | *ENGINE MOUNTING & BRACKET RH       | Cracked / Torn    | 285.30 F   | *285.30 FL   |
| 77  | 1   |          | *DRIVE SHAFT CONNECTOR BRACKET      | Broken            | 650.00 F   | *650.00 FL   |
| 78  | 1   |          | *OXYGEN SENSOR                      | Bent              | 140.00 F   | *140.00 FL   |
| 79  | 1   |          | *FRONT EXHAUST HEATSHIELD TOP       | Bent              | 80.00 F    | *80.00 FL    |
| 80  | 1   |          | *FRONT EXHAUST HEATSHIELD BOTTOM    | Bent              | 82.00 F    | *82.00 FL    |
| 81  | 1   |          | *FRONT EXHAUST SENSOR               | Damaged           | 121.40 F   | *121.40 FL   |
| 82  | 1   |          | *FRONT EXHAUST CATALYTIC            | Dented            | 1,251.00 F | *1,251.00 FL |
| 83  | 1   |          | *FRONT DRIVESHAFT RH                | Broken            | 927.90 F   | *927.90 FL   |
| 84  | 1   |          | *FRONT ENGINE CROSS MEMBER          | Serviceable       | 1,455.30 F | *- FL        |
| 85  | 1   |          | *RADIATOR T JOINT HOSE              | Torn              | 68.50 F    | *68.50 FL    |
| 86  | 1   |          | *WATER HOSE                         | Torn              | 60.00 F    | *60.00 FL    |
| 87  | 1   |          | *INTAKE MANIFOLD                    | Cracked           | 850.20 F   | *850.20 FL   |
| 88  | 1   |          | *STEERING RACK ASSY                 | Not Necessary     | 1,861.20 F | *- FL        |
| 89  | 1   |          | *BY PASS VALVE                      | Damaged           | 209.40 F   | *209.40 FL   |
| 90  | 1   |          | *REAR FENDER QUARTER GLASS RH       | Necessary         | 155.90 F   | *155.90 FL   |
| 91  | 1   |          | *AIR CON ALUMINIUM PIPE             | Bent              | 105.00 F   | *105.00 FL   |
| 92  | 1   |          | *WASHER TANK                        | Torn              | 182.40 F   | *182.40 FL   |
| 93  | 1   |          | *WATER TANK                         | Torn              | 86.50 F    | *86.50 FL    |
| 94  | 2   |          | *HEADLAMP TOP CHROME                | Broken            | 224.60 F   | *224.60 FL   |
| 95  | 1   |          | *FRONT FENDER TOP GARNISH RH        | Distorted         | 65.00 F    | *65.00 FL    |
| 96  | 1   |          | *ACTUATOR BY PASS VALVE             | Cracked           | 235.00 F   | *235.00 FL   |
| 97  | 1   |          | *REAR LICENSE PLATE                 | Bent              | 50.00 FS   | *40.00 FS    |
| 98  | 1   |          | *SET REAR BUMPER REVERSE SENSOR     | Shorted           | 280.00 FS  | *200.00 FS   |
| 99  | 1   |          | *REAR WINDSCREEN SEALANT            | Necessary         | 50.00 FS   | *40.00 FS    |
| 100 | 1   |          | *REAR WINDSCREEN INNER SEAL         | Necessary         | 50.00 FS   | *40.00 FS    |
| 101 | 1   |          | *REAR END PANEL SEALANT             | Necessary         | 50.00 FS   | *50.00 FS    |
| 102 | 1   |          | *SET REAR FLOOR PANEL INSULATOR     | Necessary         | 180.00 FS  | *120.00 FS   |
| 103 | 1   |          | *SET REAR REVERSE CAMERA            | Not Necessary     | 380.00 FS  | *- FS        |
| 104 | 1   |          | *FRONT LICENSE PLATE                | Bent              | 50.00 FS   | *40.00 FS    |
| 105 | 1   |          | *ERP BRACKET                        | Necessary         | 30.00 FS   | *20.00 FS    |
| 106 | 1   |          | *FRONT WINDSCREEN SEALANT           | Necessary         | 50.00 FS   | *40.00 FS    |
| 107 | 1   |          | *FRONT WINDSCREEN INNER SEAL        | Necessary         | 50.00 FS   | *40.00 FS    |
| 108 | 1   |          | *FRONT WINDSCREEN SOLAR FILM        | Necessary         | 180.00 FS  | *150.00 FS   |
| 109 | 1   |          | *BOT RADIATOR COOLANT               | Necessary         | 50.00 FS   | *30.00 FS    |

F=Franchise part. S=SpcNett. L=ListItemDisc.

|                                                           |                  |                  |
|-----------------------------------------------------------|------------------|------------------|
| <b>Sub Total (\$\$)</b>                                   | <b>33,048.00</b> | <b>24,735.70</b> |
| <b>- List Item Discount on L Items 0.00/20.00% (\$\$)</b> | 0.00             | 4,785.14         |
| <b>Total Parts (\$\$)</b>                                 | <b>33,048.00</b> | <b>19,950.56</b> |

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

| No                              | Particulars                                         | Lab.Type | Repairer's      | Amount          |
|---------------------------------|-----------------------------------------------------|----------|-----------------|-----------------|
| <b>Labour Items</b>             |                                                     |          |                 |                 |
| 1                               | TO CHECK WIRING                                     | New      | 150.00          | 30.00           |
| 2                               | TO REMOVE & REINSTALL REVERSE SENSOR                | New      | 120.00          | 50.00           |
| 3                               | TO REMOVE & REFIX BOOTLID MECHANISM                 | New      | 80.00           | 60.00           |
| 4                               | TO REMOVE & REFIX CUSHION UPHOLSTERY                | New      | 120.00          | 100.00          |
| 5                               | TO REMOVE & REFIX REAR WINDSCREEN                   | New      | 150.00          | 120.00          |
| 6                               | TO REMOVE & REFIX FUEL TANK                         | New      | 80.00           | 0.00            |
| 7                               | TO REMOVE & REFIX AIR-CON & REFILL GAS              | New      | 150.00          | 100.00          |
| 8                               | TO LIFT UP ENGINE TO FACILITATE REPAIRS & REINSTALL | New      | 450.00          | 350.00          |
| 9                               | TO REMOVE & REFIX UNDERCARRIAGE                     | New      | 400.00          | 350.00          |
| 10                              | TO REMOVE & REFIX FRONT WINDSCREEN                  | New      | 150.00          | 120.00          |
| 11                              | TO REMOVE & REFIX DASHBOARD                         | New      | 280.00          | 0.00            |
| 12                              | TO CONDUCT WHEEL ALIGNMENT                          | New      | 120.00          | 60.00           |
| 13                              | TO SPRAY RUST PROOFING                              | New      | 200.00          | 150.00          |
| 14                              | LABOUR FOR PANEL BEATING ,WELDING & RENEW PARTS     | New      | 3,800.00        | 3,000.00        |
| 15                              | SPRAY PAINTING                                      | New      | 3,000.00        | 2,000.00        |
| <b>Gross Labour Cost (\$\$)</b> |                                                     |          | <b>9,250.00</b> | <b>6,490.00</b> |

Report was unsubmitted during this print-out.

< END OF ESTIMATES >