



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJX 1751P

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BONNET	DENTED	873.20	873.20
1	BONNET INNER RUBBER	NOT NECESSARY	45.00	-
2	BONNET HINGES @\$85.00	TO REPAIR SEE LABOUR	170.00	-
1	BONNET LOCK	TWISTED	161.00	161.00
1	FRONT BUMPER	DISTORTED	1,101.40	1,101.40
2	FRONT BUMPER SIDE RETAINERS @\$25.00	NECESSARY	50.00	50.00
1	FRONT BUMPER BEAM	BENT	455.00	455.00
1	FRONT GRILLE CHROME MOULDING	CRACKED	267.00	267.00
1	FRONT GRILLE	CRACKED	350.40	350.40
1	FRONT GRILLE 'H' LOGO	NECESSARY	45.00	45.00
1	FRONT SUPPORT PANEL	TO REPAIR SEE LABOUR	455.80	-
1	FRONT SUPPORT PANEL TOP GARNISH	TWISTED	162.30	162.30
2	HEADLAMPS @\$1100.20	CRACKED	2,200.40	2,200.40
1	HEADLAMP LOWER BRACKET O/S	BENT	34.20	34.20
1	FRONT FENDER O/S	TO REPAIR SEE LABOUR	566.30	-
1	AIR CON CONDENSER	NOT NECESSARY	899.00	-
	LESS 20% DISCOUNT		-1,567.20	-1,139.98
			6,268.80	4,559.92
<u>SPECIAL NETT ITEMS</u>				
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	48.00	45.00
1	FRONT LICENCE PLATE (SN)	CRACKED	50.00	40.00
1	SET FRONT BUMPER LOWER CENTRE GARNISH W/WIRE MESH (SN)	DISTORTED	480.00	480.00
1	SET FRONT SUPPORT PANEL TOP GARNISH CLIPS (SN)	NECESSARY	30.00	30.00
			608.00	595.00
<u>LABOUR</u>				
	TO CHECK WIRING.		50.00	20.00
	TO SPRAY RUST PROOFING.		80.00	30.00

Report Ref No. CS/TP21010046/Uuf3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REFILL AIR CON GAS.	NOT NECESSARY	120.00	-
	TO RESET & REPROGRAMME DIAGNOSIS SYSTEM.		100.00	100.00
	LABOUR FOR PANEL BEATING & REPLACED PARTS.		680.00	600.00
	INCLUSIVE OF THE REPAIR OF BONNET HINGES, FRONT SUPPORT PANEL AND FRONT FENDER O/S.			
	TO PUTTY & SPRAY PAINTING.		1,180.00	1,000.00
			2,210.00	1,750.00
GRAND TOTAL			9,086.80	6,904.92
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,500.00

Report Ref No. CS/TP21010046/Uuf3e2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.