

practicing Management Consultant (PMC) of SBACC Approved Training Organisation (ATO) of Workforce Singapore

Our reference:

21-7838

Date:

16/6/2021

c/o Garage 13 Pte Ltd 8 Kaki Bukit Ave 4 #03-46 Premier@KB Singapore 415875

Dear Sirs

RE:

Road Traffic Accident on 5/6/2021

Koh Chee Siong Derek

In accordance with your instructions received in this office on examine the vehicle on

8/6/2021 , we made arrangements to

at above-mentioned address. The following data was

No.25 Kaki Bukit Road 4

#06-46 Synergy @KB Singapore 41780

Hotline: 6385 1171

8/6/2021

recorded:

#### Vehicle details


			/
Make	Hyundai	Registration	SJT6478S
Model	Elantra Avante	Chassis	KMHDU41BR9U771057
Colour	Silver	Gearbox	Auto
Odometer	214954km	Paintwork	Good
Steering	In order	Brakes	In order
Condition	Good		

### Tyre Depths

Front left	195/60R15	85% Firenza		
Front right	195/60R15	85% Firenza		
Rear left	195/60R15	85% Firenza		
Rear right	195/60R15	85% Firenza		

Status	REPAIRABLE
Magnitude	Medium
Legal status	Unroadworthy

## Impact Direction & Area of Damage:

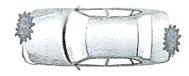

Following our examination of the accident damage, we have calculated repair times and method, which are detailed on page 2 & 3. We would recommend a sum of \$5,100.00 working days for repair, which is sufficiently lower than the pre accident value to render the vehicle an economically and physically reliable proposition.

- Impact Analysis Consulting Pte Ltd
   Impact Analysis Academy Pte Ltd
   IA Racking Solutions Pte Ltd
- IA Accounting & Consultancy Pte Ltd Infoknights International Services (Philippines) IABN Pte Ltd www.iaconsultingsg.com



Practicing Management Consultant (PMC) of SBACC
Approved Training Organisation (ATO) of Workforce Singapore

Our reference

21-7838

Date

16/6/2021

Page

2

## Section A: Damaged Parts Assessment

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

Section	Section A: Damaged Parts Assessment			
Part's Description	Qty	Condition As inspected	Repairer's Estimate	Our Adjustment
List Items:				
Front bumper	1	deformed	622.80	622.80 461
Front bumper side retainer @\$28	3.70 2	necessary	57.40	57.40
Front bumper reinforcement	1	bent	312.50	312.50 255
Front bumper sponge	1	damaegd	166.50	166.50 118.6
Front bumper lower grille	1	cracked	142.15	142.15 105, 2
Radiator grille	1	holder cracked	225.60	225.60/
Radiator grille logo	1	necessary	32.80	32.80
Head lamp @\$526.20	2	intact	1052.40	0.00×51C
Boot lid	1	repair.respray	982.30	0.00 X Y
Boot lid top lock	1	bent-in	145.50	145.50
Boot lid logo	1	necessary	32.20	32.20
Boot lid emblem 'AVANTE'	1	necessary	33.60	33.60
Boot lid emblem 'S'	1	necessary	18.40	18.40
Boot lid weather strip	1	reuse	112.50	0.00×5VC
Rear bumper	1	deformed	653.70	653.70 4 <i>84</i>
Rear bumper side retainer @\$26.	50 2	necessary	53.00	53.00
Rear bumper bracket @\$92.40	2	bent	184.80	184.80
Rear bumper sponge	1	damaegd	181.80	181.80 119
Rear bumper reinforcement	1	bent	302.10	302.10 <i>28</i> 7- <i>8</i>
Tail lamp @\$298.60	2	shifted	597.20	597.20 X SVC
Rear end panel	1	dented	587.50	587.50 X C
Rear end panel top garnish	1	reuse	152.40	0.00 XSVC
	Sub- Total	costs	6649.15	4349.55
Pe	ercentage discount :	20%	1329.83	869.91
	Sub-Total costs	for parts	5319.32	3479.64

<sup>•</sup> Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd

<sup>•</sup> IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd www.iaconsultingsg.com



Practicing Management Consultant (PMC) of SBACC Approved Training Organisation (ATO) of Workforce Singapore

Our reference

21-7838

	i otai cosis je	η ρατω			
	Total costs fo		5741.82	3902.14	
	Sub- Total	costs	0.00	0.00	
•	*	*	0.00	0.00	
Parts Repair					
	Sub-Total costs	s for parts	422.50	422.50	
Reverse sensor	set	malfunction	250.00	250.00	OO
Rear end panel sealant	1	necessary	40.00	40.00 X	
Rear bumper clip @\$5.50	10	necessary	55.00	55.00 ′	
Radiator grille clip @\$5.50	5	necessary	27.50	27.50	
Front bumper clip @\$5.00	10	necessary	50.00	50.00 2	
Date 16/6/2021					

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780

Hotline: 6385 1171

 <sup>●</sup> Impact Analysis Consulting Pte Ltd ● Impact Analysis Academy Pte Ltd ● IA Racking Solutions Pte Ltd

<sup>•</sup> IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd www.iaconsultingsg.com



practicing Management Consultant (PMC) of SBACC Approved Training Organisation (ATO) of Workforce Singapore

Our reference

21-7838

Date

16/6/2021

Page

3

## Section R: Labour Cost Calculation

No.25 Kaki Bukit Road 4

#06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

Section B: Labour Cost Calcul	ation					1
	Hourly	rate	19		Total	
To dismantle, replace, cut, weld, knock out dents to straighten accident parts as-mentioned on the 'Parts Repair' column inclusive of replacement parts.		5.00	20	\$	900.00	600
Putty & Spray painting to adjacent panels. Job allowance. Paint /	Sul	b-contr	act work.	\$	950.00	800
material.	Sul	n-contri	act work.	\$	50.00	10
Apply rust proofing on the adjacent panels.	54,	-		-		200
Remove and replace rear bumper reverse sensor & conduct distance	\$ 45	5.00	1.7	\$	76.50	
safety setting.	\$ 45	5.00	1	\$	45.00	₹\$ <u>2</u> 0
Wiring and bulb checking	'		our cost		2,021.50	

Manhour rate and the number of manhours required for each repairing task are formulated based on individual workshop's operating cost and in-house@ IA Research Guidelines respectively.

Impact Analysis Consulting Pte Ltd
 Impact Analysis Academy Pte Ltd
 IA Racking Solutions Pte Ltd

 <sup>◆</sup> IA Accounting & Consultancy Pte Ltd
 ◆ Infoknights International Services (Philippines)
 ◆ IABN Pte Ltd www.iaconsultingsg.com

Impact Analysis

Procticing Management Consultant (PMC) of SBACC Approved Training Organisation (ATO) of Workforce Singapore

Our reference

21-7838

Date

16/6/2021

No.25 Kaki Bukit Road 4 #06-46 Synergy @ KB Singapore 41780 Hotline: 6385 1171

# Section C: Summary Table of Total Repair Cost

P 6 394 - 24 12	ar iotal Keba
Description	Cost
Damaged Parts Assessment (See section A)	\$3,902.14
Further	\$780.43
discount 20%	ψ. 33.13
Recommended cost of parts replacement	\$3,121.71
Inhour Cost Calculation	

Labour Cost Calculation \$2,021.50 (See section B)

**Total Repair Cost** \$5,100.00 (Round off to hundred)

(2)

(1)

\$3050 We would recommend a sum of \$5,100.00

and

working days for repair.

No further items will be approved without our expressed written agreement. Any significant additional items will be subject to a supplementary report.

Mechanical Engineer, Accident Expert Witness, Licensed Appraiser (Automobile)

B.Eng. (Hons, NUS)

Diploma.Mechanical Engineering

NTC-2 Automovite Technology

Sr.MIES, Institution of Engineers, Singapore (#20100091)

MATAI, Maryland Association of Traffic Accident Investigators

IAARS, International Association of Accident Reconstruction Specialists

PMC of Singapore Business Advisors & Consultants Council

ACTA certified Trainer, Singapore

Enterprise Singapore - Recognised Certification for Management Consultants

IMI Professional Certificate In Vehicle Accident Damage Assessment (UK)

- Impact Analysis Consulting Pte Ltd
   Impact Analysis Academy Pte Ltd
   IA Racking Solutions Pte Ltd
- IA Accounting & Consultancy Pte Ltd Infoknights International Services (Philippines) IABN Pte Ltd www.iaconsultingsg.com