



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKQ 8996D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BONNET	BENT	1,076.30	1,076.30
1	FRONT RADIATOR TOP GARNISH	MTG CRACKED	299.30	299.30
1	FRONT BUMPER	BUCKLED	1,023.10	1,023.10
2	FRONT BUMPER SIDE RETAINER	SERVICEABLE	31.00	-
1	FRONT BUMPER SPONGE	SERVICEABLE	47.80	-
1	FRONT GRILLE BASE WITH CHROME	CRACKED	1,071.00	1,020.00
1	FRONT LOGO	NECESSARY	95.10	95.10
1	FRONT LOGO HOLDER	CRACKED	57.70	57.70
2	FRONT LOWER RH SIDE COVER/GARNISH	SERVICEABLE	39.20	-
1	TOWING COVER	SERVICEABLE	13.60	-
1	FRONT REINFORCEMENT BAR	TO REPAIR SEE LABOUR	614.10	-
2	FRONT BUMPER SENSOR	SERVICEABLE	361.80	-
1	REAR BUMPER	TO REPAIR SEE LABOUR	1,278.90	-
2	REAR BUMPER SIDE RETAINER	SERVICEABLE	47.40	-
2	REAR BUMPER TOWING COVER	SERVICEABLE	12.00	-
1	REAR REINFORCEMENT BAR	TO REPAIR SEE LABOUR	520.00	-
2	REAR REINFORCEMENT ARM	TO REPAIR SEE LABOUR	50.80	-
1	EXHAUST BOX	TO REPAIR SEE LABOUR	1,485.80	-
1	SET EXHAUST MOUNTING	SERVICEABLE	140.00	-
2	SET REVERSE SENSOR	SERVICEABLE	361.80	-
	LESS 20% DISCOUNT		-1,725.34	-714.30
			6,901.36	2,857.20
<u>SPECIAL NETT ITEMS</u>				
1	SET FRONT NUMBER PLATE WITH HOLDER (SN)	BENT	50.00	45.00
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	SET REAR BUMPER CLIPS (SN)	NOT NECESSARY	303.00	-

Report Ref No. CS/AGI21010109/Kqf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET FRONT RADIATOR TOP GARNISH CLIPS (SN)	NOT NECESSARY	60.00	-
			443.00	75.00
	LABOUR			
	SPRAY PAINTING ON ALL AFFECTED AREA (FRONT & REAR).		1,000.00	660.00
	LABOUR REMOVE/REFIX ACCIDENT DAMAGES PARTS TO KNOCK,JACK,CUT WELD AND REALIGN ACCIDENT AFFECTED AREA.INCLUSIVE OF THE REPAIR OF FRONT REINFORCEMENT BAR,REAR BUMPER,REAR REINFORCEMENT BAR,REAR REINFORCEMENT ARM AND EXHAUST BOX.		1,000.00	600.00
	TO CHECK WIRING SYSTEM & LIGHT.		100.00	30.00
	ANTI RUSH TREATMENT.		120.00	30.00
	TO CHECK & ADJUST WHEEL ALIGNMENT.	NOT NECESSARY	100.00	-
	TO REMOVE/REFIX REVERSE SENSOR (FRONT).		150.00	50.00
	TO REMOVE/REFIX REVERSE SENSOR (REAR).	NOT NECESSARY	150.00	-
	TO REMOVE/REFIX/REPLACE EXHAUST BOX.	NOT NECESSARY	380.00	-
	COMPUTER DIAGNOTIC AFTER REPAIR.	NOT NECESSARY	350.00	-
			3,350.00	1,370.00
GRAND TOTAL			10,694.36	4,302.20
RECOMMENDED COST OF REPAIRS				4,302.20

Report Ref No. CS/AGI21010109/Kqf3n2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.