



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2205755

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 19/09/2022
Reference CC6/CTI21010300/Aea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLB 292X
Insured Veh. SLN 2176Y
Claim No. SNM21D205650/C02
Policy No.
Accident Date 01/10/2021
Inspection Date 05/10/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21010300/Aea3q2 Date: 19/09/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLN 2176Y	Veh. Inspected	SLB 292X	
Policy No.		Coverage (\$)	0.00	
Claim No.	SNM21D205650/C02	Excess (\$)	0.00	
Assign From		Assign Date	05/10/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA ALTIS	c.c	1598	
Engine No.	HIDDEN	Year of Reg.	2009	
Chassis No.	MR053ZEE106148607	Colour	GOLD	
Odometer	216247 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/55 R16	FIRENZA	6 mm	
L/H Front Tyre	205/55 R16	FIRENZA	6 mm	
R/H Rear Tyre	205/55 R16	FIRENZA	6 mm	
L/H Rear Tyre	205/55 R16	FIRENZA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	01/10/2021	Inspection Date	05/10/2021	
Survey held at	XIN HUA WORKSHOP PTE LTD 23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING) SINGAPORE 415933			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLB 292X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	DISTORTED	495.00	495.00
1	FRONT BUMPER BADGE	NECESSARY	95.20	95.20
2	FRONT BUMPER SIDE RETAINERS @\$85.30	N/S DAMAGED	170.60	45.00
1	SET FRONT BUMPER CLIPS	NECESSARY	30.00	30.00
1	FRONT BUMPER REINFORCEMENT	DENTED	365.00	365.00
1	FRONT BUMPER LOWER GRILLE	NOT NECESSARY	165.80	-
1	FRONT BUMPER FOG LAMP LH	CRACKED	198.20	198.20
1	FRONT BUMPER FOG LAMP COVER LH	CRACKED	82.30	82.30
1	FRONT GRILLE	NOT NECESSARY	328.80	-
1	HEADLAMP LH	CRACKED	535.00	535.00
1	HEADLAMP LOWER BRACKET LH	NOT NECESSARY	123.80	-
1	SET HEADLAMP CLIPS LH	NECESSARY	30.00	10.00
1	FRONT FENDER LH	DISTORTED	486.20	486.20
1	FRONT FENDER INNER HOUSING (OUTER)	TO REPAIR SEE LABOUR	391.30	-
1	FRONT FENDER EMBLEM VVTI LH	NECESSARY	72.20	43.00
1	FRONT FENDER BRACKET LH	BENT	65.20	65.20
1	FRONT FENDER INNER SHIELD LH	TORN	165.00	165.00
1	FRONT FENDER INNER SHIELD CLIPS	NECESSARY	30.00	30.00
1	FRONT RESONATOR BOX	CRACKED	189.20	189.20
1	FRONT RADIATOR	NOT NECESSARY	987.80	-
1	FRONT CONDENSER	NOT NECESSARY	876.90	-
1	FRONT AIR VENT	DEFORMED	108.60	108.60
1	FRONT DOOR LH	TO REPAIR SEE LABOUR	1,001.40	-
1	FRONT ABSORBER	BENT	428.60	326.00
1	FRONT ABSORBER TOP MOUNTING	NOT NECESSARY	119.50	-
1	FRONT LOWER ARM	BENT	598.60	375.00
1	FRONT KNUCKLE ARM	BENT	523.60	523.60
1	FRONT WHEEL BEARING	DAMAGED	172.50	172.50
1	FRONT ANTI ROLL BAR	NOT NECESSARY	253.10	-

Report Ref No. CC6/CTI21010300/Aea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	FRONT ANTI ROLL BAR BUSH @\$36.00	NOT NECESSARY	72.00	-
1	FRONT ANTI ROLL BAR LINK	NOT NECESSARY	125.10	-
1	FRONT STABILIZER LINKAGE	NOT NECESSARY	145.80	-
1	FRONT DRIVE SHAFT	NOT NECESSARY	1,210.10	-
1	STEERING RACK AND PINION	NOT NECESSARY	1,328.60	-
1	BONNET	DENTED	987.50	757.00
	LESS 25% DISCOUNT		-3,239.63	-1,274.25
			9,718.87	3,822.75
1	FRONT SPORT RIM LH (SN)	CUT	845.30	480.00
	LESS 25% DISCOUNT		-211.33	-
			633.97	480.00
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NUMBER PLATE W/COVER (SN)	NOT NECESSARY	50.00	-
1	FRONT TYRE LH (SN)	NOT NECESSARY	220.00	-
			270.00	-
	<u>LABOUR</u>			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF FRONT FENDER INNER HOUSING (OUTER) AND FRONT DOOR LH .		1,800.00	900.00
	SPRAY PAINTING.		1,800.00	850.00
	CHECK WIRING ON HEADLAMP .		120.00	30.00
	ANTI RUST.		180.00	50.00
	TO REMOVE CONDENSER AND TOP UP GAS.	NOT NECESSARY	120.00	-
	REMOVE AND INSTALL FRONT UNDERCARRIAGE.		180.00	180.00
	TO PERFORM COMPUTERIZE WHEEL ALIGNMENT.		120.00	80.00
			4,320.00	2,090.00
GRAND TOTAL			14,942.84	6,392.75

Report Ref No. CC6/CTI21010300/Aea3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,100.00
---	--	--	-----------------

Report Ref No. CC6/CTI21010300/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

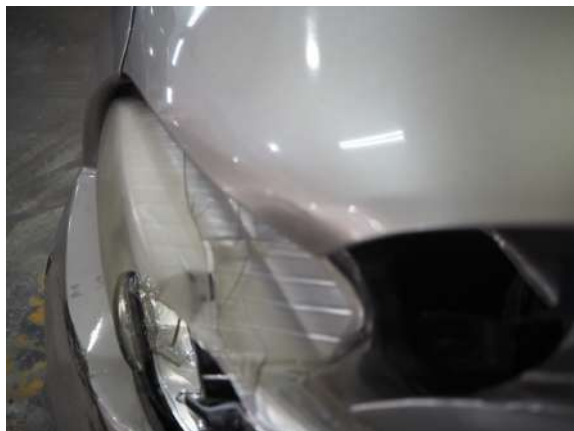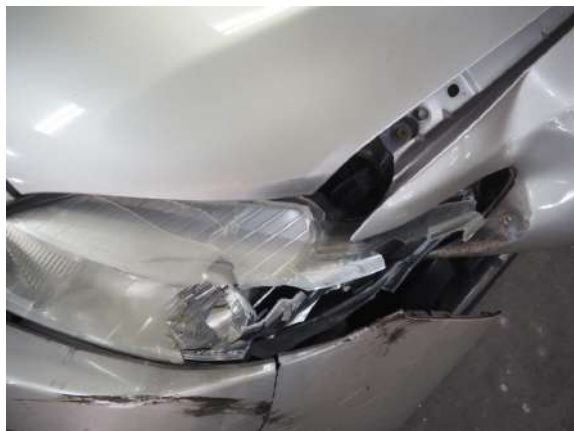



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLB 292X

RE-INSPECTION

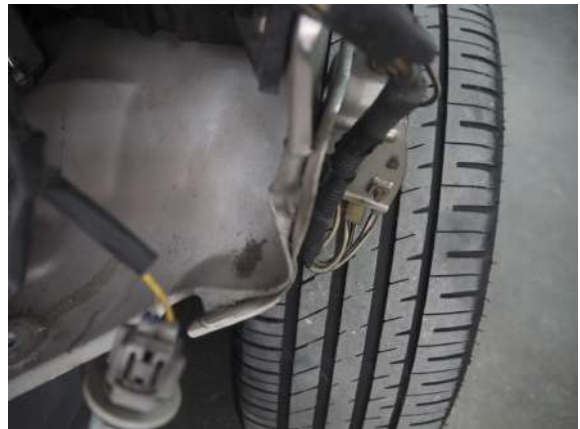



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

