

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CC6/AIG21010319/AGA3Q2**Date:** 13/01/2022REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	7210104006
<b>Claimant Vehicle No :</b>	SLB2669E	<b>Insured Vehicle No :</b>	SNB5043S
Date of Loss:	27/09/2021	Nature of Claim:	TP
		Claim No:	7024352791SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	<b>SLB2669E</b>		
Make & Model:	SUBARU FORESTER, 2.0 XT CVT AWD SR (A)	Engine No:	FA20A874603
Reg. Date:	31/03/2016 (Man. Year: 2016)	Chassis No:	JF1SJGK85GG067865
Colour:	Silver	Odometer:	84684 km
Engine Capacity:	1998 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/55 R18	Rear Tyre Size:	225/55 R18
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	725.44	676.40	49.04	6.76
Miscellaneous Items	0.00	0.00	0.00	
Labour	600.00	400.00	200.00	33.33
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (S\$)</b>	<b>1,325.44</b>	<b>1,076.40</b>	<b>249.04</b>	<b>18.79</b>
<b>Approved Total (Overridden) (S\$)</b>		<b>850.00</b>		
<b>(S\$)</b>	1,325.44	850.00	475.44	35.87
<b>+ GST 7.00/7.00% (S\$)</b>	92.78	59.50	33.28	35.87
<b>Nett Amount (S\$)</b>	<b>1,418.22</b>	<b>909.50</b>	<b>508.72</b>	<b>35.87</b>
<b>+ Loss of Use (3.0 x S\$80.00/day) (S\$)</b>		240.00		
<b>+ Doc/Search Fee (S\$)</b>		2.00		
<b>Nett Liability (S\$)</b>		<b>1,151.50</b>		
<b>Global Sum Settlement (S\$)</b>		<b>1,150.00</b>		

INSPECTION

Date of Assignment:	06/10/2021	
Date Inspected:	06/10/2021	Inspected At: Success United Pte Ltd (HQ) 2 Kaki Bukit Ave 2 #01-33, Kaki Bukit AutoHub Singapore 417921
Estimated Period of Repair:	2.0 days	

**Adjuster:** ADRIAN LING**Manager:** Chong Pui Lin

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT BUMPER ASSY	Deformed	795.40 FL	*795.40 FL
2	1		*FRT BUMPER BRACKET RH	Necessary	50.10 FL	*50.10 FL
3	1		*FRT WIPER COVER RH	Not Necessary	61.30 FL	*- FL
F=Franchise part. L=ListItemDisc.						
Sub Total (S\$)					906.80	845.50
- List Item Discount on L Items 20.00/20.00% (S\$)					181.36	169.10
Total Parts (S\$)					725.44	676.40

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	TO REMOVE ,REPAIR AND REPLACED DAMAGED BODYPARTS ,REALIGN BODYWORKS & WHERE CONSISTENT TO THE ACCIDENT	New	200.00	200.00
2	TO PUTTY AND RESPRAY PAINTING ON AFFECTED AREA	New	400.00	200.00
<b>Gross Labour Cost (S\$)</b>			<b>600.00</b>	<b>400.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >