LKK Auto Consultants #01-25 Paya Ubi Industrial Park, 51 Ubi Avenue 1 408933

Insurer Reference: SKB7527K Repairer Reference: SKB7527K

Repairer Reference: SKB7527K Registration: SKB7527K Date calculated: 11/11/2021 12:03 PM Printed: 11/11/2021 12:03 PM

Summary Information

Claim

Location: Singapore (SG) Work Provider: China Taiping Insurance

(Singapore) Pte Ltd

Full Report

Printed by: KK LAU Currency: SGD
Claim Reference: SKB7527K Date of Incident: 05/10/21

Estimated Repair Time: 10 Hire Car Start:
Actual Repair Days: Hire Car End:

Vehicle Details

Vehicle

Manufacturer: KIA

Model: CERATO/FORTE/K3

Sub Model: BASE MODEL
Model Sheet Number: 28 98 01
Registration: SKB7527K

VIN number: KNAFW411MB5451030

Odometer:

Model Specs

AIR CONDITIONING FOG LAMPS 1.6 LTR 95 KW TWO COAT METALLIC

PREPARE OFF VEHICLE


Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

All	
Underbody	

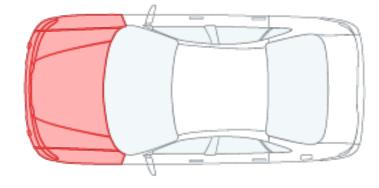

Tyres Condition

Tyre Brand Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Outer),

mm mm mm mm Middle), mm

Spare Tyre Brand Tread (Spare), mm

Labour

Code	Time Base 10 WU/h Description	Price = 42. WU	00 SGD/h Price SGD
86512R00 ZAX	RENEW FRONT BUMPER (BUMPER REMOVED) INCLUDES: GRILLE AND REQUIRED ATTACHED PARTS R + R. ATTACHED PARTS ASSEMBLE IF NECESS RENEW.	8.0	33.60
92000R00	R + R L/HEADLAMP DOES NOT INCLUDE: ADJUST HEADLAMP	5.0	21.00
92000R00	R + R R/HEADLAMP DOES NOT INCLUDE: ADJUST HEADLAMP	5.0	21.00
66400R00	RENEW BONNET INCLUDES: R + R BONNET AND NECESSARY ATTACHED PARTS, RENEW ATTACHED PARTS IF NECESSARY	6.0	25.20
64100R00)	R + R FRONT PANEL CPL	14.0	58.80
86150R00	R + R COWL COVER	3.0	12.60
97606R00)	R + R CONDENSER	5.0	21.00
28210R00	R + R INTAKE TUBE	2.0	8.40
09760A00	DRAIN + REFILL AIR CONDITIONING	5.0	21.00

Code	Description		WU	Price SGD
18600A00	ADJUST HEADLAMPS		3.0	12.60
0741	L/F WING REPAIR		20.0*	84.00
	Labour Cost Panel / Mechanical Labour	Hrs 7.60	WU 76.0	319.20
	Total of Labour			319.20

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	BONNET NEW PART PAINTING	17.0
	FRONT PANEL SURFACE PAINT	6.0
	FRONT BUMPER NEW PART PAINT K1R	50.0*
	L/F WING REPAIR PAINTING <50%	12.0

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	47.47
1009	FRONT PANEL SURFACE PAINT	11.95
0283	FRONT BUMPER NEW PART PAINT K1R	55.10
0741	L/F WING REPAIR PAINTING <50%	14.54

Labour Cost - Paint		Hrs	WU	Price SGD
Factor	42.00 SGD/h			
Time Paint			85.0	
Preparation Main Work Metal		2.50	25.0	105.00
Total	10 WU/h	11.00	110.0	462.00

Material Cost - Paint	Price SGD
New Part Painting	47.47
New Part Painting - Plastic K1R	55.10
Repair Painting	14.54
Surface-/Blend Paint	11.95
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	166.66

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01 Price SGD
0257	FRONT NUMBER PLATE	KNPL3	Original	35.00
0260	FRT NO PLATE REINF	86519A7010	Original	20.25
0283	FRONT BUMPER	86511A7000	Original	270.00
0293	FRONT SPOILER	86590A7000	Original	37.80
0315	FRONT IMPACT DAMPER	86520A7000	Original	128.25
0317	L/F BUMPER BRACKET	86513A7000	Original	18.00

Code	Description	Part Number	Part Source		Price SGD
0318	R/F BUMPER BRACKET	86514A7000	Original		18.00
0410	GRILLE	86350A7500	Original		140.00
0471	BONNET	66400A7000	Original		520.00
0481	BONNET INSULATION	81125A7000	Original		120.00
0492	BONNET LOCK	81130A7900	Original		35.00
0524	BONNET SEAL	86357A7000	Original		25.00
0561	LEFT HEADLAMP ASSY	92101A7120	Original		281.50
0562	RIGHT HEADLAMP ASSY		Original		281.50
1009	FRONT PANEL	64101A7000	Original		256.50
1395	COWL PANEL COVER	86150A7900	Original		450.00
4465	CONDENSER	97606A2001	Original		162.00
8390	AIR INTAKE DUCT	282103X900	Original		175.00
			J		
f: OEM Parts	Savings				0.00
n: Non-OEM Parts u: Used parts	Subtotal				2,973.80
a. 336a pa. 3	Total				2,973.80
Final Calculati	on				
- Illai Calculati	011				
				SGD	SGD
Dt-				2.072.00	
Parts				2,973.80	2 072 00
Total Parts					2,973.80
Labour Time Da	10 WII/b				
Labour Time Ba				319.20	
Total 76.0 WU Total of Labour	X 42.00 SGD/II			319.20	319.20
TOTAL OF LABOUR					319.20
Paint Work Time	a Rasa 10 WII/h				
	0.0 WU X 42.00 SGD/h			462.00	
Material Cost	7.0 WU X 42.00 SGD/II			166.66	
Total Paint Inclu	ding Matorial			100.00	628.66
Total Pallit Iliciu	инд масена				028.00
Repair Cost Exclu	ıdes GST				3,921.66
GST (+7.0%)					274.52
Repair Cost Inclu	ided GST				4,196.18
Deductions (Excl	udes GST)				
				-784.33	
•	Repair Cost Discount (+20.00%) -784.33 Total Of Deductions (Excludes GST)				-784.33
iotai oi beductit	is (Excludes 051)				-/07.33
Grand Total Exclu	ıdes GST				3,137.33
GST (+7.0%)					219.61
Crand Total Inch	.dad CCT				2 256 04

Comments

* - USER SUPPLIED DATA

Grand Total Included GST

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

3,356.94

