

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/AIG21010396/KVF3N2**Date:** 11/11/2021**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2100490949
Claimant Vehicle No :	SJT3160C	Insured Vehicle No :	SLH9540P
Date of Loss:	07/10/2021	Nature of Claim:	TP
		Claim No:	9030812655SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJT3160C	Engine No:	4GR0564588
Make & Model:	TOYOTA LEXUS, 2.5 IS250 (A)	Chassis No:	JTHBK262505099598
Reg. Date:	30/06/2009 (Man. Year: 2009)	Odometer:	158300 km
Colour:	Metallic Black		
Engine Capacity:	2500 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/45R17	Rear Tyre Size:	245/45R17
Front Left Side:	Pirelli 8 mm	Rear Left Side:	Pirelli 8 mm
Front Right Side:	Pirelli 8 mm	Rear Right Side:	Pirelli 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	16,428.49	9,383.71	7,044.78	42.88
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,020.00	2,520.00	1,500.00	37.31
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	20,448.49	11,903.71	8,544.78	41.79
Approved Total (Overridden) (S\$)		9,500.00		
Nett Amount (S\$)	20,448.49	9,500.00	10,948.49	53.54

INSPECTION

Date of Assignment:	11/10/2021	Eng Heng Automobil Trading Co (HQ)
Date Inspected:	11/10/2021	Inspected At: Blk 10 #01-01 Ang Mo Kio Part 2A AutoPoint
Estimated Period of Repair:	10.0 days	Singapore 568047

Adjuster: KENNETH KONG**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BOOT LID	Bent	937.24 F	*937.24 FL
2	2		*REAR BOOT LID HINGE-RIGHT/LEFT	Repair	264.00 F	*- FL
3	1		*REAR BOOT LID LOCK-UPPER	Repair	499.00 F	*- FL
4	1		*REAR BOOT LID LOCK-LOWER	Repair	322.00 F	*- FL
5	1		*LEXUS BADGE	Necessary	120.00 F	*70.00 FL
6	1		*IS250 BADGE	Necessary	120.00 F	*80.00 FL
7	1		*LEXUS EMBLEM	Necessary	120.00 F	*90.00 FL
8	1		*NO PLATE GARNISH	Cracked	254.00 F	*254.00 FL
9	1		*TAIL LAMP LH-BOOT LID	Cracked	654.89 F	*484.30 FL
10	1		*TAIL LAMP RH-BOOT LID	Serviceable	654.89 F	*- FL
11	1		*TAIL LAMP LH-FENDER	Cracked	569.40 F	*569.40 FL
12	1		*TAIL LAMP RH-FENDER	Serviceable	569.40 F	*- FL
13	1		*REAR BUMPER	Bent	921.30 F	*921.30 FL
14	1		*REAR BUMPER REFLECTOR-RIGHT	Serviceable	120.00 F	*- FL
15	1		*REAR BUMPER REFLECTOR-LEFT	Cracked	120.00 F	*120.00 FL
16	2		*REAR BUMPER SIDE RETAINER (RH/LH)	Distorted	120.00 F	*120.00 FL
17	1		*REAR BUMPER SPONGE	Cracked	235.00 F	*235.00 FL
18	1		*REAR BUMPER REINFORCEMENT	Bent	465.00 F	*465.00 FL
19	1		*REAR BUMPET TOW COVER	Missing	21.65 F	*21.65 FL
20	1		*REAR LEFT SIDE PANEL SIDE TRIM	Deformed	185.00 F	*185.00 FL
21	1		*REAR RIGHT SIDE PANEL TRIM	Serviceable	185.00 F	*- FL
22	1		*TYRE COMPARTMENT SPARE WHEEL COVER	Deformed	178.00 F	*178.00 FL
23	1		*REAR END PANEL	Bent	665.00 F	*665.00 FL
24	1		*REAR END PANEL TOP GARNISH	Cracked	365.00 F	*342.00 FL
25	1		*SPARE TYRE PANEL	Repair	565.00 F	*- FL
26	1		*TYRE COMPARTMENT TRAY COVER	Deformed	205.80 F	*205.80 FL
27	1		*REAR FENDER-LH	Buckled	1,124.90 F	*1,124.90 FL
28	1		*REAR FENDER SHIELD-LH	Serviceable	210.00 F	*- FL
29	1		*LEFT REAR DOOR-INNER LOCK	Repair	515.00 F	*- FL
30	1		*SET (03) GEAR BOX MOUNTING	Serviceable	145.00 F	*- FL
31	1		*SET ENGINE MOUNTING	Serviceable	362.10 F	*- FL
32	1		*REAR EXHAUST ASSEMBLY	Bent	2,446.70 F	*2,014.50 FL
33	6		*EXHAUST O RINGS	Necessary	201.60 F	*201.60 FL
34	1		*TYRE COMPARTMENT UNDERCOVER	Serviceable	365.80 F	*- FL
35	1		*SPARE TYRE LOCK	Cracked	188.90 F	*188.90 FL
36	1		*REAR LEFT FENDER LAMP GARNISH LOWER	Dented	78.50 F	*78.50 FL
37	1		*REAR LEFT FENDER LAMP GARNISH UPPER	Dented	92.15 F	*92.15 FL
38	1		*REAR RIGHT FENDER LAMP GARNISH LOWER	Dented	78.50 F	*78.50 FL
39	1		*REAR RIGHT FENDER LAMP GARNISH UPPER	Dented	92.15 F	*92.15 FL
40	1		*FRONT HEADLAMP HID BULB	Not Consistent With The Impact	380.00 F	*- FL
41	1		*REAR BOOT LID WEATHERSTRIP (50%)	Distorted/Dented	250.62 FS	*125.31 FS
42	1		*SET NO PLATE N BRACKET	Dented	80.00 FS	*45.00 FS
43	1		*SET REVERSE SENSOR	Dented/Shorted	380.00 FS	*380.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	16,428.49	10,365.20
- List Item Discount on L Items 0.00/10.00% (\$\$)	0.00	981.49
Total Parts (\$\$)	16,428.49	9,383.71

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	WORKMANSHIP TO CHANGE ENGINE MOUNTING & GEAR BOX MOUNTING	New	250.00	0.00
2	WORKMANSHIP TO PANEL BEAT,REPLACE REAR END PANEL,REAR BOOT LID,REAR BUMPER REINFORCEMENT,REAR LEFT FENDER,STRAIGHTEN AND REALIGN	New	1,800.00	1,200.00
3	WORKMANSHIP TO DISMANTLE WIRINGS,FITTINGS AND REFIT	New	350.00	120.00
4	RESPRAY PAINT REAR BOOT LID,LUGGUAGE COMPARTMENT,REAR BUMPER,REAR LEFT FENDER	New	1,500.00	1,200.00
5	COMPUTERISED WHEEL ALIGNMENT	New	120.00	0.00
Gross Labour Cost (\$)			4,020.00	2,520.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >