1/20/22, 9:04 AM Adjuster Report

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.

Our File No: CC3/AIG21010569/AVY3N2

AIG Building, 78 Shenton Way, #09-16

Singapore 079120 **Date:** 20/01/2022

REFERENCE

Insured/Claimant: NAGAR MEHUL HASMUKH Policy No: 7210105705

Date of Loss: 08/10/2021 Nature of Claim: OD Claim No: 9923033603SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SNB6228U

Make & Model: AUDI Q3 SPORTBACK, 1.4 TFSI S TRONIC (17) (A) Engine No: CZDC50059

Reg. Date: 31/08/2021 (Man. Year: 2021) Chassis No: WAUZZZF34M1156915

Colour: Red Odometer: 769 km

Engine Capacity: 1395 cc
Market Value/New Car Price: \$\$160,000.00

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/65R17 Rear Tyre Size: 215/65R17
Front Left Side: Falken 6 mm Rear Left Side: Falken 6 mm
Front Right Side: Falken 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS		Repairer's	Adjuster's	Difference	Diff %
Parts		16,624.00	7,709.76	8,914.24	53.62
Miscellaneous Items		0.00	0.00	0.00	
Labour		18,732.00	11,707.00	7,025.00	37.50
Paintwork Labour		0.00	0.00	0.00	
Towing		0.00	0.00	0.00	
	Calculated Gross Total (S\$)	35,356.00	19,416.76	15,939.24	45.08
	- Excess (S\$)	800.00	800.00	0.00	0.00
	(S\$)	34,556.00	18,616.76	15,939.24	46.13
	+ GST 7.00/7.00% (S\$)	2,418.92	1,303.17	1,115.75	46.13
	Nett Amount (S\$)	36,974.92	19,919.93	17,054.99	46.13

INSPECTION

Date of Assignment: 14/10/2021

Date Inspected: Premium Automobiles Pte Ltd (UBI)

55 Ubi Road 1

Singapore 408699

Estimated Period of Repair: 13.0 days

Adjuster: ADRIAN LING Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*REAR BUMPER	Not Necessary	1,634.00 FS	*-FS
2	1	*REAR BUMPER FIXING PARTS	Not Necessary	211.00 FS	*- FS
3	1	*REAR BUMPER SPOILER	Not Necessary	459.00 FS	*- FS
4	1	*REAR BUMPER BRACKET-RH	Not Necessary	48.00 FS	*- FS
5	1	*REAR BUMPER REFLECTOR-RH	Not Necessary	41.00 FS	*- FS
6	1	*REAR TAIL LIGHT-RH	Not Necessary	926.00 FS	*- FS
7	1	*REAR BUMPER GUIDE SECTION-RH	Not Necessary	63.00 FS	*-FS
8	2	*REAR WHEEL ARCH COVER-LH/RH	N/s Necessary/O/s Missing	536.00 FS	*428.80 FS
9	1	*REAR SECTIONAL PART-RH	Distorted	3,388.00 FS	
10	1	*1/4 GLASS	Necessary	614.00 FS	*490.80 FS
11	1	*PRIMER	Necessary	20.00 FS	*15.76 FS
12	1	*REAR WHEEL HOUSING LINER-RH	Not Necessary	241.00 FS	*-FS
13	1	*REAR WHEEL HOUSING LINER ATTACHMENT PARTS	Not Necessary	101.00 FS	*-FS
14	1	*REAR WHEEL SPOILER	Not Necessary	39.00 FS	*-FS
15	1	*REAR DOOR-RH	Dented	2,909.00 FS	*2,327.20 FS
16	1	*REAR DOOR OUTER SEAL-RH	Necessary	135.00 FS	*108.00 FS
17	1	*REAR DOOR ATTACHMENT PARTS	Not Necessary	311.00 FS	*- FS
18	1	*REAR DOOR CATCH-RH	Damaged	120.00 FS	*96.00 FS
19	1	*REAR DOOR SEAL INNER	Not Necessary	191.00 FS	*- FS
20	1	*SILL PANEL SEAL-RH	Not Necessary	135.00 FS	*-FS
21	1	*REAR DOOR LOWER COVER-RH	Cut	257.00 FS	*205.20 FS
22	1	*REAR DOOR HANDLE-RH	Cut	198.00 FS	*158.00 FS
23	1	*REAR DOOR HANDLE CAP-RH	Cut	27.00 FS	*21.60 FS
24	1	*REAR DOOR MOUNTING BAR-RH	Not Necessary	162.00 FS	*-FS
25	1	*REAR DOOR BOWDEN CABLE-RH	Not Necessary	52.00 FS	*-FS
26	1	*REAR DOOR WINDOW REGULATOR-RH	Not Necessary	282.00 FS	*-FS
27	1	*REAR DOOR WINDOW REGULATOR MOTOR-RH	Not Necessary	271.00 FS	*-FS
28	1	*REAR DOOR CONTROL UNIT	Not Necessary	400.00 FS	*-FS
29	1	*REAR TYRE RIM-RH	Not Necessary	1,262.00 FS	*-FS
30	1	*1/4 GLASS SEALANT	Necessary	100.00 FS	*100.00 FS
31	1	*ACRYLIC SEALANT	Necessary	180.00 FS	*180.00 FS
32	1	*CAVITY WAX	Necessary	140.00 FS	*140.00 FS
33	1	*STONE CHIP TREATMENT	Necessary	180.00 FS	*180.00 FS
34	1	*METAL FILLER POWDER	Necessary	280.00 FS	*280.00 FS
35	1	*SUNDRIES	Necessary	400.00 FS	*19.20 FS
36	1	*REAR END PANEL-OUTER (Supplementary)	Necessary	311.00 FS	*248.80 FS

F=Franchise part. S=SpcNett.

Total Parts (S\$) 16,624.00 7,709.76

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

Particulars	Lab.Type	Repairer's	Amount
our Items			
TO REMOVE AND REINSTALL REAR PARKING AID AND REAR LID KICK SENSOR.CHECK FUNCTION	New	360.00	360.00
TO RENEW RHS 1/4 GLASS TO FACILITATE FENDER RENEWAL	New	300.00	300.00
TO INSTALL SOLAR FILM FOR RHS SIDE 1/4 GLASS	New	400.00	400.00
TO CARRY OUT WATER SEEPAGE TEST ON 1/4 GLASS	New	200.00	150.00
TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS,BATTERY MANAGER,FUSE AND RELAY TRAYS,ELECTRICAL AND AUDIO EQUIPMENT.INSPECT FOR DAMAGE AND RENEW WHERE NECESSARY	New -	1,600.00	1,600.00
TO REMOVE AND REINSTALL REAR SEAT, BACK REST, HAT TRAY, ABCD PILLAR TRIMS, LUGGAGE COMPARTMENTS TRIMS. DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAG ETC	New	1,600.00	1,600.00
TO REMOVE AND TRANSFER RHS REAR DOORS MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES.INSPECT FOR DAMAGES	New	400.00	280.00
TO DISMANTLE AND RENEW REAR BUMPER AND RHS REAR DOOR.TO CUT OUT AND WELD RHS REAR FENDER.RE-ORGANIZE CRASH MANAGEMENT COMPONENTS.REINSTALL ALL PART REMOVED	New	6,400.00	4,250.00
TO RESPRAY REAR BUMPER,RHS REAR FENDER,RHS REAR DOOR,DOOR HANDLE,RHS SILL PANEL,DRAIN CHANNEL,ROOF CHANEL,DOOR ENTRANCE AND REAR END PANELLING	New	7,000.00	2,575.00
TO RENEW RHS REAR RIM AND CARRY OUT WHEEL ALIGNMENT	New	280.00	0.00
TO CARRY OUT DIAGNOSTIC CHECK	New	192.00	192.00
Gross Labour	r Cost (S\$)	18,732.00	11,707.00
Report was unsubmitted during this	print-out		
	TO REMOVE AND REINSTALL REAR PARKING AID AND REAR LID KICK SENSOR.CHECK FUNCTION TO RENEW RHS 1/4 GLASS TO FACILITATE FENDER RENEWAL TO INSTALL SOLAR FILM FOR RHS SIDE 1/4 GLASS TO CARRY OUT WATER SEEPAGE TEST ON 1/4 GLASS TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS,BATTERY MANAGER,FUSE AND RELAY TRAYS,ELECTRICAL AND AUDIO EQUIPMENT.INSPECT FOR DAMAGE AND RENEW WHERE NECESSARY TO REMOVE AND REINSTALL REAR SEAT,BACK REST,HAT TRAY,ABCD PILLAR TRIMS,LUGGAGE COMPARTMENTS TRIMS.DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAG ETC TO REMOVE AND TRANSFER RHS REAR DOORS MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES.INSPECT FOR DAMAGES TO DISMANTLE AND RENEW REAR BUMPER AND RHS REAR DOOR.TO CUT OUT AND WELD RHS REAR FENDER.RE-ORGANIZE CRASH MANAGEMENT COMPONENTS.REINSTALL ALL PART REMOVED TO RESPRAY REAR BUMPER,RHS REAR FENDER,RHS REAR DOOR,DOOR HANDLE,RHS SILL PANEL,DRAIN CHANNEL,ROOF CHANEL,DOOR ENTRANCE AND REAR END PANELLING TO RENEW RHS REAR RIM AND CARRY OUT WHEEL ALIGNMENT TO CARRY OUT DIAGNOSTIC CHECK Gross Labour	TO REMOVE AND REINSTALL REAR PARKING AID AND REAR LID NEW KICK SENSOR. CHECK FUNCTION TO RENEW RHS 1/4 GLASS TO FACILITATE FENDER RENEWAL NEW TO INSTALL SOLAR FILM FOR RHS SIDE 1/4 GLASS NEW TO CARRY OUT WATER SEEPAGE TEST ON 1/4 GLASS NEW TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT. INSPECT FOR DAMAGE AND RENEW WHERE NECESSARY TO REMOVE AND REINSTALL REAR SEAT, BACK REST, HAT TRAY, ABCD PILLAR TRIMS, LUGGAGE COMPARTMENTS TRIMS. DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAGETC TO REMOVE AND TRANSFER RHS REAR DOORS MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES TO DISMANTLE AND RENEW REAR BUMPER AND RHS REAR DOOR. TO CUT OUT AND WELD RHS REAR FENDER. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PART REMOVED TO RESPRAY REAR BUMPER, RHS REAR FENDER, RHS REAR NEW DOOR, DOOR HANDLE, RHS SILL PANEL, DRAIN CHANNEL, ROOF CHANEL, DOOR ENTRANCE AND REAR END PANELLING TO RENEW RHS REAR RIM AND CARRY OUT WHEEL ALIGNMENT NEW	TO REMOVE AND REINSTALL REAR PARKING AID AND REAR LID New 360.00 KICK SENSOR. CHECK FUNCTION TO RENEW RHS 1/4 GLASS TO FACILITATE FENDER RENEWAL New 300.00 TO INSTALL SOLAR FILM FOR RHS SIDE 1/4 GLASS New 400.00 TO CARRY OUT WATER SEEPAGE TEST ON 1/4 GLASS New 200.00 TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR New 1,600.00 LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT. INSPECT FOR DAMAGE AND RENEW WHERE NECESSARY TO REMOVE AND REINSTALL REAR SEAT, BACK REST, HAT New 1,600.00 TRAY, ABCD PILLAR TRIMS, LUGGAGE COMPARTMENTS TRIMS. DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAG ETC TO REMOVE AND TRANSFER RHS REAR DOORS MULTI-LOCK New 400.00 SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES TO DISMANTLE AND RENEW REAR BUMPER AND RHS REAR New 6,400.00 DOOR. TO CUT OUT AND WELD RHS REAR FENDER. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PART REMOVED TO RESPRAY REAR BUMPER, RHS REAR FENDER, RHS REAR New 7,000.00 TO RESPRAY REAR BUMPER, RHS REAR FENDER, RHS REAR New 7,000.00 TO RESPRAY REAR BUMPER, RHS REAR FENDER, RHS REAR New 7,000.00 TO RENEW RHS REAR RIM AND CARRY OUT WHEEL ALIGNMENT New 280.00 TO CARRY OUT DIAGNOSTIC CHECK New 192.00

< END OF ESTIMATES >