

CHARTERED AUTO ASSESSORS

17 Joo Seng Road #08-129 Joo Seng Heights Singapore 360017 Reg No. 26910200X
Tel: +65 9631 7008 Fax: +65 6281 9989 Email: charteredauto@gmail.com

Hamidah Binte Abdul Karim
Block 140 Bedok Reservoir Road #04-1503
Singapore 470140

Your Ref : SLM 516 T
Our Ref : 2105024/CA
Date : 23 June, 2021
Survey : Third Party

phs 15x4=60
+1=61/25

SURVEY REPORT

PARTICULARS OF VEHICLE

Vehicle No. : SLM 516 T
Make : Honda
Type of Body : 5 Doors Stationwagon
Year & Model : 2017, Shutter 1.5G
Colour : Silver
Passenger-cap : 4

Propellant : Petrol, Auto
Capacity : 1500 cc
Mileage : 132159
Engine No : L15B3537887
Chassis No : GK8-1006718
Road Tax : March, 2022

TYRES CONDITIONS

Front Left	: Yokohma	Worn : 30%	Size : 195/60 R15
Front Right	: Yokohma	Worn : 30%	Size : 195/60 R15
Rear Left	: Yokohma	Worn : 30%	Size : 195/60 R15
Rear Right	: Yokohma	Worn : 30%	Size : 195/60 R15

PRE-ACCIDENT CONDITION (Static Test Only)

Handbrake : Serviceable
Footbrake : Serviceable

Steering : Serviceable
Paintwork : Good

QUANTUM

Repair Estimate : \$ 16,331.80
Revised Amount : \$ 11,600.00 (Lump-sum Without Prejudice)

Under normal circumstances, the repair period would be:
We have not authorised repairs.

eight (8) days. ✓

Survey Done At : Precise Auto Service
1 Kaki Bukit Avenue 6, #02-34/36
Autobay @ Kaki Bukit
Singapore. 417883

8 days
Submit 2/5 8000

Survey 17/5/21
pass out 25/5/21

Assignment Date : 20 May, 2021
Survey Date : 20 May, 2021
Accident Date : 13 May, 2021
Assignment Given By : Hamidah Binte Abdul Karim

nn - No photo shown damaged

Our Ref: 2105024/CA

Vehicle No. SLM 516 T

Description	Qty	Repair Estimate	Revised Amount	Remarks
Rear trunklid	1	1,193.20	1,193.20	Badly Bent <i>Badly Bent</i>
Rear trunklid hinge o/s & n/s <i>(No photo shown damaged)</i>	2	81.00	81.00	Distorted <i>nn X</i>
Rear trunklid rubber stopper	2	17.00	17.00	To replace <i>nn</i>
Rear trunklid upper lock	1	256.40	256.40	Bent <i>Bent</i>
Rear trunklid lower lock striker	1	34.70	34.70	Bent <i>nn X</i>
Rear trunklid lock buzzer	1	80.10	80.10	Damaged <i>nn X</i>
Rear trunklid weatherstrip	1	168.20	168.20	Torn/Deformed <i>Torn</i>
Rear trunklid damper o/s & n/s <i>(No photo shown damaged)</i>	2	360.80	360.80	Bent/Stiffed <i>nn X</i>
Rear trunklid outer chrome garnish <i>(No photo shown damaged)</i>	1	463.80	463.80	Holder Broken <i>nn X</i>
Rear trunklid outer chrome garnish clip	8	28.00	28.00	To replace <i>nn X</i>
Rear trunklid reverse camera <i>(No photo shown damaged)</i>	1	658.90	658.90	Harness Damaged <i>nn X</i>
Rear trunklid H emblem	1	46.50	46.50	To replace <i>nn</i>
Rear trunklid SHUTTER emblem	1	55.40	55.40	To replace <i>nn</i>
Rear trunklid inner trimboard	1	390.40	390.40	Torn/Deformed <i>Torn</i>
Rear trunklid inner trimboard clip	8	28.00	28.00	To replace <i>nn</i>
Rear trunklid keyless sensor	1	285.40	285.40	Damaged <i>nn X</i>
Rear trunklid inner holding handle	1	65.90	65.90	Damaged <i>nn X</i>
Rear windscreen glass moulding	1	149.20	149.20	To replace <i>nn</i>
Rear windscreen glass clip	14	77.00	77.00	To replace <i>nn</i>
Rear bumper fascia	1	1,150.40	1,150.40	Torn/Deformed <i>nn</i>
Rear bumper side retainer o/s & n/s	2	53.00	53.00	To replace <i>nn</i>
Rear bumper side attachment o/s & n/s	2	82.80	82.80	To replace <i>nn</i>
Rear bumper bracket o/s & n/s	2	77.40	77.40	Bent <i>Bent</i>
Rear bumper reflector o/s & n/s <i>(No photo shown damaged)</i>	2	90.40	90.40	Holder Damaged <i>nn X</i>
Rear bumper reflector garnish o/s & n/s	2	92.20	92.20	Grazed/Damaged <i>nn X</i>
Rear bumper tow hook cover	1	46.50	46.50	Torn/Deformed <i>nn</i>
Rear bumper sponge o/s & n/s <i>(No photo shown damaged)</i>	2	112.00	112.00	To replace <i>nn X</i>
Rear bumper clip	10	35.00	35.00	To replace <i>nn</i>
Rear end panel	1	560.20	560.20	Badly Bent <i>nn</i>
Rear end panel top trim	1	155.40	155.40	Torn/Deformed <i>nn</i>
Rear end panel top trim clip	4	14.00	14.00	To replace <i>nn</i>
Rear number plate lamp <i>(No photo shown damaged)</i>	2	77.00	77.00	Holder Damaged <i>nn</i>
Rear trunk panel cover board <i>(No photo shown damaged)</i>	1	655.20	655.20	Wrapped <i>washed</i>
Rear trunk panel lower insulation cloth <i>(No photo shown damaged)</i>	1	291.60	291.60	To replace <i>D.S</i>
Rear trunk panel upper tool tray	1	345.20	345.20	Bent/Deformed <i>nn</i>
Rear trunk panel tool tray front cover	1	650.40	650.40	Torn/Deformed <i>nn</i>
Rear trunk panel lower sponge tool tray	1	312.80	312.80	Torn/Deformed <i>nn</i>
Rear fender inner trimboard o/s & n/s	2	966.40	966.40	Torn/Deformed <i>nn</i>
Rear fender inner trimboard clip o/s & n/s	20	110.00	110.00	To replace <i>nn</i>

10,317.80

10,317.80

-

2,063.56

Less 20%

Page Total :

10,317.80

8,254.24

8410.20
202
672816

Our Ref: 2105024/CA

Vehicle No. SLM 516 T

Description	Qty	Repair Estimate	Revised Amount	Remarks
Balance brought forward		10,317.80	8,254.24	
<u>SPECIAL NETT</u>				
Rear number plate	(also photo of the plate) 1	45.00	45.00	Damaged Repd 20
Rear number plate Casing	1	29.00	29.00	Damaged Repd 20
Rear windscreen inner seal	1	50.00	50.00	To replace per 40
Rear windscreen sealant	1	60.00	60.00	To replace per 40
Rear reverse sensor c/w control box	1 set	380.00	380.00	Damaged Shown 200

	-----	-----
Total Materials Cost :	10,881.80	8,818.24

Labour & Miscellaneous Charges

To provide towing service.	120.00	110.00	50
To remove/refit wire harness, all related connectors. Check proper function.	150.00	120.00	30
To check airbag assembly, sensors and control units. Reset to factory specifications.	280.00	250.00	100
To apply underseal and rust-proofing on the affected areas.	250.00	220.00	80
To set vehicle on chassis alignment bench, inclusive of all necessary preparatory works.	380.00	320.00	117
To remove/refit rear windscreen glass.	200.00	180.00	120

	-----	-----
Page Total:	12,261.80	10,018.24

Our Ref: 2105024/CA

Vehicle No. SLM 516 T

Description	Qty	Repair Estimate	Revised Amount	Remarks
Balance brought forward		12,261.80	10,018.24	
<u>Labour & Miscellaneous Charges</u>				
To install reverse sensors, control unit. Re-connect wires harness. Check function.		180.00	150.00	50
To transfer rear trunklid mechanisms with motor assembly and all attachments.		150.00	120.00	60
To remove/refit boot garnishes, speakers, interior garnishes, carpets where necessary.		180.00	150.00	100
To straighten/align rear exhaust assembly with all attachments, brackets and holders.		280.00	250.00	11X
To position and install rear reverse camera. Re-connect wires harness. Check function.		180.00	150.00	X
To ^{putty} and spray paint rear bumper, rear trunklid, rear trunklid outer garnish, rear end panel, rear trunk panel, o/s rear fender, n/s rear fender and repaired body parts inclusive of preparatory works and painting materials.		1,500.00	1,400.00	1200
To remove all damaged parts with all necessary components and attachments. To apply hot-works where necessary. Straighten/align chassis members, repair/reshape/align dented body panels, in accordance with factory specifications. Replace damaged parts, refit and align into position. Refit all necessary components/attachments.		1,600.00	1,500.00	1200
Grand Total:		16,331.80	13,738.24	

Summary

Total Material	10,881.80	8,818.24
Total Labour/Painting	5,450.00	4,920.00
Grand Total	16,331.80	13,738.24
Lump-sum Amount		<u>11,600.00</u>

S.N-320
L 2990

10038.

Our Ref: 2105024/CA

Vehicle No. SLM 516 T

CAUSE OF DAMAGE

The vehicle sustained impact to the rear.

REMARKS

Having checked the scope of repair works we were satisfied that it was in accordance with the damage sustained. We also checked each item and have indicated its nature of damage. It was our opinion that these items were found damaged beyond repair and require replacement.

We checked the damage carefully and were of the opinion that the vehicle could be repaired.
We would therefore recommend repairs to be carried out at: \$ 11,600.00 on a lump-sum basis.

The survey was conducted on a without prejudice basis and we submit this report for your consideration.

CHARTERED AUTO ASSESSORS



Tan Chin Sunn (Licensed Appraiser)

MEMBERS OF THE MOTOR VEHICLE APPRAISERS ASSOCIATION OF SINGAPORE