

(08/11/13) wef
ASS. R&C BY: Marcus

REF: CS/1CS21010935/U+3

ASSIGNMENT

From: Date:

Estimated Cost:

OD (TP) WS/TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SM 6 4222J

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

GIA / PR Seen:

Est. Repairs:

Lum Sum:

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

0530
27/10/14

Veh No:

SM 6 4222J

Yr Regn:

19/12/18

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

KIA Carens

c.c

1685

Colour

Beige

A/C:

Insured / Std / NI / NA

Sp. Reading

233681

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

KNAHU8LVJ7211190

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F: 205/55-16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

 
L/Bal.

D.O.A.

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.



Duratura

Rear

R/Bal.

L/Bal.

D.O.I.

Survey held at

Reer

30/10/14 4/5 \$1800 Conf. met with William.

RED: 2229.8; 55%

Date/Time, File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

3

Resurvey No. of Trip:

Survey Fee:

Transportation:

) \$ + RS. SI

) Photos

) Others

Report Format :

Lump Sum / I.B.I: (\$)

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

TOTAL



陳林摩呀私人有限公司
TAN LIM MOTOR PTE LTD

ECICS Insured's Veh No : SNC2341X

Date of Accident : 22 October 2021

1 Defu Lane 6 Singapore 539365
Tel : 68585151 (24 Hours) Fax : 68580877

GST Regn. No. : M2-8922054-2

Messrs BIS Motoring Pte Ltd

Date : 26 October 2021

Estimate To Repair SMG4222J - KIA CARENS 1.7 DCT DIESEL 5DR FWD

Chassis No : KNAHU815VJ7211190

S/No	Quantity	Description	Amount
<u>LIST ITEMS</u>			
01	1 pc	rear bumper <i>20/10</i>	\$ 549.00
02	8 ps	rear bumper clips @ \$3.50 <i>new</i>	\$ 28.00
03	1 pc	rear bumper centre pad <i>de</i>	\$ 189.00
04	1 pc	rear bumper lower <i>de</i>	\$ 179.00
05	2 ps	rear bumper reverse sensor @ \$160.00 <i>should</i>	\$ 320.00
06	2 ps	rear bumper side retainer @ \$28.00 <i>1 1</i>	\$ 56.00
07	2 ps	rear bumper reflector @ \$116.00 <i>1 1</i>	\$ 232.00
08	1 pc	rear bumper reinforcement <i>CRA</i>	\$ 367.00
09	2 ps	rear bumper bracket @ \$84.00 <i>1 1</i>	\$ 168.00
10	1 pc	rear end panel <i>R</i>	\$ 611.00
11	1 pc	rear end panel top garnish <i>1 1</i>	\$ 123.00
Less 10 %			\$ 2,822.00
			\$ 282.20
			\$ 2,539.80
<u>LABOUR & MISC. CHARGES</u>			
01		To remove & reinstall of rear bumper reverse sensor.	\$ 80.00
02		To check electrical lighting concerned.	\$ 60.00
03		Panel beating, knocking and straighten the necessary portion, remove and renewal of parts, adjust and realign the same.	\$ 700.00
04		Putty and spray painting of the affected portion.	\$ 650.00
			\$ 1,490.00
Total			\$ 4,029.80

page 1 LKK - Marcus
27/10/2021 00915h

✓
✓
✓
✓
✓
✓
✓
✓
✓
✓
✓

50
20
400
500

not Authorised
LKK
27/10/21
L/S #1800
Take the other report
3 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

2-1472
105
1324.80
1294.8