

Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10,#01-20
575645



Insurer Reference:
Repairer Reference: 044185
Date calculated: 27/12/2021 4:38 PM

Full Report
Registration: SMT3804T
Printed: 27/12/2021 4:39 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:		Date of Incident:	24/10/21
Estimated Repair Time:	21	Hire Car Start:	
Actual Repair Days:	21	Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	VW
Model:	GOLF (5K)
Sub Model:	R
Model Sheet Number:	06 AF 06
Registration:	SMT3804T
VIN number:	
Odometer:	170877
Model Specs	
5-DOOR	2.0 LTR 199KW

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

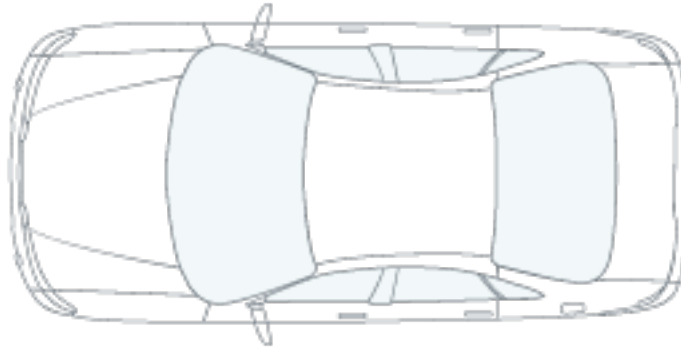

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
50 38 09 50	DETACH + REFIT FRONT LOCK CARRIER (SERVICE POSITION) (BUMPER COVER REMOVED)		7.0	29.40
66 05 19 00	R + R RADIATOR GRILLE		2.0	8.40
63 29 19 50	R + R FRONT BUMPER COVER (RADIATOR GRILLE REMOVED)		4.0	16.80
92 60 19 50	R + R WASHER RESERVOIR (BUMPER COVER REMOVED)		2.0	8.40
92 60 55 50	RENEW WASHER RESERVOIR (REMOVED) INCLUDES: CONVERT ATTACHED PARTS		2.0	8.40
17 50 19ZAX)	R + R OIL PAN		7.0	29.40
17 20 19 12)	R + R OIL PUMP (OIL PAN REMOVED)		12.0	50.40
17 50 55 50	RENEW OIL PAN (REMOVED)		1.0	4.20
19 20 19 70	R + R COOLING BLOWER HOUSING		4.0	16.80
19 70 19 70)	R + R RADIATOR (BUMPER COVER REMOVED)		4.0	16.80

Code	Description	WU	Price SGD
19 70 55 50	INCLUDES: DETACH + REFIT LOCK CARRIER, DRAIN + REFILL COOLANT RENEW RADIATOR (REMOVED)	3.0	12.60
NO NUMBER	INCLUDES: CONVERT ATTACHED PARTS R + R LEFT GEARBOX SUPPORT	4.0	16.80
34 41 19 50	R + R PENDULUM SUPPORT	2.0	8.40
26 01 19 20	R + R EXHAUST SYSTEM INCLUDES: R + R EXHAUST PIPES AND SILENCER	13.0	54.60
48 35 19 04)	R + R STEERING GEAR (WHEELS, OSCILLATION DAMPER AND NOISE CONTROL PAN REMOVED) INCLUDES: DETACH + REFIT ASSEMBLY CARRIER DOES NOT INCLUDE: ALIGN FRONT AND REAR, READ OUT FAULT MEMORY	9.0	37.80
48 35 55 54	RENEW STEERING GEAR (REMOVED)	3.0	12.60
40 07 19ZAX)	R + R ASSEMBLY CARRIER (NOISE CONTROL PAN, SUPPORT AND WHEELS REMOVED) INCLUDES: DETACH + REFIT STEERING GEAR AND STABILIZER DOES NOT INCLUDE: ALIGN FRONT AND REAR	13.0	54.60
44 05 19 00	R + R FRONT WHEEL (WHEELS)	2.0	8.40
40 07 55 50	RENEW AGGREGATE CARRIER (REMOVED)	1.0	4.20
01 50 00 00	GFS / GUIDED FUNCTION (READ AND DELETE ERROR MEMORY AFTER REPAIR)	2.0	8.40
44 95 03 00	ALIGN FRONT AND REAR VEHICLE INCLUDES: CHECK TOE AND CAMBER, R + R BRACKET AND ALIGNMENT SENSOR DOES NOT INCLUDE: ADJUSTMENT	9.0	37.80
Labour Cost		Hrs	WU
Panel / Mechanical Labour		9.70	97.0
Alignment			
Measuring Work		0.90	9.0
Total of Labour			445.20

Spare Parts

				prices as at 2015-06-01
Code	Description	Part Number	Part Source	Price SGD
1436	FLUID RESERVOIR	1K0 955 453 S	Original	100.00
7009	L/ASSY CARRIER CONS	1K0 199 295 E	Original	300.00
7010	R/ASSY CARRIER CONS	1K0 199 296 J	Original	300.00
7011	ASSEMBLY CARRIER	1K0 199 313 AL	Original	900.00
7047	L/F TRACK CONT ARM	1K0 407 151 AC	Original	260.00
7048	R/F TRACK CONT ARM	1K0 407 152 AC	Original	260.00
7261	FRONT STABILISER	1K0 411 303 AQ	Original	280.00
7300	POWER STEERING	1K2 423 055 K	Original	3,200.00
7761	RADIATOR	1K0 121 251 AB	Original	400.00
7927	LWR CYL BLOCK FRAME	06B 103 307 C		0.00
8065	ENGINE SUMP	06F 103 601 J	Original	480.00

Code	Description	Part Number	Part Source	Price SGD
8657	FRONT ENGINE SUPPORT	1K0 199 855 BJ	Original	100.00
8771	ENGINE PROTECTION	1K0 825 235 AE	Original	200.00
8795	FRT CTR EXHAUST PIPE	1K0 254 512 HX	Original	6,000.00
8806	FRT EXH PIPE SEAL	1K0 253 115 AB	Original	20.00
8809	FRONT LAMBDA PROBE	06J 906 262 AA	Original	300.00
8833	CENTRE REAR EXHAUST	5K6 253 181 AN	Original	2,850.00
8841	FRT EXHAUST CLAMP	1K0 253 141 H	Original	60.00
8843	FRT EXH PIPE BRACKET	1K0 253 144 BD	Original	45.00
1002	THERMOSTAT HOUSING	THERMOSTAT	Supplementary	350.00
1003	WIRE HARDNESS	STEERING RACK	Supplementary	300.00
1004	OIL LEVEL SENSOR	LEVEL SENSOR	Supplementary	160.00
1005	UPP RUBBER MOUNTING	RUBBER MOUNTING	Supplementary	100.00
1006	LWR RUBBER MOUNTING	RUBBER MOUNTING	Supplementary	100.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	17,065.00
Total	17,065.00

Extras

Code	Description	Price SGD
1000	ENGINE ECU REPROGRAM ENGINE ECU	670.00*
1001	TIRE ALIGNMENT ALIGNMENT	42.00*
	Total Extras	712.00

Final Calculation

	SGD	SGD
Parts	17,065.00	
Total Parts		17,065.00
Labour Time Base 10 WU/h		
Total 97.0 WU X 42.00 SGD/h	407.40	
Alignment		
Measuring Work	37.80	
Total of Labour		445.20
Total Of Extras		712.00
Repair Cost Excludes GST		18,222.20
GST (+7.0%)		1,275.55
Repair Cost Included GST		19,497.75

Comments

* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.