

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/CTI21011304/UUY3N2**Date:** 23/11/2021**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMCVSNW00103422101	
Claimant Vehicle No :	GBE2105T	Insured Vehicle No :	YN9296J	
Date of Loss:	03/11/2021	Nature of Claim:	TP	Claim No: SNM21D206321/C02/THAMYL

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	GBE2105T		Engine No:	1KD2546628
Make & Model:	TOYOTA HIACE, 2.5 DX (M)		Chassis No:	KDH2015018858
Reg. Date:	29/09/2015 (Man. Year: 2015)		Odometer:	232866 km
Colour:	Silver			
Engine Capacity:	2982 cc			
Market Value/New Car Price:	N/A			
Sum Insured (\$\$):	Market Value/New Car Price			

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195R15	Rear Tyre Size:	195R15
Front Left Side:	CST 6 mm	Rear Left Side:	CST 6 mm
Front Right Side:	CST 6 mm	Rear Right Side:	CST 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (\$\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	16/11/2021	
Date Inspected:	05/11/2021	Inspected At: Garage 13 Pte Ltd (HQ) 8 Kaki Bukit Ave 4, Premier @ Kaki Bukit, #03-46 Singapore 415875
Estimated Period of Repair:	5.0 days	

Adjuster: MARCUS CHUA**Manager:** Tan Hui Zhen

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$3,000.00
-\$4,000.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 23 Nov 2021)	
Parts:	N/A	TOYOTA HIACE 2.5 DX (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GBE2105T)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >