

|   |        |      |             |
|---|--------|------|-------------|
| 1 | of 2 ? | 100% | Find   Next |
|---|--------|------|-------------|



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

|   |  |             |  |                    |
|---|--|-------------|--|--------------------|
| <b>Affiliated to Federation Internationale Des Experts En Automobile</b>  |  |             |  |                    |
| SOMPO INSURANCE SINGAPORE PL<br>50 RAFFLES PLACE #03-03<br>SINGAPORE LAND TOWERS SINGAPORE 048623   |  |             | Ref: CS3/SMO21011310/Kuf3e2<br>Date: 12/11/2021<br>Code: SMO |                    |
| <b>1. Policy Particulars :- (THIRD PARTY CLAIM)</b>   |  |             |  |                    |
| <b>Insured Veh.</b>   | SBT 7003S  |             | <b>Veh. Inspected</b>  | SMS 5845S          |
| <b>Policy No.</b>   | D21MTPV01004267  |             | <b>Coverage (\$)</b>   | 0.00               |
| <b>Claim No.</b>  | CMTD2103186/GPL  |             | <b>Excess (\$)</b>   | 0.00               |
| <b>Assign From</b>  | GRACE TEO  |             | <b>Assign Date</b>   | 05/11/2021         |
| <b>2. Vehicle Particulars &amp; Condition</b>   |  |             |  |                    |
| <b>Make &amp; Model</b>   | TOYOTA ESTIMA (A)  |             | <b>c.c</b>   | 2362               |
| <b>Engine No.</b>   | HIDDEN   |             | <b>Year of Reg.</b>  | 2015               |
| <b>Chassis No.</b>  | ACR500191986   |             | <b>Colour</b>  | WHITE              |
| <b>Odometer</b>   | 105156 KM  |             | <b>Steering</b>  | IN ORDER           |
| <b>Brakes</b>   | IN ORDER   |             | <b>Modification</b>  | STANDARD ALLOY RIM |
| <b>General</b>  | GOOD   |             |  |                    |
| <b>3. Conditions of Tyres</b>   |  |             |  |                    |
|   | <b>Size</b>  | <b>Make</b> | <b>Balance</b>   |                    |
| <b>R/H Front Tyre</b>   | 225/50 R18   | FALKEN      | 3 mm   |                    |
| <b>L/H Front Tyre</b>   | 225/50 R18   | FALKEN      | 3 mm   |                    |
| <b>R/H Rear Tyre</b>  | 225/50 R18   | FALKEN      | 4 mm   |                    |
| <b>L/H Rear Tyre</b>  | 225/50 R18   | FALKEN      | 4 mm   |                    |
| <b>4. Description of Damages</b>  |  |             |  |                    |
| THE VEHICLE SUSTAINED DAMAGES AT THE N/S REAR BODY.   |  |             |  |                    |
| <b>5. General Information</b>   |  |             |  |                    |
| <b>Accident Date</b>  | 23/10/2021   |             | <b>Inspection Date</b>                                       | 08/11/2021         |
| <b>Survey held at</b>   | NEXWAVE AUTO<br>160 SIN MING DRIVE #05-15 SIN MING AUTOCITY SINGAPORE 575722 |             |  |                    |
| <b>5a. Remarks</b>  |  |             |  |                    |
| A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.<br>B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.<br>THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.<br>C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.<br>D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$1,000-\$2,000 |  |             |  |                    |
| <b>5b. Estimate Days of Repair</b>  |  |             |  |                    |
| ESTIMATED NORMAL PERIOD FOR REPAIR:   |  |             | <b>3 Working Days</b>  |                    |