

SML3493Z. 2013 May.

Lexus LS460L 4608CC

TP EQ

Denise.

JTHGL46F40S050023.

Front Bumper	Deformed	850.40 /
Front Bumper Clips.	new	50(SN) /
Front Bumper Side Holder LH.	new	62.90 /
Front Bumper Side Grille LH.	new	67.90 +
Front Bumper Side Grille Chrome LH.	new	85.40 +
Front Grille	Cracked	789.50 /
Front Grille Logo	} new	88.90 /
Front Grille Clips.		30(SN) /
Headlamp LH.	cracked	6006.10 ✓
Headlamp Control Unit.	new	385.40 +
Front LH Fender	Dented	1043.20 /
Front LH Fender Bracket Bent		85.90 /
Front LH Fender Inner Shield	crumpled	295.20 /
Front LH Fender Inner Shield clips.	new	30(SN) /

SML 3493Z.

Front LH Wheel Rim. Lt ~~1380~~ 850(SN)

Front LH Lower Arm. } 496.20 x

Front LH Shock Absorber } LH 524.10 x

Front LH Knuckle Arm. } RH 854.20 x

Front LH Wheel Hub. c/w Bearing. 448.90 x
9222.10 S.N: 960.
8259.89

Panel Beating

~~750~~ 600

Spray Painting

~~750~~ 500

Wiring

1360

~~100~~ 30

To perform wheel alignment

~~180~~ 80

To dismantle front undercarriage

~~350~~ x

To perform diagnostic test.

~~250~~ 150

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature

Total: 1061989

L/s: 8.5K. w/s 04 Days.

15,994.20