

## ACCIDENT VEHICLE INSPECTION REPORT

Report no : 332M1021.SSH  
Vehicle no : SMY6209R

### 1 REFERENCE

Date of inspection : 7 October 2021  
Requested by : Lim Thim Chay  
c/o Blk 3023A Ubi Road 1  
#01-63  
Singapore 408716  
Type of survey : Independent  
Repairer : Sin Seng Hong Spray Painting & Services  
Blk 3023A Ubi Road 1, #01-63 Singapore 408717  
Date of accident : 22 September 2021

### 2 VEHICLE DATA

Make/model : PEUGEOT 5008 (A) 1.6 E-HDI ETG ACTIVE MPV  
Chassis no : VF30E9HD8FS179624  
Engine no : 10JBFT0099599  
Date of registration : 09 October 2015  
Engine capacity : 1560 cc  
Odometer Reading : 156162 km  
Colour : Silver

### 3 STATIC CONDITION CHECK

Steering : Affected  
Foot brakes : Serviceable  
Hand brakes : Serviceable  
Paintwork : Good  
General Condition : Good

### 4 TIRE CONDITION CHECK

	<u>RH/MAKE</u>	<u>LH/MAKE</u>	<u>SIZE</u>
Front tread	: 6 mm/Goodyear	6 mm/Goodyear	215/55R16
Rear tread	: 6 mm/Goodyear	6 mm/Goodyear	215/55R16

### 5 BRIEF DESCRIPTION OF DAMAGE

Front bumper cut/scraped/deformed, RH headlamp lens scraped/leg bent, RH front fender scraped/buckled/distorted, front right undercarriage & suspension parts damaged, etc. Please see para. 8 of this report for more details.

### 6 REMARKS

This inspection is carried out on a "WITHOUT PREJUDICE" basis and we have not authorized any repairs.

### 7 RECOMMENDATION

Cost of repairs : \$8,600.00 (lump sum) 4450 ✓  
Estimated no. of days : Four (4) ✓

Report no: 332M1021.SSH  
Vehicle no: SMY6209R

#### A SPARE PARTS

<u>Description</u>	<u>Qty</u>	<u>Assessed Condition</u>	<u>Repairer's Amount</u>	<u>Revised Amount</u>
Front bumper	1	scraped/cut/deformed	1,290.00	1,290.00 ✓
Front bumper side retainer LH & RH	2	necessary	282.00	282.00 170
Front bumper side set	10	necessary	211.50	211.50 50
Front bumper Peugeot logo	1	necessary	82.25	82.25 ✓
RH fog lamp assy	1	serviceable	164.50	164.50 X SVC
RH fog lamp garnish + chrome trim	1	scraped/broken	211.50	211.50 ✓
RH headlamp asy	1	lens scraped/leg bent	1,612.50	1,612.50 / Scr
RH front fender	1	scraped/buckled/distorted	559.00	559.00 ✓
RH front fender splash shield	1	serviceable	235.00	0.00
RH front fender splash shield clip	5	necessary	35.25	35.25 ✓
RH front door assy	1	to repair	1,870.50	0.00
RH front door moulding	1	necessary	188.00	188.00 X SVC
RH front side mirror assy	1	scraped/motor rattled	763.25	763.25 468
RH front suspension lower arm	1	bent	537.50	537.50 X SVC
RH front shock absorber	1	bent	279.50	279.50 X SVC
RH front steering knuckle + bearing	1	bent/distorted	967.50	967.50 X SVC
RH front stabiliser bar link	1	bent	105.75	105.75 X SVC
RH front drive shaft	1	wobbled/bent	1,032.00	1,032.00 X SVC
RH front sport rim	1	scraped/distorted	967.50	967.50 450
Subtotal of the above			11,395.00	9,289.50
Discount 10%			1,139.50	928.95
Total cost of parts:			10,255.50	8,360.55

#### B LABOUR

To remove and replace, to cut and weld, to panel beat and straighten damaged parts and body panels.	750.00	500.00 400
To putty and spray paint the front bumper, front fender, front door, side mirror and necessary areas.	1,250.00	1,000.00 600
To apply anti-rust undercoating.	150.00	60.00 20
To remove and transfer front distance sensors and check for proper functions.	90.00	60.00 20
To check wiring.	60.00	45.00 20
To refocus headlamp beams to specifications.	80.00	60.00 30
To remove and replace the damaged front right suspension and undercarriage parts.	600.00	450.00 X W W
To conduct computerised 4-wheels alignment to reset wheel alignment.	120.00	90.00 60
Total cost of labour:	3,100.00	2,265.00
Total cost of repair:	13,355.50	10,625.55

Report no: 332M1021.SSH  
Vehicle no: SMY6209R

**9 CONCLUSION**

The revised or adjusted cost of repairs to restore the vehicle is \$10,625.55

(a) The recommended cost of repair based on lump sum repairs would be

\$8,600.00

4450

(b) The estimated number of days for the repairs would be

Four (4)

(1<sup>st</sup> Re-inspection conducted on 12 October 2021)

(Post Repair Inspection conducted on 14 October 2021)

*The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its pre-accident condition.*

**Note: Lump Sum Repair Basis**

*This means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition.*

Prepared by:

Liaw Leong San  
Licensed Automotive Appraiser

Dated: 22 October 2021