

PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Email: mirage1195@gmail.com, Mobile: 90610543

ACCIDENT VEHICLE INSPECTION REPORT

Report no : 332M1021.SSH
Vehicle no : SMY6209R

1 REFERENCE

Date of inspection : 7 October 2021
Requested by : Lim Thim Chay
c/o Blk 3023A Ubi Road 1
#01-63
Singapore 408716
Type of survey : Independent
Repairer : Sin Seng Hong Spray Painting & Services
Blk 3023A Ubi Road 1, #01-63 Singapore 408717
Date of accident : 22 September 2021

2 VEHICLE DATA

Make/model : PEUGEOT 5008 (A) 1.6 E-HDI ETG ACTIVE MPV
Chassis no : VF30E9HD8FS179624
Engine no : 10JBFT0099599
Date of registration : 09 October 2015
Engine capacity : 1560 cc
Odometer Reading : 156162 km
Colour : Silver

3 STATIC CONDITION CHECK

Steering : Affected
Foot brakes : Serviceable
Hand brakes : Serviceable
Paintwork : Good
General Condition : Good

4 TIRE CONDITION CHECK

	<u>RH/MAKE</u>	<u>LH/MAKE</u>	<u>SIZE</u>
Front tread	: 6 mm/Goodyear	6 mm/Goodyear	215/55R16
Rear tread	: 6 mm/Goodyear	6 mm/Goodyear	215/55R16

5 BRIEF DESCRIPTION OF DAMAGE

Front bumper cut/scraped/deformed, RH headlamp lens scraped/leg bent, RH front fender scraped/buckled/distorted, front right undercarriage & suspension parts damaged, etc. Please see para. 8 of this report for more details.

6 REMARKS

This inspection is carried out on a "WITHOUT PREJUDICE" basis and we have not authorized any repairs.

7 RECOMMENDATION

Cost of repairs : \$8,600.00 (lump sum)
Estimated no. of days : Four (4)

8 ASSESSMENT OF DAMAGE AND COSTS

Report no: 332M1021.SSH
 Vehicle no: SMY6209R

A SPARE PARTS

<u>Description</u>	<u>Qty</u>	<u>Assessed Condition</u>	<u>Repairer's Amount</u>	<u>Revised Amount</u>
Front bumper	1	scraped/cut/deformed	1,290.00	1,290.00
Front bumper side retainer LH & RH	2	necessary	282.00	282.00
Front bumper side set	10	necessary	211.50	211.50
Front bumper Peugeot logo	1	necessary	82.25	82.25
RH fog lamp assy	1	serviceable	164.50	164.50
RH fog lamp garnish + chrome trim	1	scraped/broken	211.50	211.50
RH headlamp assy	1	lens scraped/leg bent	1,612.50	1,612.50
RH front fender	1	scraped/buckled/distorted	559.00	559.00
RH front fender splash shield	1	serviceable	235.00	0.00
RH front fender splash shield clip	5	necessary	35.25	35.25
RH front door assy	1	to repair	1,870.50	0.00
RH front door moulding	1	necessary	188.00	188.00
RH front side mirror assy	1	scraped/motor rattled	763.25	763.25
RH front suspension lower arm	1	bent	537.50	537.50
RH front shock absorber	1	bent	279.50	279.50
RH front steering knuckle + bearing	1	bent/distorted	967.50	967.50
RH front stabiliser bar link	1	bent	105.75	105.75
RH front drive shaft	1	wobbled/bent	1,032.00	1,032.00
RH front sport rim	1	scraped/distorted	967.50	967.50
Subtotal of the above			11,395.00	9,289.50
Discount 10%			1,139.50	928.95
Total cost of parts:			<u>10,255.50</u>	<u>8,360.55</u>

B LABOUR

To remove and replace, to cut and weld, to panel beat and straighten damaged parts and body panels.	750.00	500.00
To putty and spray paint the front bumper, front fender, front door, side mirror and necessary areas.	1,250.00	1,000.00
To apply anti-rust undercoating.	150.00	60.00
To remove and transfer front distance sensors and check for proper functions.	90.00	60.00
To check wiring.	60.00	45.00
To refocus headlamp beams to specifications.	80.00	60.00
To remove and replace the damaged front right suspension and undercarriage parts.	600.00	450.00
To conduct computerised 4-wheels alignment to reset wheel alignment.	120.00	90.00
Total cost of labour:	<u>3,100.00</u>	<u>2,265.00</u>
Total cost of repair:	<u>13,355.50</u>	<u>10,625.55</u>

Report no: 332M1021.SSH

Vehicle no: SMY6209R

9 CONCLUSION

The revised or adjusted cost of repairs to restore the vehicle is \$10,625.55

(a) The recommended cost of repair based on lump sum repairs would be \$8,600.00

(b) The estimated number of days for the repairs would be Four (4)
(1st Re-inspection conducted on 12 October 2021)
(Post Repair Inspection conducted on 14 October 2021)

The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its pre-accident condition.

Note: Lump Sum Repair Basis

This means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition.

Prepared by:


.....
Liaw Leong San
Licensed Automotive Appraiser

Dated: 22 October 2021