

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG21011460/AEA3Q2**Date:** 31/05/2022REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1800105302
Claimant Vehicle No :	GBC1879K	Insured Vehicle No :	SLS3921E
Date of Loss:	09/11/2021	Nature of Claim:	TP
		Claim No:	2001144483SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	GBC1879K		
Make & Model:	NISSAN NV200, 1.5 L MT ABS AIRBAG 2WD 6DR (M)	Engine No:	K9KF276D123007
Reg. Date:	27/07/2011 (Man. Year: 2011)	Chassis No:	VSKYBAM20U0021323
Colour:	White	Odometer:	327667 km
Engine Capacity:	1461 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	175 R14C	Rear Tyre Size:	175 R14C
Front Left Side:	Double Coin 6 mm	Rear Left Side:	Double Coin 6 mm
Front Right Side:	Double Coin 6 mm	Rear Right Side:	Double Coin 6 mm

The above values represent the remaining tyre tread depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	11,977.15	8,184.84	3,792.31	31.66
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,680.00	2,610.00	1,070.00	29.08
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	15,657.15	10,794.84	4,862.31	31.05
Approved Total (Overridden) (S\$)		8,600.00		
(S\$)	15,657.15	8,600.00	7,057.15	45.07
+ GST 7.00/7.00% (S\$)	1,096.00	602.00	494.00	45.07
Nett Amount (S\$)	16,753.15	9,202.00	7,551.15	45.07
+ Loss of Use (10.0 x S\$100.00/day) (S\$)		1,000.00		
+ Doc/Search Fee (S\$)		36.45		
Nett Liability (S\$)		10,238.45		
Global Sum Settlement (S\$)		10,230.00		

INSPECTION

Date of Assignment:	09/11/2021	
Date Inspected:	09/11/2021 Inspected At:	Ryder Auto Pte Ltd (HQ) 2 Kaki Bukit Ave 2, #02-19 AutoHub @ Kaki Bukit Singapore 417921
Estimated Period of Repair:	8.0 days	

Adjuster: ADRIAN LING**Manager:** Asher Sng Rong Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Deformed	695.90 FN	*695.90 FN
2	2		*REAR BUMPER O/S & N/S RETAINER	Necessary	86.60 FN	*86.60 FN
3	1		*REAR BUMPER SPONGE	Cracked	90.20 FN	*90.20 FN
4	2		*REAR BUMPER O/S & N/S REFLECTOR	Not Necessary	103.40 FN	*- FN
5	2		*REAR O/S & N/S TAIL LAMP	Not Necessary	731.20 FN	*- FN
6	1		*REAR MAIN FRAME WEATHERSTRIP	Cut	210.00 FN	*210.00 FN
7	1		*REAR O/S TAIL GATE	Dented	1,057.00 FN	*1,057.00 FN
8	1		*REAR O/S TAIL GATE WEATHERSTRIP	Not Necessary	215.00 FN	*- FN
9	1		*REAR O/S TAIL GATE LOCK	Not Necessary	215.50 FN	*- FN
10	1		*REAR O/S TAIL GATE LOCK CATCH	Not Necessary	63.60 FN	*- FN
11	2		*REAR O/S TAILGATE HINGES	Not Necessary	120.00 FN	*- FN
12	1		*REAR O/S TAILGATE STRIKER	Not Necessary	80.00 FN	*- FN
13	1		*REAR N/S TAIL GATE	Dented	1,409.20 FN	*1,409.20 FN
14	1		*REAR N/S TAIL GATE INNER BOARD	Not Necessary	180.00 FN	*- FN
15	1		*REAR N/S TAIL GATE MOULDING	Not Necessary	143.00 FN	*- FN
16	1		*REAR N/S TAIL GATE LOCK	Damaged	215.50 FN	*215.50 FN
17	1		*REAR N/S TAIL GATE LOCK CATCH	Not Necessary	63.60 FN	*- FN
18	1		*REAR N/S TAILGATE LOCK (UPPER)	Not Necessary	215.50 FN	*- FN
19	1		*REAR N/S TAILGATE LOCK CATCH (UPPER)	Not Necessary	63.60 FN	*- FN
20	2		*REAR N/S TAILGATE HINGES	Not Necessary	120.00 FN	*- FN
21	1		*REAR N/S TAILGATE STRIKER	Not Necessary	80.00 FN	*- FN
22	2		*REAR N/S TAILGATE NUMBER PLATE LAMP	Not Necessary	120.00 FN	*- FN
23	1		*REAR LOCK ASSEMBLY	Not fitted	516.50 FN	*- FN
24	1		*REAR END PANEL	Repair	384.80 FN	*- FN
25	1		*REAR END PANEL INNER TRIM	Cracked	136.60 FN	*136.60 FN
26	1		*REAR NISSAN EMBLEM	Necessary	88.20 FN	*88.20 FN
27	1		*FRONT BUMPER	Deformed	750.40 FN	*541.00 FN
28	1		*FRONT BUMPER SPONGE	Cracked	110.20 FN	*110.20 FN
29	1		*FRONT ENFORCEMENT	Dented	245.40 FN	*245.40 FN
30	2		*FRONT O/S & N/S BUMPER TOP GARNISH	Deformed	441.60 FN	*441.60 FN
31	2		*FRONT BUMPER O/S & N/S RETAINER	Necessary	126.70 FN	*126.70 FN
32	2		*FRONT O/S & N/S HEAD LAMP	Cracked	1,296.80 FN	*1,296.80 FN
33	1		*FRONT GRILLE	Cracked	520.50 FN	*520.50 FN
34	1		*FRONT GRILLE EMBLEM	Necessary	82.20 FN	*82.20 FN
35	1		*FRONT BONNET	Dented	1,144.80 FN	*864.00 FN
36	10		*REAR BUMPER CLIPS	Necessary	30.00 FS	*30.00 FS
37	2		*REAR O/S & N/S TAIL LAMP INNER SEAL	Not Necessary	20.00 FS	*- FS
38	1		*REAR O/S WINDSCREEN MOULDING	Necessary	130.00 FS	*130.00 FS
39	1		*REAR O/S WINDSCREEN SEALANT	Necessary	80.00 FS	*60.00 FS
40	1		*REAR N/S TAIL GATE PROTECTOR STRIP	Necessary	80.00 FS	*40.00 FS
41	12		*REAR N/S TAIL GATE INNER BOARD CLIPS	Not Necessary	36.00 FS	*- FS
42	4		*REAR N/S TAIL GATE MOULDING CLIPS	Not Necessary	16.00 FS	*- FS
43	1		*REAR N/S WINDSCREEN SEALANT	Necessary	80.00 FS	*60.00 FS
44	1		*REAR N/S WINDSCREEN MOULDING	Necessary	150.00 FS	*150.00 FS
45	1		*REAR TAIL GATE 70KM EMBLEM	Necessary	15.00 FS	*15.00 FS
46	1		*REAR TAIL GATE 5 PAX EMBLEM	Necessary	15.00 FS	*15.00 FS
47	1		*REAR REVERSE SENSOR	Damaged	280.00 FS	*200.00 FS
48	12		*FRONT BUMPER CLIPS	Necessary	60.00 FS	*30.00 FS
49	1		*FRONT NUMBER PLATE	Bent	45.00 FS	*30.00 FS
50	1		*FRONT NUMBER PLATE BRACKET	Deformed	29.00 FS	*29.00 FS

F=Franchise part. S=SpcNett. N=NettItemDisc.

Sub Total (\$\$)	13,189.50	9,006.60
- Nett Item Discount on N Items 10.00/10.00% (\$\$)	1,212.35	821.76
Total Parts (\$\$)	11,977.15	8,184.84

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
Report was unsubmitted during this print-out.						

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO DISMANTLE DAMAGED PARTS ,STRAIGHTEN & WELDING	New	1,600.00	1,200.00
2	TO SPRAY PAINTING	New	1,400.00	1,000.00
3	TO REMOVE & REPLACE /REFIT REAR O/S & N/S TAIL GATE DOOR FITTINGS	New	140.00	120.00
4	TO REMOVE & REFIT REAR TAIL GATE O/S WINDSCREEN	New	130.00	60.00
5	TO REMOVE & REFIT REAR TAIL GATE N/S WINDSCREEN	New	130.00	60.00
6	TO REMOVE AND REPLACE REAR REVERSE SENSOR	New	50.00	50.00
7	TO CHECK WIRING	New	80.00	60.00
8	TO RE SEAL ANTI RUST	New	150.00	60.00
Gross Labour Cost (\$\$)			3,680.00	2,610.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >