



*****INVOICE*****

M/S: Mohamed Hameem Mohamed Kassim
C/O MCS AUTO
1100 Serangoon Road
Singapore 328196

Invoice No : 21-08580

Invoice Ref : TP/MCS/FBK3092H/8580

Date : 18 October 2021

DESCRIPTION	AMOUNT
For Services Rendered Inspection Report Fees Inclusive Of : Re-Inspection, Transportation And Photographs Forty (40) Copies Vehicle No : FBK 3092 H Make/Model : Bajaj Pulsar 200 NS FI	\$ 400.00
Singapore Dollars: Four Hundred Only	\$ 400.00

Cheques should be made payable to **KTO AUTOMOBILE ASSESSORS**. Please indicate our Invoice No. on the reverse of your cheque.

KTO AUTOMOBILE ASSESSORS

Ong Ah Keng (CAE, AMIMI, MSAAA)
Automotive Appraiser

**ACCIDENT DAMAGED VEHICLE INSPECTION REPORT**

M/S : Mohamed Hameem Mohamed Kassim
C/O MCS AUTO
1100 Serangoon Road
Singapore 328196

Date : 18 October 2021
Our Ref : TP/MCS/FBK3092H/8580

REFERENCE PARTICULARS

Date of Accident : 05 September 2021
Date of Inspection : 13 September 2021

Type of Inspection : Third Party Claim
Date of Re-Inspn : 29 September 2021

VEHICLE PARTICULARS

Registration No : FBK 3092 H
Make : Bajaj
Model : Pulsar 200 NS FI
Year : 201 (COE Expiry 14 Jun 2025)

Engine No : JLZCFA76409
Chassis No : MD2A36FZ5FCA85412
Odometer : 52411 km
Colour : Black

CONDITION OF VEHICLE (STATIC CHECKS AT TIME OF INSPECTION ONLY)

Engine condition : Good
Front brake : Serviceable
Rear brake : Serviceable

General Body Work : Good
Steering : Affected
Lightings : Serviceable

TYRE CONDITION (Remaining estimated life of tyre in mm)

<u>Location</u>	<u>Make</u>	<u>Size</u>	<u>Thread Balance</u>
Front	: Bridgestone	100/80-17	5 mm
Rear	: Bridgestone	130/70-17	6 mm

GENERAL DESCRIPTION OF DAMAGES

The motorcycle sustained damage at the front & left side portion.

For details, refer to assessment for repairs and photographs attached.

ASSESSMENT SUMMARY

Our assessment of the repair costs to pre-accident condition was **\$3,700.00 nett** at lump sum basis. (Subject to GST if applicable)

Under normal circumstances, estimated period required for repairs : Five (5) working days.

Enclosed Forty (40) photographs depicting damage to the vehicle and after repair.

Inspection conducted at : MCS AUTO.
1100 Serangoon Road Singapore 328196

In accordance to your instruction, we have **not authorise** repairs and inspection was conducted strictly on a "**WITHOUT PREJUDICE BASIS**".

ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS

DESCRIPTION OF PARTS AND NATURE OF REPAIRS						
A)	SPARE PARTS	QTY PC/SET	ASSESSED CONDITION		ORIGINAL QUOTATION	REVISED QUOTATION
1	Headlamp cowling	1	Grazed	\$	85.00	\$ 85.00
2	Front cowling stay	1	Bent	\$	65.00	\$ 65.00
3	Front signal lamp LH	1	Broken	\$	45.00	\$ 45.00
4	Handle bar L/R @ \$95.00	2	LH only (Broken)	\$	190.00	\$ 95.00
5	Handle bar holder L/R	1	Bent	\$	75.00	\$ 75.00
6	Handle bar balancer LH	1 set	Grazed	\$	30.00	\$ 30.00
7	Brake lever	1	Bent	\$	28.00	\$ 28.00
8	Clutch lever	1	Bent	\$	28.00	\$ 28.00
9	View mirror LH	1 set	Grazed	\$	150.00	\$ 150.00
10	Front windshield	1	Scratched	\$	158.00	\$ 158.00
11	Headlamp assy	1	Grazed	\$	255.00	\$ 255.00
12	Tank side spoiler LH	1	Grazed	\$	198.00	\$ 198.00
13	Radiator assy	1	Dented	\$	280.00	\$ 280.00
14	Radiator side bracket LH	1	Bent	\$	45.00	\$ 45.00
15	Radiator cover LH	1	Grazed	\$	48.00	\$ 48.00
16	Radiator grille cover	1	Torn	\$	60.00	\$ 60.00
17	Fork inner tube L/R @ \$180.00	2	Misaligned	\$	360.00	\$ 360.00
18	Fork under bracket	1	Misaligned	\$	187.00	\$ 187.00
19	Front fender	1	Grazed	\$	86.00	\$ 86.00
20	Front wheel rim	1	Warped	\$	380.00	\$ 380.00
21	Front wheel axle shaft	1	Grazed/Bent	\$	45.00	\$ 45.00
22	Front footrest LH	1	Grazed/Bent	\$	48.00	\$ 48.00
23	Gear shift pedal	1	Bent/Grazed	\$	38.00	\$ 38.00
24	Gear shift rod	1	Bent	\$	25.00	\$ 25.00
25	Rear brake pedal	1	Bent	\$	48.00	\$ 48.00
26	Footrest bracket LH	1	Bent	\$	95.00	\$ 95.00
27	Rear footrest LH	1	Grazed	\$	35.00	\$ 35.00
28	Rear footrest bracket LH	1	Bent/Gazed	\$	85.00	\$ 85.00
29	Rear seat cowling	1	Grazed	\$	298.00	\$ 298.00
30	Rear signal lamp LH	1	Broken	\$	45.00	\$ 45.00
				\$	3,515.00	\$ 3,420.00
				\$	351.50	\$ 342.00
				\$	3,163.50	\$ 3,078.00
B)	S/NETT ITEM					
31	Front number plate	1	Bent	\$	15.00	\$ 12.00
32	I.U meter	1	Faulty	\$	159.00	\$ 159.00
33	Steering upper/lower cone bearing	1 set	Necessary	\$	55.00	\$ 55.00
34	Rear 'Kappa' top cases	1	Grazed	\$	560.00	\$ 560.00
35	Rear box bracket	1 set	Bent	\$	120.00	\$ 120.00
36	Rear seat cowling decals set	1 set	Necessary	\$	26.00	\$ 26.00
37	Fork oil	1	Necessary	\$	12.00	\$ 12.00
38	Fork oil seal & dust cover L/R @ \$24.00	2	Necessary	\$	48.00	\$ 48.00
				\$	4,158.50	\$ 4,070.00

C) LABOUR CHARGES

39	Towing service charge. (2 Trips)	\$	80.00	\$	80.00
40	To conduct front body frame alignment.	\$	280.00	\$	180.00
41	Replace, realign & adjust above damaged parts. Check wiring & lighting system.	\$	450.00	\$	350.00
Labour Total :		\$	810.00	\$	610.00
Total Parts and Labour		\$	4,968.50	\$	4,680.00

FINAL LUMP SUM ADJUSTMENT

\$ 3,700.00

REMARKS

The repairer has agreed to undertake repair the vehicle at a lump sum basis of **\$3,700.00 nett** corresponding to replacement of parts and labour charges. We now revert for your decision on the above claim.

Yours faithfully
KTO Automobile Assessors



Ong Ah Keng (CAE, AMIMI, MSAAA)
Automotive Appraiser