


PRS

ASSIGNMENT

Date: _____
 Estimated Cost: _____
 To Inspect Vehicle No: FBF 6891A
 at Workshop no: _____
 Insured: SHC 4172A
 Policy No: _____
 Claims No: TAX/10/21/2059
 Sum Insured: _____
 (Client's Ref): _____
 Make of Vch: _____

(Policy Condition)

Remarks: The vch had commenced its repair at the time of inspection.

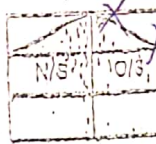

Est. or Market Value: \$10K
 IDAC Accident Report: _____ Consistent? : Yes or No
 DIA / PR Sect: _____ Consistent? : Yes or No
 Est. Repair: 2 days Res.: Yes or No
 Cum Sum: _____ % D Val.: Yes or No
 QA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____

Date / Time Action / Instruction

No G/A report

\$500-\$1000, 2 repair days

16/11/2021 Submit PRS

16/11 TYPIST ☐ : Prelim. Report
☐ : Final Report

TP
 www.gam110.hk

Vch No: FBF 6891A Yt Regn: _____
 Type: M/Cat / M/Cycle / Bus / Van / Lorry / Truck / Prime Mover /
 Truck / Trailer or _____
 Make: Yamaha
 Colour: Black A/C: _____ Insured / Stg / M / H
 Sp. Reading: 2015 Tyres: Insured / Stg / M / H
 Eng. No: 5YP-3034-86
 On/O: _____
 Gen. Condi: Good / Fair / Poor / Bught
 Steering: In / Jammed / Locked / Burnt or
 Brake: In / Jammed / Locked / Burnt or
 Model: MT 07 / MT 07 / MT 07
 Tyre Size: 70/90-17
80/90-17
 ES / DUN / EXNOVA / GY / FS / LIZA / MIO / OHTSU / PIR / SUMI
 YOYO / YOKO or DIABLO
 Front: _____ mm Rear: 4 mm
 Wheel: _____ mm USH: _____ mm
 D.O.A. 23/10/21 Hua Chin Trading Motor
 Survey held at _____
 Des. of Damages: Fr / Rear / O/S / M/S / VIC / Rollover or
 No. of / CRASHES frame / Body Structure affected due to collision

Days Of Repair: 2
 Resurvey No. of Trips: _____

Add Fee: ☐ : Site Insp (\$ _____)
☐ : Interview (\$ _____)
☐ : Tech. Insp (\$ _____)
☐ : Wheel and (\$ _____)

Survey Fee	Transportation
_____	_____
_____	_____
_____	_____
_____	_____