

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/CTI21011611/DVY3N2**Date:** 29/12/2021**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMPCSNW00196782000

Claimant Vehicle No : SMR8489Y **Insured Vehicle No :** SLW2499T

Date of Loss: 11/11/2021 Nature of Claim: TP Claim No: SNM21D206509/C02/LEEPG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMR8489Y**

Make & Model: MERCEDES-BENZ C180K, 1.6 (A) Engine No: 27191031344108

Reg. Date: 18/03/2011 (Man. Year: 2011) Chassis No: WDD2040452A507340

Colour: Brown Odometer: 135843 km

Engine Capacity: 1597 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 225/40R18 Rear Tyre Size: 225/40R18

Front Left Side: Yokohama 5 mm Rear Left Side: Yokohama 5 mm

Front Right Side: Yokohama 5 mm Rear Right Side: Yokohama 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 18/11/2021

Date Inspected: 16/11/2021 Inspected At: 68 KAKI BUKIT AVENUE 6 #03-05 REPAIRER: TRIPLE-T AUTOMOBILE

Estimated Period of Repair: 3.0 days

Adjuster: BRYAN TANI**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$2,500.00
-\$2,800.00

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 28 Dec 2021)
Parts:	143	MERCEDES-BENZ C180K 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMR8489Y)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >