



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2204439

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 20/07/2022
Reference CC6/CTI21011649/Kpa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMD 837C
Insured Veh. GBK 5912D
Claim No. SNM21D206507/C02
Policy No. DMCVSNW00104192101
Accident Date 11/11/2021
Inspection Date 12/11/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERS SINGAPORE 079909			Ref: CC6/CTI21011649/Kpa3q2 Date: 20/07/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBK 5912D	Veh. Inspected	SMD 837C
	Policy No.	DMCVSNW00104192101	Coverage (\$)	0.00
	Claim No.	SNM21D206507/C02	Excess (\$)	0.00
	Assign From		Assign Date	12/11/2021
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA SIENTA (A)	c.c	1496
	Engine No.	HIDDEN	Year of Reg.	2018
	Chassis No.	NHP1707108820	Colour	METALLIC SILVER
	Odometer	212583 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	185/60 R15	INTERTRAC	9 mm
	L/H Front Tyre	185/60 R15	INTERTRAC	9 mm
	R/H Rear Tyre	185/60 R15	SUNWIDE	7 mm
	L/H Rear Tyre	185/60 R15	SUNWIDE	7 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR & FRONT PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	11/11/2021	Inspection Date	12/11/2021
	Survey held at	OPTIMA WERKZ PTE LTD 6, KUNG CHONG ROAD SINGAPORE 159143		
5a. Remarks				
	A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		16 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMD 837C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	BUCKLED	450.00	450.00
1	RHF HEADLAMP	MTG CRACKED	990.00	990.00
1	LHF HEADLAMP	MTG CRACKED	990.00	990.00
1	FRONT BONNET	BENT	890.00	845.10
1	BONNET HINGE RH	DISTORTED	70.00	70.00
1	BONNET HINGE LH	DISTORTED	70.00	70.00
1	RETAINER RH	DISTORTED	68.00	68.00
1	RETAINER LH	DISTORTED	68.00	68.00
1	FRONT REINFORCEMENT BEAM	BENT	363.00	363.00
1	RADIATOR	SERVICEABLE	1,080.00	-
1	A/C CONDENSER	BENT	1,020.00	1,020.00
1	RHF FENDER	TO REPAIR SEE LABOUR	580.00	-
1	LHF FENDER	TO REPAIR SEE LABOUR	580.00	-
1	FRONT CHROME GRILLE	CRACKED	480.00	480.00
1	TOYOTA FRONT LOGO EMBLEM	NECESSARY	180.00	63.00
1	FRONT BASE GARNISH	BENT	520.00	125.00
1	REAR BUMPER	BENT	654.00	654.00
1	REAR BUMPER INNER /LOWER BUMPER	BENT	543.00	543.00
1	RHR CORNER INNER BUMPER	DENTED	383.00	383.00
1	LHR CORNER INNER BUMPER	DENTED	383.00	383.00
1	REAR TOYOTA EMBLEM	NECESSARY	168.00	168.00
1	RHR TAILGATE LAMP (INNER)	CRACKED	787.00	281.55
1	LHR TAILGATE LAMP (INNER)	CRACKED	787.00	281.55
1	RHR LAMP UNIT (OUTER)	CRACKED	678.00	460.50
1	LHR LAMP UNIT (OUTER)	CRACKED	678.00	460.50
1	REAR TAILGATE LID	BENT	1,281.90	1,086.00
1	REAR WINDSCREEN SIENTA	SHATTERED	1,040.00	1,040.00
1	REAR WIPER MOTOR	JAMMED	685.00	652.00
1	REAR WIPER ARM	DENTED	140.00	140.00

Report Ref No. CC6/CTI21011649/Kpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR WIPER RUBBER BLADE	CUT	98.00	98.00
1	WEATHERSTRIP	DENTED / CUT	168.00	168.00
1	SET REAR WINDSCREEN INNER RUBBER	SERVICEABLE	88.00	-
1	REAR TOP LISENCE SIENTA GARNISH	MTG BROKEN	456.00	456.00
1	REAR END PANEL	BENT	876.00	689.75
1	FLOOR REAR PANEL	BENT	676.00	676.00
1	REAR TAILGATE LOCK UNIT	JAMMED	382.00	382.00
1	REAR END PANEL GARNISH	CRACKED	442.00	266.00
1	REAR TAILGATE GARNISH	DISTORTED	432.00	260.50
1	REAR TAILGATE HINGE RH	DISTORTED	123.00	123.00
1	REAR TAILGATE HINGE LH	DISTORTED	123.00	123.00
1	REAR TAILGATE ABSORBER RH	PUNCTURE	298.00	298.00
1	REAR TAILGATE ABSORBER LH	PUNCTURE	298.00	298.00
1	SIENTA REAR HYBRID SYNERGY DRIVER EMBLE	NECESSARY	66.00	66.00
1	RHR INNER GARNISH	DISTORTED	444.00	444.00
1	LHR INNER GARNISH	BUCKLED	456.00	456.00
1	FLOOR PANEL MAT /GARNISH	CRACKED	345.00	345.00
1	3RD ROW SEAT FLOOR MAT	SERVICEABLE	434.00	-
1	FLOOR REAR BATTERY COVER PLASTIC	CRACKED	240.00	240.00
1	3RD ROW SEAT CHAIR RH	TO REPAIR SEE LABOUR	1,080.00	-
1	FRONT SUPPORT PANEL /BULKHEAD (ADDITIONAL)	BUCKLED	898.00	788.10
1	HYBRID COOLER (ADDITIONAL)	BENT	878.00	690.60
1	FRONT SUPPORT TOP LH (ADDITIONAL)	SERVICEABLE	183.00	-
1	FRONT SUPPORT MAIN BEAM PANEL LH (ADDITIONAL)	TO REPAIR SEE LABOUR	584.00	-
1	FRONT AIR DUCT COVER RH (ADDITIONAL)	CRACKED	128.00	128.00
1	FRONT AIR DUCT COVER LH (ADDITIONAL)	CRACKED	128.00	128.00
1	FRONT BONNET LOCK (ADDITIONAL)	DISTORTED	228.00	228.00
1	FRONT FOAM BUMPER (ADDITIONAL)	CRACKED	168.00	168.00
1	FRONT UNDERCARRIAGE COVER (ADDITIONAL)	SERVICEABLE	479.00	-
1	TAILGATE HOLDER COVER (ADDITIONAL)	DENTED	65.00	65.00
1	REAR ANTENAL SENSOR (ADDITIONAL)	BROKEN	175.00	175.00
1	LHR MULFRED (ADDITIONAL)	SERVICEABLE	151.00	-

Report Ref No. CC6/CTI21011649/Kpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RHR MULFRED (ADDITIONAL)	DISTORTED	151.00	151.00
2	RUBBER HOLDER REAR EXHAUST @\$55.00	SERVICEABLE	110.00	-
2	TAILGATE LAMP LICENSE PLATE @\$85.00 (ADDITIONAL)	BROKEN	170.00	170.00
1	REAR EXHAUST PIPE (ADDITIONAL)	TO REPAIR SEE LABOUR	680.00	-
1	RHR LAMP END PANEL (ADDITIONAL)	BENT	555.00	285.00
1	LHR LAMP END PANEL (ADDITIONAL)	BENT	555.00	285.00
1	REAR FLOOR SUPPORT BEAM (ADDITIONAL)	BENT	464.00	464.00
1	REAR TOP FENDER COVER LH (ADDITIONAL)	CRACKED	580.00	580.00
1	REAR TOP FENDER COVER RH (ADDITIONAL)	CRACKED	580.00	580.00
1	REAR AIR DUCK COVER LH (ADDITIONAL)	DENTED	164.00	164.00
1	REAR AIR DUCK COVER RH (ADDITIONAL)	SERVICEABLE	164.00	-
	LESS 20% DISCOUNT		-6,473.98	-
	LESS 25% DISCOUNT		-	-5,643.54
			25,895.92	16,930.61
	<u>SPECIAL NETT ITEMS</u>			
1	COOLANT (SN)	NECESSARY	120.00	50.00
2	REAR REVERSE SENSOR @\$160.00 (SN)	DENTED	320.00	200.00
20	BUMPER CLIPS @\$4.00 (SN)	NECESSARY	80.00	50.00
2	SEALANT @\$60.00 (SN)	NECESSARY	120.00	40.00
4	REAR FLOOR COVER BATTERY CLIPS @\$5.00 (SN)	NOT NECESSARY	20.00	-
1	SET FRONT & REAR NUMBER PLATE (SN)	DENTED	150.00	90.00
8	REAR PANEL BASE HOLDER CLIP @\$7.50 (SN) (ADDITIONAL)	NECESSARY	60.00	60.00
1	CAR BATTERY (\$200.00) (50%) (SN) (ADDITIONAL)	DEFORMED	380.00	100.00
1	REAR REVERSE CAMERA (SN) (ADDITIONAL)	DAMAGED	428.00	320.00
			1,678.00	910.00
	<u>LABOUR</u>			
	LABOUR CHARGES TO REMOVE ,REPLACE ,REPAIR ,READJUST ,DISMANTLE ACCIDENT AREA & ETC .INCLUSIVE OF THE REPAIR OF RHF FENDER,LHF FENDER,3RD ROW SEAT CHAIR RH,FRONT SUPPORT MAIN BEAM PANEL LH AND REAR EXHAUST PIPE.		3,600.00	2,000.00

Report Ref No. CC6/CTI21011649/Kpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR CHARGES FOR PAINTING & TO SUPPLY PAINT & FURNISHING MATERIALS AT ACCIDENT AREAS & ETC.		2,800.00	2,400.00
	LABOUR CHARGES TO REMOVE REPLACE REFIX FRONT & REAR BOTH FENDER AREA ABSORBER ,STABILIZER BAR ,UNDERCARRIAGE ,FUEL TANK ,CLEAR SHUTTLE GLASS & ETC .		1,200.00	380.00
	LABOUR CHARGES TO DISCONNECT & RECONNECT FRONT WIRING SYSTEM & ETC.TO EFFECT REPAIR AT FRONT ACCIDENT & ETC.		500.00	40.00
	LABOUR CHARGES TO DIAGNOSE FAULTY CODE & RESET MEMORY.		400.00	150.00
	LABOUR CHARGES FOR KNOCKING /STRAIGHTEN REPAIR ALL ACCIDENT AREAS & ETC (INCLUDE FRONT SUPPORT PANEL BULKHEAD & REAR FLOOR PANEL). (ADDITIONAL)	NOT NECESSARY	400.00	-
	LABOUR CHARGES FOR KNOCKING /STRAIGHTEN & REPAIR ALL ACCIDENT AREAS & ETC.(INCLUDE BOTH FRONT & REAR FENDER). (ADDITIONAL)	NOT NECESSARY	800.00	-
	SPRAY PAINT FOR ACCIDENT CONSISTANCE AFFECTED AREA X4 DOOR PANEL. (ADDITIONAL)	NOT NECESSARY	400.00	-
	INSTALL REAR WINDSCREEN GLASS & CLEAR ALL THE SHUTTLE GLASS . (ADDITIONAL)		300.00	120.00
	REMOVE & INSTALL RADIATOR,COOLANT ,A/C CONDENSER GAS RECHARGE MECHANISM TO FACILITATE REPAIR WITH CHECK FOR FUNCTION. (ADDITIONAL)		300.00	100.00
	REMOVE & INSTALL INTERIOR LINNING ,ROOF ,SEATS & REAR COMPARTMENT LINING . (ADDITIONAL)		300.00	120.00
	REMOVE & INSTALL FUEL TANK & PIPE LINE FOR FLOOR PANEL. (ADDITIONAL)		300.00	60.00
	REMOVE & INSTALL REAR EXHAUST PIPE. (ADDITIONAL)	NOT NECESSARY	200.00	-
			11,500.00	5,370.00
GRAND TOTAL			39,073.92	23,210.61

RECOMMENDED COST OF REPAIRS			23,210.61
------------------------------------	--	--	------------------

Report Ref No. CC6/CTI21011649/Kpa3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMD 837C

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

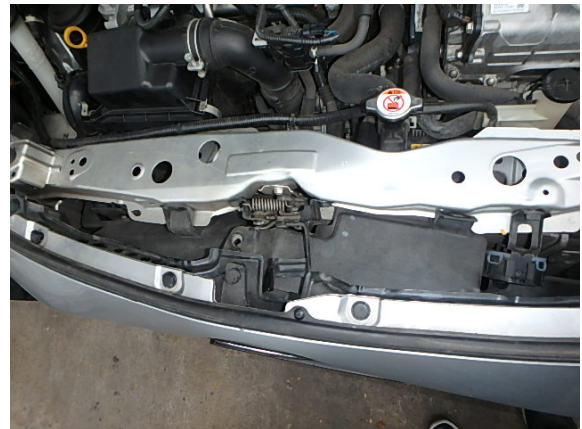



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMD 837C

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

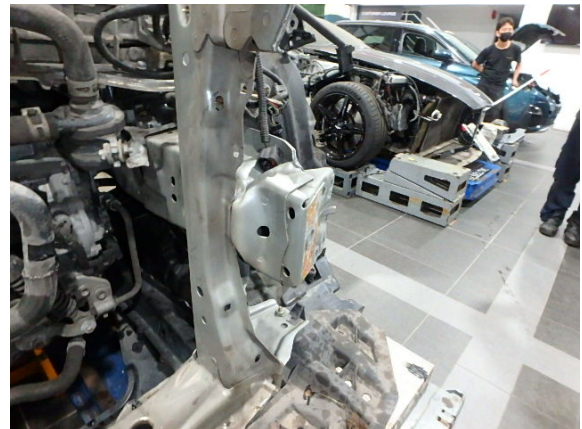




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

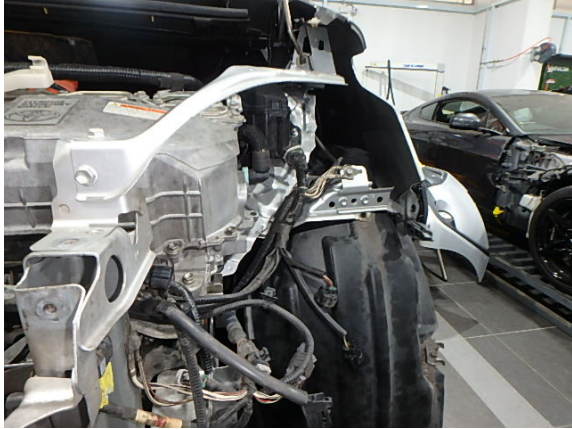



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMD 837C

RE-INSPECTION

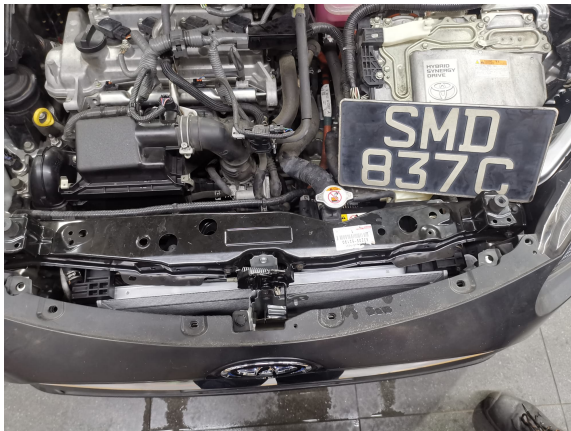



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

