

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CS3/CTI21011802/T1VY3N2**Date:** 24/11/2021**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMPCSNW00176932101
<b>Claimant Vehicle No :</b>	SLT3389L	<b>Insured Vehicle No :</b>	SKS845Z
Date of Loss:	17/11/2021	Nature of Claim:	TP
		Claim No:	SNM21D206646/C02/TANCHC

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

Reg No:	<b>SLT3389L</b>	Engine No:	28291480199353
Make & Model:	MERCEDES-BENZ CLA200, 1.3 AMG LINE (A)	Chassis No:	WDD1183872N018991
Reg. Date:	13/09/2019 (Man. Year: 2019)	Odometer:	39876 km
Colour:	Black		
Engine Capacity:	1332 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

**CONDITION OF TYRES**

Front Tyre Size:	225/45R17	Rear Tyre Size:	225/45R17
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

**INSPECTION**

Date of Assignment:	19/11/2021	
Date Inspected:	22/11/2021	Inspected At: Garage 13 Pte Ltd (HQ) 8 Kaki Bukit Ave 4, Premier @ Kaki Bukit, #03-46 Singapore 415875
Estimated Period of Repair:	3.0 days	

**Adjuster:** MOHD TAUFIKH BIN HAMID**Manager:** VERON CHEN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.  
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$2,000.00  
-\$3,000.00

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 24 Nov 2021)
Parts:	143	MERCEDES-BENZ CLA200 1.3 AMG LINE (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLT3389L)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >