

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI21011857/EVY3N2**Date:** 29/06/2022**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMCVSNA00058162102

Claimant Vehicle No : SMN5064E **Insured Vehicle No :** GBH4695C

Date of Loss: 17/11/2021 Nature of Claim: TP Claim No: SNM21D206663/C02/TANKL

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMN5064E**

Make & Model: SUBARU XV, 2.0 I-S EYESIGHT AWD CVT (A) Engine No: FB20CF34431

Reg. Date: 15/08/2019 (Man. Year: 2019) Chassis No: JF1GT7KL5KG070425

Colour: Orange Odometer: 42970 km

Engine Capacity: 1995 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/60R16 Rear Tyre Size: 215/60R16

Front Left Side: Michelin 5 mm Rear Left Side: Michelin 5 mm

Front Right Side: Michelin 5 mm Rear Right Side: Michelin 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	630.30	322.56	307.74	48.82
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,540.00	1,000.00	540.00	35.06
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	2,170.30	1,322.56	847.74	39.06
+ GST 7.00/7.00% (S\$)	151.92	92.58	59.34	39.06
Nett Amount (S\$)	2,322.22	1,415.14	907.08	39.06

INSPECTION

Date of Assignment: 22/11/2021

Date Inspected: 23/11/2021 Inspected At: Motor Image Enterprises Pte Ltd (Leng Kee)
25 Leng Kee Road
Singapore 159097

Estimated Period of Repair: 3.0 days

Adjuster: CHEN TSUE YEE**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 29 Jun 2022)

Parts: M1-SUV SUBARU XV 2.0 I-S EYESIGHT AWD CVT (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SMN5064E)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BUMPER-FACE,REAR	Dented	403.20 F	*403.20 FL
2	1		*BRACKET-REAR BUMPER SIDE,RIGHT	Not Necessary	12.10 F	*- FL
3	1		*BRACKET-REAR BUMPER SIDE,LEFT	Not Necessary	12.10 F	*- FL
4	1		*BACK BEAM COMPLETE-REAR	Not Necessary	202.90 F	*- FL

F=Franchise part. L=ListItemDisc.

Sub Total (\$)	630.30	403.20
- List Item Discount on L Items 0.00/20.00% (\$)	0.00	80.64
Total Parts (\$)	630.30	322.56

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	REMOVE & REPLACE REAR BUMPER,BUMPER BEAM,BRACKET	New	580.00	580.00
2	RESPRAY REAR BUMPER ASSY,BUMPER BEAM	New	960.00	420.00
Gross Labour Cost (\$)			1,540.00	1,000.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >