1/11/23, 4:20 PM Adjuster Report

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC4/AIG21011874/TPA3Q2

11/01/2023 Date:

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2100503487 **Claimant Vehicle** SHC8595L Insured Vehicle No: SLL8425A

No:

Date of Loss: 20/11/2021 Nature of Claim: TP Claim No: 6309175982SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SHC8595L

HYUNDAI 140, 1.7 L CRDI AT ABS AIRBAG Make & Model:

Engine No: D4FDFU530050 4DR (A)

Reg. Date: Chassis No: KMHLB41UMGU082967 17/12/2015 (Man. Year: 2015) Colour: Blue Odometer: 858138 km

Engine Capacity: 1685 cc

Market Value/New Car

N/A Price:

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Pre-accident Condition: Handbrake (Serviceable): Engine Modification: Yes No

CONDITION OF TYRES

205/60 R16 Front Tyre Size: 205/60 R16 Rear Tyre Size: Front Left Side: Rear Left Side: West Lake 6 mm West Lake 6 mm Rear Right Side: Front Right Side: West Lake 6 mm West Lake 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS		Repairer's	Adjuster's	Difference	Diff %
Parts		1,266.42	424.50	841.92	66.48
Miscellaneous Items		0.00	0.00	0.00	
Labour		680.00	560.00	120.00	17.65
Paintwork Labour		0.00	0.00	0.00	
Towing		0.00	0.00	0.00	
Calculate	ed Gross Total (S\$)	1,946.42	984.50	961.92	49.42
Approved Tota	l (Overridden) (S\$)		750.00		
	(S\$)	1,946.42	750.00	1,196.42	61.47
+ G	ST 7.00/7.00% (S\$)	136.25	52.50	83.75	61.47
	Nett Amount (S\$)	2,082.67	802.50	1,280.17	61.47
	+ Loss of Use (2.0 x S\$	50.00/day) (S\$)	100.00		
	+ Car Rental (2.0 x S\$1	10.67/day) (S\$)	221.34		
	+ Doc/S	earch Fee (S\$)	2.00		
	Ne	tt Liability (S\$)	1,125.84		
	Global Sum S	Settlement (S\$)	1,120.00		

INSPECTION

Date of Assignment: 22/11/2021

ComfortDelGro Engineering Pte Ltd (Loyang) Date Inspected: 22/11/2021 Inspected At: 59 Loyang Drive

Singapore 508969

Estimated Period of Repair: 2.0 days Adjuster: MOHD TAUFIKH BIN HAMID Manager: CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*COVER ASSY-RR BUMPER 50% discount	Deformed	553.00 FL	*276.50 FL
2	1		*COVER-RR BUMPER LWR	Not Necessary	228.00 FL	*- FL
3	1		*ABSORBER - RR BUMPER ENERGY	Not Necessary	119.50 FL	*- FL
4	1		*BEAM -RR BUMPER	Not Necessary	428.40 FL	*- FL
5	10		*BUMPER COVER CLIP REAR	Necessary	22.00 FL	*22.00 FL
6	1		*PROTECTOR MAT	Necessary	50.00 FS	*50.00 FS
7	1		*REVERSE SENSOR ASSY	Necessary	135.70 FS	*135.70 FS
F=Fra	anchise	part. S=SpcNe	ett. L=ListItemDisc.	_		
				Sub Total (S\$)	1,536.60	484.20
			- List Item Discount o	n L Items 20.00/20.00% (S\$)	270.18	59.70
				Total Parts (S\$)	1,266.42	424.50
			Report was unsubmitted d	luring this print-out.		

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount			
Lab	<u>our Items</u>			*			
1	PANEL BEATING	New	300.00	280.00			
2	SPRAYPAINT CHARGE	New	300.00	250.00			
3	REMOVE/REFIX REVERSE SENSOR	New	80.00	30.00			
		Gross Labour Cost (S\$)	680.00	560.00			
	Report was unsubmitted during this print-out.						

< END OF ESTIMATES >