

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CS3/CTI21011887/GQY3N2**Date:** 26/11/2021**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMCVSNW00102402102

**Claimant Vehicle No :** SKP626E **Insured Vehicle No :** GBB2282E

Date of Loss: 20/11/2021 Nature of Claim: TP **Claim No:** SNM21D206719/C02/TANKW

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

Reg No: **SKP626E**

Make & Model: HYUNDAI ELANTRA, 1.6 ABS D/AB 2WD 4DR (A) Engine No: G4FGEU026408

Reg. Date: 12/08/2014 (Man. Year: 2014) Chassis No: KMHDH41CMEU208248

Colour: Blue Odometer: 266081 km

Engine Capacity: 1591 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

**CONDITION OF TYRES**

Front Tyre Size: 205/55R16 Rear Tyre Size: 205/55R16

Front Left Side: Hankook 6 mm Rear Left Side: Hankook 6 mm

Front Right Side: Hankook 6 mm Rear Right Side: Hankook 6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

**INSPECTION**

Date of Assignment: 24/11/2021

Date Inspected: 23/11/2021 Inspected At: Garage 13 Pte Ltd (HQ)  
8 Kaki Bukit Ave 4, Premier @ Kaki Bukit, #03-46  
Singapore 415875

Estimated Period of Repair: 6.0 days

**Adjuster:** XING GUO QIANG**Manager:** SHIAU CHAN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$5,000.00  
-\$6,000.00

## REPAIR DETAILS

### Reference

**Part Source:** MRM-SG    Version: 1.0 (Last Synchronised: 26 Nov 2021)

**Parts:**            143            HYUNDAI ELANTRA 1.6 ABS D/AB 2WD 4DR (A) (Catalogue:Merimen Singapore 1.0)

**Labour:**          Repairer's    (Price-denominated Standard List)

**Print Code:** (Unsubmitted, no print-code for SKP626E)

**Validity:**        These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk \*.

### Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

**< END OF ESTIMATES >**