

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI21011889/KVY3N2**Date:** 29/11/2021REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMPCSNW00218072105	
Claimant Vehicle No :	GBK50Z	Insured Vehicle No :	SLH2956U	
Date of Loss:	22/11/2021	Nature of Claim:	TP	Claim No: SNM21D206738/C02/TANCHC

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	GBK50Z		
Make & Model:	MITSUBISHI CANTER, 3.0 D FEA01BR1SDEK (CBU) (M)		Engine No: 4P10D76216
Reg. Date:	20/09/2019 (Man. Year: 2019)		Chassis No: FEA01BA30301
Colour:	White		Odometer: 55060 km
Engine Capacity:	2998 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	185/75 R15	Rear Tyre Size:	185/75 R15(D)
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 2/2 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 2/2 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	8,108.31	3,955.85	4,152.46	51.21
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,730.00	1,430.00	1,300.00	47.62
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (\$\$)	10,838.31	5,385.85	5,452.46	50.31

INSPECTION

Date of Assignment:	23/11/2021	Poon Siang Seow (HQ)
Date Inspected:	23/11/2021	Inspected At: 160 Sin Ming Drive, #05-13 Sin Ming AutoCity
Estimated Period of Repair:	4.0 days	Singapore 575722

Adjuster: KENNETH KONG**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 29 Nov 2021)		
Parts:	N/A	MITSUBISHI CANTER 3.0 D FEA01BR1SDEK (CBU) (M) (Model not available in database)	
Labour:	Repairer's	(Price-denominated Standard List)	
Print Code:	(Unsubmitted, no print-code for GBK50Z)		
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page		
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.		

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT DOOR	Bent	969.31 F	*969.31 FL
2	1		*FRONT DOOR HINGE (2 Pcs)	Lower Bent	248.80 F	*124.40 FL
3	1		*FRONT DOOR SIDE GARISH	Dented/ Cut	167.30 F	*167.30 FL
4	1		*FRONT DOOR RUBBER	Distorted/Dented	234.80 F	*234.80 FL
5	1		*FRONT DOOR STICKER DUONIC	Necessary	65.80 F	*65.80 FL
6	1		*FRONT RIGHT PILLAR	Repair	1,533.25 F	*- FL
7	1		*CONNER PANEL RIGHT	Buckled/Mtg Cracked	524.54 F	*408.25 FL
8	1		*HEAD LAMP RIGHT	Cracked	501.40 F	*501.40 FL
9	1		*SIDE LAMP RIGHT	Broken	266.35 F	*266.35 FL
10	1		*SIDE REFLECTOR COVER RIGHT	Broken	222.53 F	*222.53 FL
11	1		*FRONT STEP GARNISH RIGHT	Cut	503.15 F	*341.21 FL
12	1		*FRONT W/S RUBBER	Serviceable	298.00 F	*- FL
13	1		*FRONT GRILLE	Cracked	444.80 F	*444.80 FL
14	1		*FRONT GRILLE LOG	Necessary	81.80 F	*81.80 FL
15	1		*FRONT BUMPER	Buckled	795.48 F	*780.90 FL
16	1		*FRONT BUMPER SIDE COVER RUBBER	Buckled	321.60 F	*319.82 FL
17	1		*FRONT BUMPER BRACKET RIGHT	Repair	120.00 F	*- FL
18	1		*FRONT GRILLE BADGE	Necessary	85.80 F	*85.80 FL
19	1		*COMPANY LOG STICKER	Necessary	450.00 FS	*180.00 FS
20	1		*LETTERING	Necessary	15.00 FS	*15.00 FS
21	1		*FRONT PILLAR RUBBER	Serviceable	258.60 F	*- FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	8,108.31	5,209.47
- List Item Discount on L Items 0.00/25.00% (\$\$)	0.00	1,253.62
Total Parts (\$\$)	8,108.31	3,955.85

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	RUSTPROOFING	New	100.00	30.00
2	TO REMOVE AND REFIT DASHBOARD N W/S	New	450.00	0.00
3	SPRAY PAINTING	New	980.00	800.00
4	PANEL BEATING	New	1,200.00	600.00
Gross Labour Cost (\$\$)			2,730.00	1,430.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >