

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG21011946/UPA3Q2**Date:** 20/04/2022REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2070174771
Claimant Vehicle No :	SNA7116H	Insured Vehicle No :	GY51M
Date of Loss:	23/11/2021	Nature of Claim:	TP
		Claim No:	3986989208SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SNA7116H	Engine No:	2ZR2M02539
Make & Model:	TOYOTA NOAH, 1.8 (A)	Chassis No:	ZWR800495326
Reg. Date:	07/07/2021 (Man. Year: 2021)	Odometer:	11377 km
Colour:	Purple		
Engine Capacity:	1797 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	Yokohama 8 mm	Rear Left Side:	Yokohama 8 mm
Front Right Side:	Yokohama 8 mm	Rear Right Side:	Yokohama 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	20,465.16	9,642.32	10,822.84	52.88
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,830.00	2,700.00	2,130.00	44.10
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	25,295.16	12,342.32	12,952.84	51.21
Approved Total (Overridden) (S\$)		12,342.31		
(S\$)	25,295.16	12,342.31	12,952.85	51.21
+ GST 7.00/7.00% (S\$)	1,770.66	863.96	906.70	51.21
Nett Amount (S\$)	27,065.82	13,206.27	13,859.55	51.21
+ Car Rental (8.0 x S\$100.00/day) (S\$)		800.00		
+ Doc/Search Fee (S\$)		2.00		
Nett Liability (S\$)		14,008.27		
Global Sum Settlement (S\$)		14,000.00		

INSPECTION

Date of Assignment:	24/11/2021	
Date Inspected:	24/11/2021	Inspected At: Fastech Auto Pte Ltd (HQ) 1 Kaki Bukit Ave 6, #01-46/48/50 Autobay Singapore 417883
Estimated Period of Repair:	7.0 days	

Adjuster: MARCUS CHUA**Manager:** CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR WINDSCREEN	Shattered	1,260.80 F	*1,260.80 FL
2	1		*REAR WINDSCREEN MOULDING	Necessary	157.30 F	*157.30 FL
3	1		*TAILGATE	Repair	1,802.00 F	*- FL
4	1		*TAILGATE OUTER CHROME	Cut	389.83 F	*389.83 FL
5	1		*TAILGATE INNER LOCK	Not Necessary	470.36 F	*- FL
6	1		*TAILGATE WEATHERSTRIP	Not Necessary	388.10 F	*- FL
7	1		*TAILGATE HYBRID EMBLEM	Serviceable	95.00 F	*- FL
8	1		*TAILGATE INNER TRIM BOARD	Not Necessary	688.10 F	*- FL
9	1		*REAR BUMPER	Distorted	1,121.00 F	*1,050.10 FL
10	1		*REAR BUMPER REFLECTOR O/S	Broken	85.00 F	*85.00 FL
11	1		*REAR BUMPER SIDE RETAINER O/S	Cracked	95.00 F	*95.00 FL
12	1		*REAR BUMPER BRACKET O/S	Repair	85.00 F	*- FL
13	1		*REAR BUMPER SPLASH SHIELD O/S	Deformed / Torn	182.10 F	*182.10 FL
14	1		*TAILLAMP O/S	Broken	1,380.00 F	*1,210.00 FL
15	1		*TAILLAMP LOWER GARNISH O/S	Distorted	376.80 F	*376.80 FL
16	1		*TAILLAMP LOWER GARNISH RETAINER TOP O/S	Broken	75.00 F	*75.00 FL
17	1		*TAILLAMP LOWER GARNISH RETAINER LOWER O/S	Broken	72.00 F	*72.00 FL
18	1		*TAILLAMP OUTER TOP PANEL O/S	Dented	188.20 F	*188.20 FL
19	1		*TAILLAMP OUTER LOWER PANEL O/S	Dented	180.10 F	*159.03 FL
20	1		*TAILLAMP INNER HOUSING PANEL O/S	Repair	199.10 F	*- FL
21	1		*REAR END PANEL	Repair	735.10 F	*- FL
22	1		*REAR END PANEL TOP GARNISH	Not Necessary	281.20 F	*- FL
23	1		*REAR FENDER O/S	Dented / Buckled	1,340.80 F	*1,340.80 FL
24	1		*REAR FENDER OUTER RAILING O/S	Repair	422.70 F	*- FL
25	1		*REAR FENDER OUTER RAILING GARNISH O/S	Missing	508.20 F	*508.20 FL
26	1		*REAR FENDER GLASS O/S	Cut / Necessary	931.50 F	*931.50 FL
27	1		*REAR FENDER INNER TRIM BOARD O/S	Deformed / Torn	839.67 F	*839.67 FL
28	1		*REAR AIR CON BLOWER ASSY O/S	Cracked	3,800.10 F	*2,761.76 FL
29	1		*REAR FLOOR PANEL TOP BOARD	Not Necessary	855.10 F	*- FL
30	1		*REAR WINDSCREEN SEALANT	Necessary	50.00 FS	*40.00 FS
31	1		*REAR WINDSCREEN INNER SEAL	Necessary	50.00 FS	*40.00 FS
32	1		*REAR WINDSCREEN SOLAR FILM	Necessary	180.00 FS	*150.00 FS
33	1		*SET REAR WINDSCREEN REAR VIDEO CAM	Missing	500.00 FS	*380.00 FS
34	1		*REAR FENDER GLASS SEALANT O/S	Necessary	50.00 FS	*40.00 FS
35	1		*REAR FENDER GLASS SOLAR FILM O/S	Necessary	220.00 FS	*150.00 FS
36	1		*SET REAR BUMPER CLIPS	Necessary	50.00 FS	*50.00 FS
37	1		*SET REAR BUMPER REVERSE SENSOR	Not Necessary	280.00 FS	*- FS
38	1		*SET REAR FENDER INNER TRIM BOARD CLIPS O/S	Not Necessary	50.00 FS	*- FS
39	1		*SET REAR FENDER OUTER RAILING GARNISH CLIPS O/S	Necessary	30.00 FS	*30.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$) 20,465.16 12,563.09
- List Item Discount on L Items 0.00/25.00% (S\$) 0.00 2,920.77

Total Parts (S\$) 20,465.16 9,642.32

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CHECK WIRING	New	50.00	20.00
2	TO DISMANTLE & REPLACED REAR WINDSCREEN	New	150.00	120.00
3	TO TRANSFER TAILGATE MECHANISM	New	100.00	0.00
4	TO DISMANTLE & REFIX CUSHION UPHOLSTERY	New	150.00	100.00
5	TO DISMANTLE & REPLACED REAR AIR CON BLOWER	New	150.00	100.00
6	TO DISMANTLE & REPLACED REAR FENDER GLASS O/S	New	150.00	120.00
7	TO REFILL AIR CON GAS	New	120.00	100.00
8	TO SPRAY RUST PROOFING	New	180.00	60.00
9	TO RESET & REPROGRAMME SYSTEM	New	180.00	80.00
10	LABOUR FOR PANEL BEATING & REPLACED PARTS	New	1,800.00	1,000.00
11	TO PUTTY & SPRAY PAINTING	New	1,800.00	1,000.00
Gross Labour Cost (\$\$)			4,830.00	2,700.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >