

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

India International Insurance Pte Ltd
64 Cecil Street, #04-00 IOB Building
Singapore 049711

Our File No: CS/III21012110/UUF3N2**Date:** 16/12/2021**REFERENCE**

Insured/Claimant: JOE'S SEAFOOD TRADING Policy No: D21MCV0007106
Date of Loss: 28/11/2021 Nature of Claim: OD Claim No: MCV2021D0005236

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **GBK6215B**
Make & Model: TOYOTA DYNA 1.5T, 3.0 (A) Engine No: 1KD2864104
Reg. Date: 28/09/2020 (Man. Year: 2019) Chassis No: KDY2318039935
Colour: White Odometer: 32538 km
Engine Capacity: 2982 cc
Market Value/New Car Price: S\$75,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 175/75R15 Rear Tyre Size: 175/75R15
Front Left Side: Dunlop 6 mm Rear Left Side: Dunlop 6 mm
Front Right Side: Dunlop 6 mm Rear Right Side: Dunlop 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	14,776.80	8,985.55	5,791.25	39.19
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,800.00	4,100.00	2,700.00	39.71
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	21,576.80	13,085.55	8,491.25	39.35
- Excess (S\$)	600.00	600.00	0.00	0.00
(S\$)	20,976.80	12,485.55	8,491.25	40.48
+ GST 7.00/7.00% (S\$)	1,468.38	873.99	594.39	40.48
Nett Amount (S\$)	22,445.18	13,359.54	9,085.64	40.48

INSPECTION

Date of Assignment: 30/11/2021
Date Inspected: 30/11/2021 Inspected At: Hup Motor Trading & Service (HQ)
Blk 9004 Tampines Street 93, #01-120
Singapore 528838
Estimated Period of Repair: 10.0 days

Adjuster: MARCUS CHUA**Manager:** Tan Hui Zhen

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 16 Dec 2021)	
Parts:	N/A	TOYOTA DYNA 1.5T 3.0 (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GBK6215B)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Distorted	683.90 FL	*683.90 FL
2	1		*FRONT BUMPER O/S & N/S BRACKET	N/s Bent/O/s Not Necessary	423.20 FL	*211.60 FL
3	1		*FRONT BUMPER N/S FOG LAMP ASSY	Broken	299.30 FL	*299.30 FL
4	1		*FRONT CENTRE CROSS BAR MEMBER	Repair	264.40 FL	*- FL
5	1		*FRONT N/S TOW BAR BRACKET	Repair	128.80 FL	*- FL
6	1		*O/S & N/S HEAD LAMP ASSY	N/s Cracked/ O/s Not Necessary	1,790.20 FL	*895.10 FL
7	1		*O/S & N/S HEAD LAMP LOWER BRACKET	N/s Cracked	82.40 FL	*41.20 FL
8	1		*FRONT N/S CORNER PANEL	Repair	288.40 FL	*- FL
9	1		*FRONT CENTRE PANEL	Badly Dented	1,226.60 FL	*1,226.60 FL
10	1		*FRONT CENTRE GRILLE PANEL	Cracked	650.50 FL	*650.50 FL
11	8		*FRONT CENTRE GRILLE PANEL CLIPS	Necessary	65.60 FL	*65.60 FL
12	1		*FRONT CENTRE TOP GRILLE (BLACK)	Scratched	170.40 FL	*170.40 FL
13	6		*FRONT CENTRE TOP GRILLE CLIPS STOPPER	Necessary	37.20 FL	*37.20 FL
14	1		*FRONT CENTRE TOP GRILLE LOGO EMBLEM	Scratched	70.40 FL	*70.40 FL
15	1		*FRONT CENTRE LOWER PANEL DYNA EMBLEM	Necessary	60.70 FL	*60.70 FL
16	1		*FRONT O/S DOOR	Dented	1,349.40 FL	*1,349.40 FL
17	2		*FRONT O/S DOOR TOP & LOW HINGE	Twisted	162.80 FL	*162.80 FL
18	1		*FRONT O/S DOOR CHECKER	Twisted	127.80 FL	*127.80 FL
19	2		*FRONT O/S & N/S DOOR BLACK STICKER	Necessary	90.00 FL	*90.00 FL
20	1		*FRONT O/S & N/S DOOR SIGNAL LAMP ASSY	O/s Cracked	162.20 FL	*81.10 FL
21	1		*FRONT O/S DOOR WEATHERSTRIP	Necessary	186.40 FL	*186.40 FL
22	1		*FRONT O/S DOOR INNER TRIM BOARD COVER	Not Necessary	491.50 FL	*- FL
23	20		*FRONT O/S DOOR INNER TRIM BOARD CLIPS	Not Necessary	124.00 FL	*- FL
24	1		*FRONT O/S DOOR AUDIO SPEAKER	Not Necessary	262.20 FL	*- FL
25	1		*FRONT O/S DOOR POWER WINDOW REGULATOR	Not Necessary	295.60 FL	*- FL
26	1		*FRONT O/S DOOR INNER LOCK	Jammed	285.90 FL	*285.90 FL
27	1		*FRONT O/S DOOR PILLAR PANEL	Repair	392.20 FL	*- FL
28	1		*FRONT WINDSCREEN GLASS WEATHERSTRIP	Not Necessary	288.60 FL	*- FL
29	1		*FRONT O/S STEP GARNISH	Deformed	318.30 FL	*318.30 FL
30	1		*FRONT O/S WHEEL PANEL	Repair	390.50 FL	*- FL
31	1		*FRONT O/S WHEEL PANEL RUBBER SEAL	Twisted	36.20 FL	*36.20 FL
32	8		*FRONT O/S WHEEL PANEL SEAL CLIPS	Not Necessary	36.00 FL	*- FL
33	1		*O/S WHEEL MUDGUARD GARNISH	Deformed	179.90 FL	*179.90 FL
34	1		*RADIATOR SPARE TANK	Deformed	133.30 FL	*133.30 FL
35	1		*AIR CLEANER BOX }	Cracked	671.80 FL	*671.80 FL
36	1		*AIR CLEANER COVER }		76.10 FL	*- FL
37	1		*AIR FILTER	Missing	71.20 FL	*71.20 FL
38	1		*FUEL TANK	Repair	774.40 FL	*- FL
39	1		*O/S TAIL GATE DOOR COMBINATION BRACKET	Repair	198.70 FL	*- FL
40	1		*O/S TAIL GATE DOOR COMBINATION BUSH	Missing	32.20 FL	*32.20 FL
41	1		*FRONT O/S TYRE	Serviceable	350.00 FL	*- FL
42	1		*FRONT O/S SHOCK ABSORBER	Bent	102.90 FL	*102.90 FL
43	1		*FRONT O/S UPPER ARM	Serviceable	1,185.70 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
44	1		*FRONT O/S LOWER ARM	Bent/Twisted	590.90 FL	*590.90 FL
45	1		*FRONT O/S WHEEL BEARING & HUB	Not Necessary	308.30 FL	*- FL
46	1		*SET STEERING RACK END	Not Necessary	119.20 FL	*- FL
47	1		*AIR COND CONDENSER (WITH FAN MOTOR,COWLING,BLADE)	Bent	1,980.70 FL	*1,980.70 FL
48	1		*AIR COND CONDENSER BRACKET	Bent	276.00 FL	*276.00 FL
49	1		*AIR COND SUCTION HOSE	Dented	473.30 FL	*473.30 FL
50	1		*AIR COND DRYER	Not Necessary	137.00 FL	*- FL
51	1		*FRONT NUMBER PLATE	Cracked	45.00 FS	*20.00 FS
52	1		*FRONT O/S WHEEL RIM	Dented	340.80 FS	*80.00 FS
53	1		*SET BALLJOINT	Twisted	284.80 FL	*284.80 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	19,573.80	11,947.40
- List Item Discount on L Items 25.00/25.00% (\$\$)	4,797.00	2,961.85
Total Parts (\$\$)	14,776.80	8,985.55

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TOWING CHARGE (KING DOLLY)	New	120.00	120.00
2	TO REMOVE & REFIX DASHBOARD,STEERING CLOMUN SHAFT,AIR COND BLOWER MOTOR,BRAKE MASTER PUMP,PEDAL BRACKET & NECESSARY PARTS	New	380.00	200.00
3	TO WIRING CHECK UP & ADJUST HEADLIGHT ALIGNMENT	New	80.00	30.00
4	TO REMOVE,REFIX AIR COND PARTS & REFILL RA134 GAS	New	150.00	100.00
5	TO REMOVE,REFIX FRONT WINDSCREEN GLASS	New	120.00	80.00
6	TO REMOVE & REFIX FRONT O/S SHOCK ABSORBER,LOWER ARM,UPPER ARM,BEARING,STEERING TIERODEND,RACKEND & NECESSARY PARTS	New	300.00	150.00
7	TO CHECK & ADJUST FRONT WHEEL ALIGNMENT & BALANCING	New	150.00	60.00
8	TO REMOVE & REFIX FUEL TANK,BRACKET & NECESSARY PARTS	New	150.00	60.00
9	LABOUR CHARGE TO REMOVE & CUT OUT DAMAGED PARTS,TO JACK,STRAIGHTEN & KNOCKING OUT FRONT CENTRE CROSS MEMBER,FRONT PANEL,WHEEL PANEL & NECESSARY PARTS,TO WELD,RENEW & ALIGN ABOVE PARTS	New	2,800.00	1,800.00
10	TO RESPRAY TUFF-KOTE ON ALL AFFECTED ACCIDENT PARTS	New	150.00	0.00
11	TO PUTTY & RESPRAY PAINTING ON ALL AFFECTED ACCIDENT PARTS	New	2,400.00	1,500.00
Gross Labour Cost (\$\$)			6,800.00	4,100.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >