



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2303091
INV Date 17/05/2023
Reference CC4/LPC21012140/Kpa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SJW 2324M
Insured Veh. SLM 1694E
Claim No. 21/21/21/VP05/025203
Policy No. Z21VP05028589
Accident Date 28/11/2021
Inspection Date 30/11/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD

300 BEACH ROAD

#17-04/07 THE CONCOURSESINGAPORE 199555

Ref: CC4/LPC21012140/Kpa3q2

Date: 17/05/2023

Code: LPC2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SLM 1694E	Veh. Inspected	SJW 2324M
Policy No.	Z21VP05028589	Coverage (\$)	0.00
Claim No.	21/21/21/VP05/025203	Excess (\$)	0.00
Assign From	GERALD	Assign Date	30/11/2021

2. Vehicle Particulars & Condition

Make & Model	VOLKSWAGEN JETTA (A)	c.c	1390
Engine No.	HIDDEN	Year of Reg.	2010
Chassis No.	WVWZZZ1KZAM076865	Colour	METALLIC BLACK
Odometer	162676 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/55 R16	KUMHO	5 mm
L/H Front Tyre	205/55 R16	KUMHO	5 mm
R/H Rear Tyre	205/55 R16	KUMHO	5 mm
L/H Rear Tyre	205/55 R16	KUMHO	5 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR & FRONT PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	28/11/2021	Inspection Date	30/11/2021
Survey held at	S & H MOTOR PTE LTD 160 SIN MING DRIVE #07-02 SIN MING AUTOCITY SINGAPORE 575722		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **7 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJW 2324M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT GRILLE (WCP)	CRACKED	580.00	310.00
1	FRONT GRILLE EMBLEM (WCP)	CRACKED	95.00	95.00
1	FRONT BUMPER NUMBER PLATE HOLDER (WCP)	DENTED	30.00	30.00
1	FRONT BUMPER SPONGE (WCP)	SERVICEABLE	45.00	-
1	FRONT BUMPER REINFORCEMENT (WCP)	TO REPAIR SEE LABOUR	280.00	-
1	REAR BOOT (WCP)	BENT	820.00	820.00
1	REAR BOOT BADGE 'JETTA' (WCP)	NECESSARY	60.00	60.00
1	REAR BOOT EMBLEM (WCP)	NECESSARY	70.00	70.00
1	REAR BOOT INNER LOCK (WCP)	TO REPAIR SEE LABOUR	120.00	-
1	REAR BOOT WEATHERSTRIP (WCP)	DISTORTED / DENTED	160.00	160.00
1	RH REAR BOOT HINGE (WCP)	TO REPAIR SEE LABOUR	65.00	-
1	LH REAR BOOT HINGE (WCP)	TO REPAIR SEE LABOUR	65.00	-
1	LH OUTER TAIL LAMP (WCP)	CUT	190.00	190.00
1	REAR BUMPER (WCP)	BUCKLED	550.00	550.00
1	REAR BUMPER LOWER CENTRE MOULDING (WCP)	DENTED	390.00	390.00
1	REAR BUMPER REINFORCEMENT (WCP)	BENT	320.00	320.00
1	REAR BUMPER SPONGE (WCP)	SERVICEABLE	80.00	-
1	REAR BUMPER CENTRE BRACKET (WCP)	TO REPAIR SEE LABOUR	65.00	-
1	REAR END PANEL (WCP)	BENT	1,380.00	500.00
1	REAR END PANEL TOP TRIM (WCP)	SERVICEABLE	125.00	-
	COST PLUS 15%		823.50	524.25
			6,313.50	4,019.25
<u>SPECIAL NETT ITEMS</u>				
1	FRONT NUMBER PLATE (SN)	BENT	45.00	45.00
1	SET REAR PARKING SENSOR (SN)	SERVICEABLE	260.00	-
			305.00	45.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO REMOVE FRONT DAMAGED PARTS ,TO RESHAPE AND REPAIR HEAD LAMP INNER PANEL,FRONT SUPPORT PANEL ,FRONT BUMPER ,TO REPLACE DAMAGED PARTS AND ADJUST BODY PANEL ALIGNMENT.		450.00	200.00
	TO SPRAY PAINT AFFECTED FRONT AND INNER DAMAGED PORTION INCLUSIVE OF PREPARATORY WORKS AND MATERIAL.		420.00	200.00
	TO REMOVE REAR DAMAGED PARTS TO JACK OUT REAR END PANEL AND REAR FLOOR PANEL AND CUT OUT BODY PANEL ,TO REWELD ,RESHAPE AND REPAIR REAR END PANEL ,REAR FLOOR PANEL,REAR BODY PANEL ,TO STRAIGHTEN OUT REAR CHASSIS MEMBER ,TO REPLACE DAMAGED PARTS AND ADJUST REAR BODY AND BOOT ALIGNMENT.INCLUSIVE OF THE REPAIR OF FRONT BUMPER REINFORCEMENT,REAR BOOT INNER LOCK,RH REAR BOOT HINGE,LH REAR BOOT HINGE AND REAR BUMPER CENTRE BRACKET.		850.00	600.00
	TO SPRAY PAINT AFFECTED REAR AND INNER DAMAGED PORTION INCLUSIVE OF PREPARATORY WORKS AND MATERIAL.		950.00	600.00
	TO DISCONNECT WIRE HARNESS TO FACILITATE REPAIRS AND CHECK FOR DAMAGE AND RECONNECT WIRING SYSTEM SYSTEM AND CHECK FOR FULL FUNCTIONALITY.TO PERFORM COMPUTER DIAGNOSTIC ON DRIVETRAIN ABS SYSTEMS ,PARKING SYSTEM,HEADLAMP SYSTEMS AND CLEAR FAULT CODES.	NOT NECESSARY	150.00	-
	TO APPLY ANTI-CORROSION TUFF-KOTE.		100.00	60.00
			2,920.00	1,660.00
	GRAND TOTAL		9,538.50	5,724.25
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			4,550.00

Report Ref No. CC4/LPC21012140/Kpa3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJW 2324M

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJW 2324M

RE-INSPECTION

