

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/CTI21012300/VQY3N2**Date:** 09/12/2021REFERENCE

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMB1SNW00013822102

Claimant Vehicle No : FBR3246U **Insured Vehicle No :** PC8576Y

Date of Loss: 28/11/2021 Nature of Claim: TP Claim No: SNM21D206992/C02/LEEPG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **FBR3246U**

Make & Model: YAMAHA AEROX GDR155A, 155cc CVT ABS Engine No: G3J1E0530671

Reg. Date: 28/04/2020 (Man. Year: 2020) Chassis No: MH3SG4620LJ076594

Colour: White/Red Odometer: 56977 km

Engine Capacity: 155 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 110/80-14 Rear Tyre Size: 110/80-14

Front Left Side: Cheng Shin 5 mm Rear Left Side: Cheng Shin 5 mm

Front Right Side: 0 mm Rear Right Side: 0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 07/12/2021

Date Inspected: 06/12/2021 Inspected At: S1 Motoring (HQ)
BLOCK 3006 UBI ROAD 1, #01-366
Singapore 408700

Estimated Period of Repair: 5.0 days

Adjuster: Thevan Thomas Karthikesavan**Manager:** SHIAU CHAN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000.00
-\$5,000.00

REPAIR DETAILS

Reference

Part Source: (Last Synchronised: 09 Dec 2021)

Parts: N/A YAMAHA AEROX GDR155A 155cc CVT ABS (Model not available in database)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for FBR3246U)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >