

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI21012375/R1TY3N2**Date:** 26/01/2022**REFERENCE**Handling Insurer: China Taiping Insurance
(Singapore) Pte. Ltd.

Policy No: DMPCSNW00192862100

Claimant Vehicle No : SMY3142T**Insured Vehicle No :** SDM9498Y

Date of Loss: 04/12/2021

Nature of Claim: TP

Claim No: SNM21D207080/C02/IRENE

DESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **SMY3142T**

Make & Model: BMW 116D, 1.5 (A)

Engine No: 37029568B37D15A

Reg. Date: 25/05/2016 (Man. Year: 2016)

Chassis No: WBA1V72040V724608

Colour: Grey

Odometer: 58350 km

Engine Capacity: 1496 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price****CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55R16	Rear Tyre Size:	205/55R16
Front Left Side:	Pirelli 6 mm	Rear Left Side:	Pirelli 6 mm
Front Right Side:	Pirelli 6 mm	Rear Right Side:	Pirelli 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	150.00	40.00	110.00	73.33
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,667.00	2,004.00	663.00	24.86
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	2,817.00	2,044.00	773.00	27.44
+ GST 7.00/7.00% (S\$)	197.19	143.08	54.11	27.44
Nett Amount (S\$)	3,014.19	2,187.08	827.11	27.44

INSPECTION

Date of Assignment: 07/12/2021

Date Inspected: 03/01/2022 Inspected At:

Performance Motors Limited (Alexandra)
303 Alexandra Road, Sime Darby Performance
Centre
Singapore 159941

Estimated Period of Repair: 3.0 days

Adjuster: MOHD RASUL**Manager:** DENISE TAY KWEE CHENG*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 25 Jan 2022)
Parts:	144	BMW 116D 1.5 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMY3142T)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*SUNDRIES	Necessary	150.00 FS	*40.00 FS
						F=Franchise part. S=SpcNett.
Total Parts (S\$)					150.00	40.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	REMOVE REAR BUMPER INCLUDE ATTACHMENT ETC	New	1,275.00	850.00
2	PAINTING REAR BUMPER	New	1,038.00	986.00
3	TO CHECK ELECTRICAL WIRING SYSTEM AND LIGHTING AT THE REAR SECTION FOR PROPER FUNCTION	New	177.00	168.00
4	TO REMOVE OLD PDC ASSEMBLY,REPLACE DAMAGED PARTS AND RECONNECT TO NEW BUMPER INCLUDING CONDUCT CHECK FOR PROPER FUNCTION	New	177.00	0.00
Gross Labour Cost (\$)			2,667.00	2,004.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >