

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC3/AIG21012380/KRA3Q2**Date:** 14/03/2023**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2070005860-01
Claimant Vehicle No :	SML8528A	Insured Vehicle No :	GBC3593X
Date of Loss:	03/12/2021	Nature of Claim:	TP
		Claim No:	1614883540SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SML8528A		
Make & Model:	TOYOTA PRIUS, 1.8 5DR HATCHBACK (A)	Engine No:	2ZR2C54077
Reg. Date:	07/06/2019 (Man. Year: 2018)	Chassis No:	JTDKB3FU403083512
Colour:	Metallic Red	Odometer:	280471 km
Engine Capacity:	1798 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	Firenza 8 mm	Rear Left Side:	Sailun 8 mm
Front Right Side:	Firenza 8 mm	Rear Right Side:	Sailun 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,004.47	1,004.47	0.00	0.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,350.00	140.00	3,210.00	95.82
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	4,354.47	1,144.47	3,210.00	73.72
+ GST 7.00/7.00% (S\$)	304.81	80.11	224.70	73.72
Nett Amount (S\$)	4,659.28	1,224.58	3,434.70	73.72
+ Loss of Use (3.0 x S\$50.00/day) (S\$)		150.00		
+ Car Rental (3.0 x S\$65.00/day) (S\$)		195.00		
+ Doc/Search Fee (S\$)		7.45		
Nett Liability (S\$)		1,577.03		

INSPECTION

Date of Assignment:	06/12/2021		
Date Inspected:	06/12/2021	Inspected At:	Trans-cab Auto Services Pte Ltd No 2 Ang Mo Kio Street 63 Singapore 569111
Estimated Period of Repair:	1.0 days		

Adjuster: KENNETH KONG**Manager:** Ezlyna

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*MIRROR ASSY ,OUTER REAR VIEW RH	Broken	1,339.30 FL	*1,339.30 FL
F=Franchise part. L=ListItemDisc.						
Sub Total (S\$)					1,339.30	1,339.30
- List Item Discount on L Items 25.00/25.00% (S\$)					334.83	334.83
Total Parts (S\$)					1,004.47	1,004.47

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER ,TO ENABLE REPAIR	New	380.00	0.00
2	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.	New	1,400.00	60.00
3	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION	New	1,400.00	60.00
4	TO CHECK ELECTRICAL LIGHTING CONCERNED	New	170.00	20.00
Gross Labour Cost (\$\$)			3,350.00	140.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >